



Assembly Instructions

1) Slide the ferrule onto the cable. Strip the cable to the dimensions shown. Take care not to nick the centre conductor or braid.


A = 6mm
B = 6mm
C = 3mm

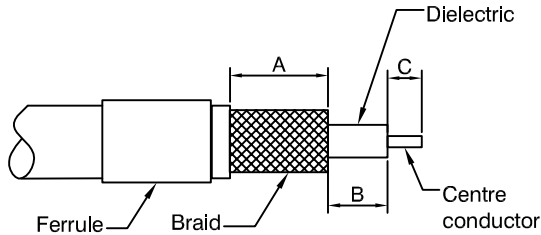

2) Crimp the contact onto the centre conductor.

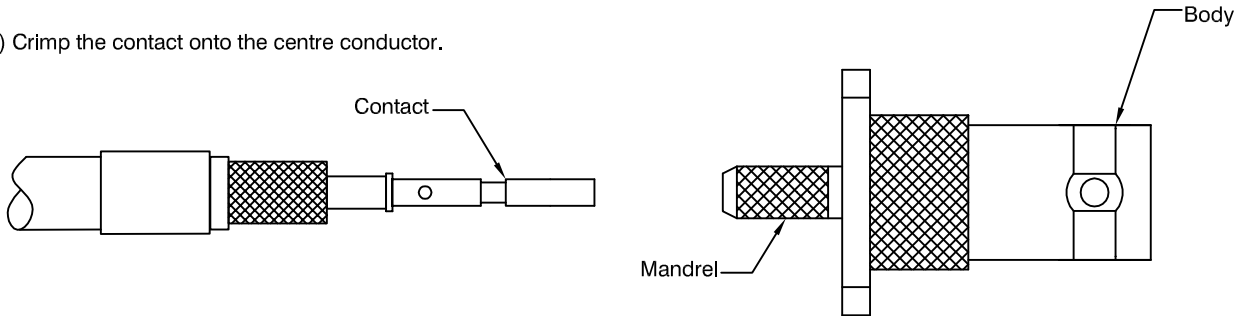

3) Insert the contact into the body and ensure that it captivates. Make sure that the braid is on the outside of the mandrel. Slide the ferrule over the braid until the ferrule butts up against the body. Crimp the ferrule using the correct tool for the connector.

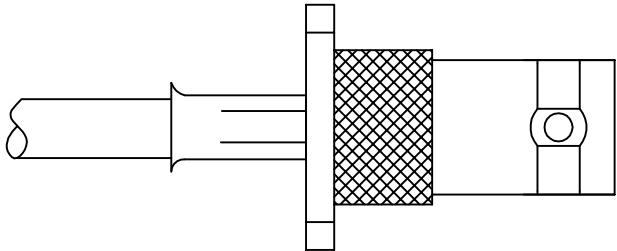

Connector Part Number	Stripping Tool Part Number	Crimp Tool Part Number	Hex Size	
			Pin	Ferrule
VB50-2031	VX1305	DCC1113	1.72	6.48
VB50-2050	VX1305	DCC1113	1.72	5.41
VB50-2051	VX1305	DCC1113	1.72	5.41
VB50-2061	VX1305	DCC0908	1.69	4.52
VB50-2061-1602	VX1305	DCC0908	1.69	4.52
VB50-2071	VX1305	DCC0908	1.69	4.52
VB50-2071-1602	VX1305	DCC0908	1.69	4.52
VB50-2072	VX1305	DCC0908	1.69	4.52

First Issue	SN	1	30 July 01
DESCRIPTION OF REVISION	APPVD	ISS	DATE



Connectivity Solutions
7-13 Russel Way,
Widford Industrial Estate,
Chelmsford, Essex,
CM1 3AA, UK.
Tel: +44 (0) 1245 359515
Fax: +44 (0) 1245 358938

SCALE: Not To Scale	DRAWN BY:	S Nash
DIMENSIONS: mm	CHECKED BY:	S Nash
TOLERANCES:	APPROVED BY:	P Couzens
	DATE:	30 July 01

DESCRIPTION:

Stripping and Assembly
Instructions for BNC Flange
mount Crimp Jack

DRAWING NUMBER:
VAIB5101
PAGE: 1 OF 1