# DP2 SERIES

# **High-performance Digital Pressure Sensor**







# Complete functionality! Selection from a wide **lineup**

Passed the UL 991 Environment Test





UL 61010C-1 compatible, Passed the UL 991 Environment Test based on SEMI S2-0200. [Category applicable for semiconductor manufacturing: TWW2, Process Equipment] [Applicable standards: UL 61010C-1] [Additional test / evaluation standards as per intended use: UL991, SEMI S2-0200]

# High accuracy · high resolution · high speed

It achieves a 2.5 ms, or less, response time at a high resolution of 1/1,000. It enables highly accurate sensing with its excellent repeatability and temperature characteristics.

Response time





### Clearly visible LED display with 31/2 digits

Bright red LED 7-segment display having 31/2 digits, 10 mm 0.394 in high. The displayed figures are remarkably noticeable not only in a dark area, but also in a well-lit place.




# Setting with easy key operation

Initialization and threshold value settings are easily done by key operation while seeing the values on the display.




# Four output modes enable versatile pressure level control

#### 1 Hysteresis mode

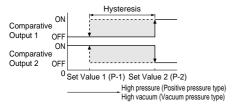


The common hysteresis of the comparative outputs can be set, as desired, with the set values.

#### 3 Dual output mode

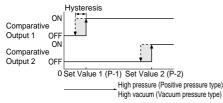


The outputs can be put to different use, such as, detection of different kinds of objects, control function, alarm function etc.

# 2 Window comparator mode

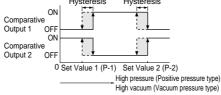

The comparative outputs can be turned ON or OFF by a pressure which is within the pressure range set by Set Value 1 and Set Value 2.

### 4 Automatic sensitivity setting mode

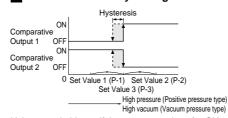


Using actual objects, if the pressure values for OK objects and NG objects are input, then the sensor is automatically set to the optimum pressure value (mid-value).

# Selection from six pressure units

The pressure unit can be selected from six different systems to suit your requirement.

The selectable pressure units differ with the sensor type. When the pressure unit is changed, the measured pressure value and the set values are automatically converted.

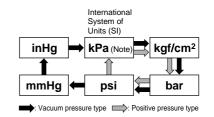


Note: 'MPa' in case of DP2-22□, DP2-42□ and DP2-62□.

#### **APPLICATIONS**


#### Confirmation of chip component suction

The light weight type does not disturb the movement of the suction head, even if it is mounted close to the head.

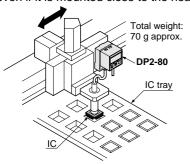


#### Verifying placement of frame

High pressure is attained when the frame is exactly seated. Hence, the pressure change when the frame is exactly placed is detected.

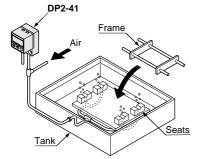


### **Controlling clamping force**

The clamping force can be changed to suit the workpiece by controlling the supplied air pressure.

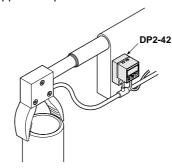


# **Detecting tap breakage**

Two opposed nozzles are supplied air at different pressures. If the tap breaks, the pressure at the lower pressure side nozzle is affected by the air of the higher pressure side nozzle. This change in pressure is detected.

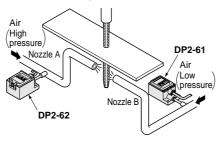


# Inspecting orientation of glass sheet

The orientation of the glass sheet can be recognized by detecting the change in vacuum due to presence / absence of indentation.

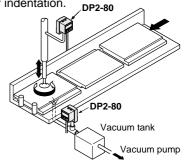

# Controlling edge of winding film

With bifurcated nozzles placed on both sides of the film, the position of the winding film is recognized as right-shifted (high pressure), OK (middle pressure), or left-shifted (low pressure).

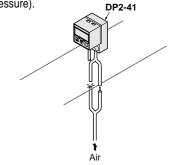

# Analog voltage output incorporated as a standard

Since a linear analog voltage output (1 to 5 V) is incorporated, the sensor is ideally suited for real time monitoring or for remote control in combination with an analog controller (ultra-compact digital panel controller CA2 series, or digital panel controller CA series).

#### Peak hold / bottom hold display

The peak value or the bottom value of the varying pressure can be displayed. This function is convenient for finding the pressure variation range or for determining a reference for pressure settings.

#### Analog bar display


Pressure changes can also be displayed in an analog fashion using LED bars. Hence, sudden pressure changes can be recognized at a glance.


LED bars indicate the pressure level in steps of 10 % F.S., regardless of the pressure unit.




# A Wide Variety of Models

Models are selectable according to mounting style, environmental resistance, and manner of use.

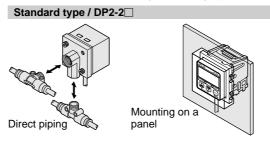

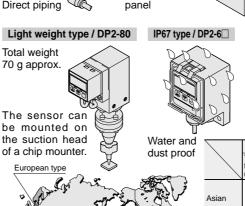

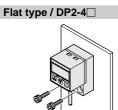

Direct mounting on a wall

The **DP2** series covers world-wide usage with the Asian type, the North American type and the European type. Each type provides the customary pressure unit, suitable transistor output, and pressure port.

	Pres	sure unit		Pressure port	
	The interna- tional system of unit (SI)		Output		
Asian		kgf/cm² (Positive pressure type) mmHg (Vacuum pressure type)	NPN and analog voltage	Rc (PT) <sup>1</sup> / <sub>8</sub> or M5 female thread	
North American	Pa	psi (Positive pressure type) inHg (Vacuum pressure type)	NPN and	NPT <sup>1</sup> / <sub>8</sub> or NPTF <sup>1</sup> / <sub>8</sub> female thread	
European		bar	PNP and analog voltage	G (PF) <sup>1/8</sup> female thread	

# **ORDER GUIDE**

DP2

	Ту	ре		Appearance	Rated pressure range	Model No.	Pressure port	Comparative output		
	ssure	type	Asian			DP2-20	Rc (PT) <sup>1</sup> / <sub>8</sub> female thread	NPN open-collector		
	Vacuum pressure	101 kPa type	ican		0 to - 101.3 kPa	DP2-20F	NPTF 1/8	transistor		
	Vacuu	<u> </u>	North American			DP2-20F-P	female thread	PNP open-collector transistor		
p.		type	Asian	CONTRACTOR OF THE PARTY OF THE		DP2-21	Rc (PT) <sup>1</sup> / <sub>8</sub> female thread	NPN open-collector transistor		
Standard	re	100 kPa type	North American	1000	0 to 100.0 kPa	DP2-21F	NPTF <sup>1</sup> / <sub>8</sub>	แสกรเรเบ		
O)	Positive pressure	10		000		DP2-21F-P	female thread	PNP open-collector transistor		
	ositive	be	Asian	-		DP2-22	Rc (PT) <sup>1</sup> / <sub>8</sub> female thread	NPN open-collector		
	Д	MPa type	North American		0 to 1.000 MPa	DP2-22F	NPTF 1/8	transistor		
		1	Nor			DP2-22F-P	female thread	PNP open-collector transistor		
Light weight	Vacuum pressure	- 101 kPa type	Asian	-1000	0 to − 101.3 kPa	DP2-80	M5 female thread	NPN open-collector transistor		
	Va	'	North American			DP2-40N	NPT <sup>1</sup> / <sub>8</sub> female thread			
Flat			European			DP2-40E	G (PF ) <sup>1</sup> / <sub>8</sub> female thread	PNP open-collector transistor		
Ĕ		kPa ty North American	Asian	Gradie com	0 to 100.0 kPa	DP2-41	Rc (PT) <sup>1</sup> / <sub>8</sub> female thread	NPN open-collector		
	re		North American	-1000		DP2-41N	NPT <sup>1</sup> / <sub>8</sub> female thread	transistor		
	Positive pressure	10(	European	500		DP2-41E	G (PF) 1/8 female thread	PNP open-collector transistor		
	ositive		Asian			DP2-42	Rc (PT) <sup>1</sup> / <sub>8</sub> female thread	NPN open-collector		
	ъ	1 MPa t	North American		0 to 1.000 MPa	DP2-42N	NPT 1/8 female thread	transistor		
			European	European			DP2-42E	G (PF) <sup>1/8</sup> female thread	PNP open-collector transistor	
	ssure	type	Asian			DP2-60	Rc (PT) <sup>1</sup> / <sub>8</sub> female thread	NPN open-collector		
	Vacuum pressure	- 101 kPa type	Enroped	North American	American American 0 to -10	0 to - 101.3 kPa	DP2-60N	NPT <sup>1</sup> / <sub>8</sub> female thread	transistor	
	Vacu				DP2-60E	G (PF) <sup>1/8</sup> female thread	PNP open-collector transistor			
		100 kPa type	an	Asian	DP2-61	Rc (PT) 1/8 female thread	NPN open-collector			
1P67	Э		) kPa t	kPa t	North American		0 to 100.0 kPa	DP2-61N	NPT <sup>1</sup> / <sub>8</sub> female thread	transistor
	oressu	100	European			DP2-61E	G (PF) <sup>1</sup> / <sub>8</sub> female thread	PNP open-collector transistor		
	Positive pressure	ed	Asian	ı		DP2-62	Rc (PT) <sup>1</sup> / <sub>8</sub> female thread	NPN open-collector		
	ď	MPa type	North American	ı	0 to 1.000 MPa	DP2-62N	NPT <sup>1</sup> / <sub>8</sub> female thread	transistor		
		-	European			DP2-62E	G (PF) <sup>1</sup> / <sub>8</sub> female thread	PNP open-collector transistor		

# **ORDER GUIDE**


# 5 m 16.404 ft cable length type

5 m 16.404 ft cable length type is also available. (Standard: 2 m 6.562 ft)

		Туре		Standard	5 m 16.404 ft cable length type
				DP2-20	DP2-20-C5
	Vacuum pressure	- 101 kPa type	DP2-20F		
			DP2-20F-P		
7	2			DP2-21	DP2-21-C5
	Standard		100 kPa type	DP2-21F	
ć	กั	Positive pressure		DP2-21F-P	
		Positive pressure		DP2-22	DP2-22-C5
			1 MPa type	DP2-22F	
				DP2-22F-P	
	ight			DP2-80	DP2-80-C5
	Light weight	Vacuum pressure	- 101 kPa type	DP2-40N	
	Ligh			DP2-40E	
				DP2-41	DP2-41-C5
Ė	<u> </u>	Positive pressure	100 kPa type	DP2-41N	
				DP2-41E	
				DP2-42	DP2-42-C5
			1 MPa type	DP2-42N	
				DP2-42E	
				DP2-60	
		Vacuum pressure	- 101 kPa type	DP2-60N	
				DP2-60E	
IP67			DP2-61	TI 1007 : 11 : 1	
		100 kPa type	DP2-61N	The IP67 type is the standard type with a 5 m 16.404 ft cable.	
	Positive pressure		DP2-61E		
	1 contro procedure		DP2-62		
		1 MPa type	DP2-62N		
				DP2-62E	

# **Accessories**

- DPX-01 [Pressure port attachment (Standard type only)]
- DPX-02 [Hexagon-socket-head plug for pressure port (Standard type only)]

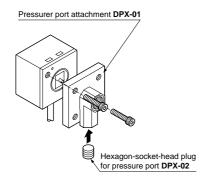

# **OPTIONS**


Designation	Model No.	Description					
Sensor mounting	MS-DPX	Mounting bracket for standard type  [Two M4 (length 6 mm 0.236 in) pan head screws and two spring] washers are attached.					
bracket (For standard type)	MS-DPX-4		ng bracket for standard type nm 0.236 in) pan head screws and two spring ed.				
Straight bush	DPX-03	Changes the pressure port from female thread [Rc (PT) $^{1/8}$ ] to male thread [R (PT) $^{1/8}$ ]					
Panel mounting bracket (For standard type)	MS-DPX-2	It can be used for mounting on a panel (1 to 3.2 mm 0.039 to 0.126 in thick).					
Front protection cover (For standard type)	DPX-04	It protects the sensor's adjustment panel. (It can be fitted when the panel mounting bracket is used.)					
Digital panel	CA2-T2	NPN open-collector transistor	This is a very small controller which allows two independent threshold level settings.  • Supply voltage: 24 V DC ± 10 %  • No. of inputs: 1 No. (sensor input)  • Input range: 1 to 5 V DC  • Main functions:  Threshold level setting function, zero-adjust function, scale setting function, hysteresis setting function, start / hold function, autoreference function, power supply ON-delay function, etc.				
(Note)	CA-R2	Relay contact	This is a multi-functional controller having mathematical functions, hold function, etc.  • Supply voltage: 100 to 240 V AC ± 10 %  • No. of inputs: 2 Nos. (sensor inputs)				
	CA-T2	NPN open-collector transistor	<ul> <li>Input range: 1 to 5 V DC</li> <li>Power supply for sensor: 12 V DC, 150 mA</li> <li>Main functions: Mathematical functions, process number</li> </ul>				
	CA-B2	NPN open-collector transistor With BCD output	selection function, hold function, scaling function, auto-reference function, power supply ON-delay function, measurement start delay function, hysteresis setting function, etc.				

Note: For further details, refer to p.864~ for the ultra-compact digital panel controller CA2 series, and to p.854~ for the digital panel controller CA series.

# Sensor mounting bracket

· MS-DPX



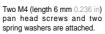



Two M4 (length 6 mm 0.236 in) pan head screws and two spring washers are attached.


# Straight bush

• DPX-03



#### Panel mounting bracket, Front protection cover

- MS-DPX-2 DPX-04

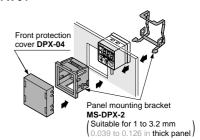

# Digital panel controller

CA2 series



· CA series



# **SPECIFICATIONS**


				\/acııım	pressure				Positiva	pressure		
Туре				Pa type		100kPa type			1MPa type			
	Туре		Standard	Light weight		IP67	Standard	Flat	IP67	Standard	Flat	IP67
		A - '		•	гіаі	-			-			
/	<u> </u>	Asian	DP2-20	DP2-80		DP2-60	DP2-21	DP2-41	DP2-61	DP2-22	DP2-42	DP2-62
	Model No.	North American (Note)	DP2-20F(-P)		DP2-40N	DP2-60N	DP2-21F(-P)		DP2-61N	DP2-22F(-P)		DP2-62N
Iten	ı∖≥	European			DP2-40E	DP2-60E		DP2-41E	DP2-61E		DP2-42E	DP2-62E
Туре	e of pre	essure					Gauge	oressure				
Rate	ed pres	ssure range		0 to — 10	01.3 kPa		(	to 100.0 kP	a	0	to 1.000 MF	Pa
Set pressure range		$ \left\{ \begin{array}{l} 5.1 \text{ to} - 101.3 \text{ kPa} \\ 0.052 \text{ to} - 1.033 \text{ kgf/cm}^2, 0.051 \text{ to} - 1.013 \text{ bar} \\ 0.74 \text{ to} - 14.70 \text{ psi, } 38 \text{ to} - 760 \text{ mmHg} \\ 1.5 \text{ to} - 29.9 \text{ inHg} \end{array} \right\} \left\{ \begin{array}{l} -5.0 \text{ to} 100.0 \text{ kPa} \\ -0.051 \text{ to} 10.20 \text{ kgf/cm}^2 \\ -0.050 \text{ to} 1.000 \text{ bar} \\ -0.72 \text{ to} 14.50 \text{ psi} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ MPa} \\ -0.051 \text{ to} 1.020 \text{ kgf/cm}^2 \\ -0.50 \text{ to} 1.000 \text{ bar} \\ -7.2 \text{ to} 145.0 \text{ psi} \end{array} \right. $							gf/cm <sup>2</sup> }			
Pres	ssure w	vithstandability				490	kPa				1.47 MPa	
App	licable	fluid					Non-corr	osive gas				
Sele	ectable	units	kPa,	kgf/cm <sup>2</sup> , bar,	psi, mmHg,	inHg	kPa	, kgf/cm <sup>2</sup> , ba	r, psi	MPa	, kgf/cm², ba	ar, psi
Sup	ply volt	tage				12 to 24 \	/ DC + 10 %					
		nsumption						or less				
(Co	mpara	ve outputs tive Output 1 tive Output 2	NPN open-c • Maximu • Applied vo	collector trans im sink curre oltage: 30 V DC al voltage: 1 V	sistor nt: 100 mA or less (betwee / or less (at	utput, flat and en comparative of 100 mA sink at 16 mA sink	output and 0 V)	PNP open- • Maxim • Applied	collector tran um source ci voltage: 30 V D0	dard PNP out sistor urrent: 100 m C or less (betwee V or less (at	A en comparative	output and $+$ V)
	Utiliza	tion category					DC-12 (	or DC-13				
	Outpu	t modes	Equipped v	vith 4 types o			e, window cor le by key ope		de, dual outp	ut mode, auto	omatic sensit	tivity setting
İ	Hyster	resis			1 digit (howe	ver, variable	in hysteresis	mode and 2	digits when	using psi unit		
İ	Repea	atability	1 digit (however, variable in hysteresis mode and 2 digits when using psi unit)  Within ± 0.2 % F.S. ± 1 digit									
İ	•	onse time	2.5 ms or less									
İ		circuit protection	Incorporated									
Analog voltage output		tage output	Output voltage: 1 to 5 V (over rated pressure range) Zero-point: within 1 V ± 5 % F.S. Span: within 4 V ± 5 % F.S. Linearity: within ± 1 % F.S. Output impedance: 1 kΩ approx.  High pressure (Positive pressure type) —Pressure — High vacuum (Vacuum pressure type)									
Disp	olay		31/2 digit red LED display (Sampling rate: 4 times/sec. approx.)									
	Displa	yable pressure range	$ \left\{ \begin{array}{l} 5.1 \text{ to} - 101.3 \text{ kPa} \\ 0.052 \text{ to} - 1.033 \text{ kgf/cm}^2, 0.051 \text{ to} - 1.013 \text{ bar} \\ 0.74 \text{ to} - 14.70 \text{ psi}, 38 \text{ to} - 760 \text{ mmHg} \\ 1.5 \text{ to} - 29.9 \text{ inHg} \end{array} \right\} \left\{ \begin{array}{l} -5.0 \text{ to} 100.0 \text{ kPa} \\ -0.051 \text{ to} 10.00 \text{ kgf/cm}^2 \\ -0.050 \text{ to} 1.000 \text{ bar} \\ -0.72 \text{ to} 14.50 \text{ psi} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ MPa} \\ -0.051 \text{ to} 1.020 \text{ kgf/cm}^2 \\ -0.050 \text{ to} 1.000 \text{ bar} \\ -0.72 \text{ to} 14.50 \text{ psi} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ MPa} \\ -0.051 \text{ to} 1.020 \text{ kgf/cm}^2 \\ -0.50 \text{ to} 10.00 \text{ bar} \\ -7.2 \text{ to} 145.0 \text{ psi} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ MPa} \\ -0.050 \text{ to} 1.000 \text{ bar} \\ -0.72 \text{ to} 145.0 \text{ psi} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ kPa} \\ -0.050 \text{ to} 1.000 \text{ bar} \\ -0.50 \text{ to} 1.000 \text{ bar} \\ -0.72 \text{ to} 145.0 \text{ psi} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ bar} \\ -0.50 \text{ to} 1.000 \text{ bar} \\ -0.50 \text{ to} 1.000 \text{ bar} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ bar} \\ -0.050 \text{ to} 1.000 \text{ bar} \\ -0.050 \text{ to} 1.000 \text{ bar} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ bar} \\ -0.050 \text{ to} 1.000 \text{ bar} \\ -0.050 \text{ to} 1.000 \text{ bar} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ bar} \\ -0.050 \text{ to} 1.000 \text{ bar} \\ -0.050 \text{ to} 1.000 \text{ bar} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ bar} \\ -0.050 \text{ to} 1.000 \text{ bar} \\ -0.050 \text{ to} 1.000 \text{ bar} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ bar} \\ -0.050 \text{ to} 1.000 \text{ bar} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ bar} \\ -0.050 \text{ to} 1.000 \text{ bar} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ bar} \\ -0.050 \text{ to} 1.000 \text{ bar} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ bar} \\ -0.050 \text{ to} 1.000 \text{ bar} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ bar} \\ -0.050 \text{ to} 1.000 \text{ bar} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ bar} \\ -0.050 \text{ to} 1.000 \text{ bar} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ bar} \\ -0.050 \text{ to} 1.000 \text{ bar} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ bar} \\ -0.050 \text{ to} 1.000 \text{ bar} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ bar} \\ -0.050 \text{ to} 1.000 \text{ bar} \end{array} \right\} \left\{ \begin{array}{l} -0.050 \text{ to} 1.000 \text{ bar} \\ -0.050 \text{ to} 1.000 \text{ bar} \end{array} \right\} \left\{ \begin{array}{l} -$						gf/cm <sup>2</sup> )			
Ana	log bar	r display	LED bar display in steps of 10 % F.S. approx.									
Ope	ration	Comparative Output 1	Orange LED (lights up when Comparative Output 1 is ON)									
		Comparative Output 2	Green LED (lights up when Comparative Output 2 is ON)									
		on degree	3 (Industrial environment)									
9	Protec	ction			Standard,	Flat and Lig	ht weight type	es: IP40 (IEC	), IP67 type:	IP67 (IEC)		
star		ent temperature	— 10 to	+50 °C +1						- 10 to + 60	°C + 14 to	+ 140 °F
Environmental resistance		ent humidity				•						
[a]	EMC	•	35 to 85 % RH, Storage: 35 to 85 % RH EN 50081-2, EN 50082-2, EN 61000-6-2									
neu		ge withstandability		1.000	V AC for on					ther and encl	osure	
onr		tion resistance	-							ted together a		 е
n N		ion resistance	<b> </b>		· ·					ons for two ho		
ш		resistance				-				ree times ea		
Tem		re characteristics	Over amb									°C ⊥ 60 °E
16111	poratu		Over allib							detected press		<b>J</b> 1 00 F
Pres	ssure	Asian								rpe: M5 fema		
port		North American		Sia	ndard type:					1/8 female thre	eau	
European Material		Pressure por		Die-cast zind	ass fiber rein alloy [Light v	IP67 types: G forced), Displ veight type: P	lay surface: A	crylic	pressure por	is brass (nic	kel plated)]	
Cab	le			0.15 mr	m <sup>2</sup> 5-core oil	resistant cab	otyre cable, 2	m 6.562 ft lo	ng (IP67 type	e: <b>5 m</b> 16.404	ft long)	
Cab	le exte	ension	Extension up	to total 100 m	328.084 ft (le	ess than 10 m	32.808 ft when	n conforming t	o CE marking)	is possible wi	th 0.3 mm <sup>2</sup> , or	r more, cable.
Wei	ght		Star	ndard type: 9	g approx.,	Flat type: 120	g approx., I	P67 type: 370	g approx., I	_ight weight t	/pe: 70 g ap	prox.
Acc	essorie	es		Hexagon-	socket-head	plug for pres	sure port: 1 p	c. (Standard	type only), P	ressure unit l	abel: 1 pc.	
			•			-	·					

Note: Model Nos. of North American standard type having the suffix '-P' are PNP output type.

### I/O CIRCUIT AND WIRING DIAGRAMS

### NPN output type

### I/O circuit diagram

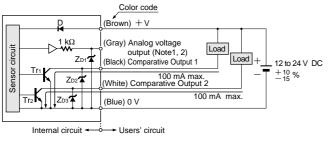


Notes:1) When using the analog voltage output, take care to connect external device of proper input impedance. Also, when a cable extension is used, voltage drop due to cable resistance should be taken into account.

2) The analog voltage output does not incorporate a shortcircuit protection circuit. Do not connect it directly to a power supply or a capacitive load.


Symbols ... D: Reverse supply polarity protection diode ZD1, ZD2, ZD3: Surge absorption zener diode Tr1, Tr2: NPN output transistor

#### Wiring diagram

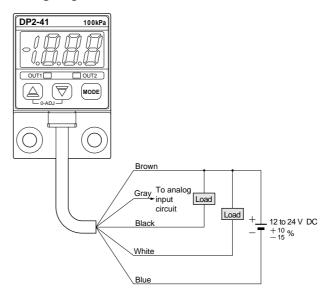

# PNP output type

#### I/O circuit diagram

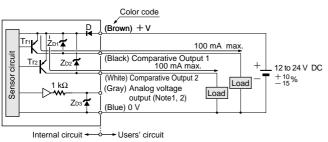


Notes:1) When using the analog voltage output, take care to connect external device of proper input impedance. Also, when a cable extension is used, voltage drop due to cable resistance should be taken into account.

2) The analog voltage output does not incorporate a shortcircuit protection circuit.

Do not connect it directly to a power supply or a capacitive load.

Symbols ... D: Reverse supply polarity protection diode  $Z_{D1}, Z_{D2}, Z_{D3}$ : Surge absorption zener diode  $T_{r1}, T_{r2}$ : PNP output transistor

#### Wiring diagram

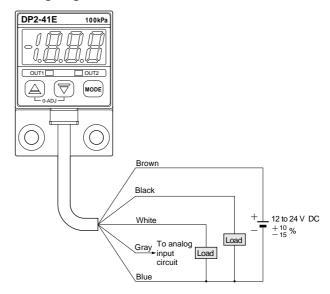

### PRECAUTIONS FOR PROPER USE

#### All models




 This product is not a safety sensor. Its use is not intended or designed to protect life and prevent body injury or property damage from dangerous parts of machinery. It is a normal pressure detection sensor.

The DP2 series is designed for use with noncorrosive gas. It cannot be used with liquid or cor-

#### Operation

- If setting is impossible even with pressing the MODE key, verify whether the key-protect function is enabled. Please note that pressing down on the MODE key for an extended moment will enable the key-protect function as soon as the key is released.
- If using the window comparator mode, set the pressure value so that there is a difference of 3 digits, or more, between Set Value 1 (P-1) and Set Value 2 (P-2). No output will be possible with a 0 to 2 digit difference.

#### **Functional description**

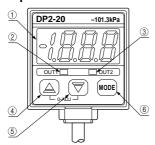

	Description	Function						
1	3¹/2 digit LED Displays measured pressure, settings, erro messages and key-protect status.							
2	Comparative Output 1 operation indicator (Orange)	Lights up when Comparative Output 1 is ON.						
3	Comparative Output 2 operation indicator (Green)	Lights up when Comparative Output 2 is ON.						
4	Increment key ( 🛆 )	In the initial setting mode, pressing the key changes the settable digit. In the Set Value 1, 2 modes, pressing the key changes the set value to the high pressure side in case of positive pressure type sensor and to the high vacuum side in case of vacuum pressure type sensor. In the sensing mode, if the key is pressed continuously for 4 sec. or more, the display shows peak hold value. In the initial setting mode, pressing the key changes the set value to the low pressure type sensor and to the low vacuum side in case of vacuum pressure type sensor and to the low vacuum side in case of vacuum pressure type sensor. In the sensing mode, if the key is lightly and the low vacuum side in case of vacuum pressure type sensor.						
(5)	Decrement key ( 🗑 )	the key changes the set value to the high pressure side in case of positive pressure type sensor and to the high vacuum side in case of vacuum pressure type sensor.  In the sensing mode, if the key is pressed continuously for 4 sec. or more, the display shows peak hold value.  In the initial setting mode, pressing the key changes the set conditions.  In the Set Value 1, 2 modes, pressing the key changes the set value to the low pressure side in case of positive pressure type sensor and to the low vacuum side in case of vacuum pressure type sensor.  In the sensing mode, if the key is pressed continuously for 4 sec. or more, the display shows bottom hold value.						
6	Mode selection key	Each press of the key changes the selected mode to sensing mode, Set Value 1 (P-1) set mode and Set Value 2 (P-2) set mode.     In the sensing mode, if the key is pressed continuously for about 3 sec., key-protect can be set / released.     In the sensing mode, if the mode selection key is pressed while pressing the increment key ( ( ), the initial setting mode is obtained.						

#### **Error messages**

• When an error occurs, take the following corrective action.

Error message		Cause Corrective action				
<u>E-1</u>	Overcui circuit.	rent due to short-	Switch off the power supply and check the load.			
<u>[ [                                  </u>		e is being applied zero-point adjust-	Applied pressure at the pressure port should be brought to atmospheric pressure and zero-point adjustment should be done again.			
	Positive pressure type	Applied pressure exceeds the upper limit of displayable pressure range.				
	Vacuum pressure type	Applied pressure exceeds the lower limit of displayable pressure range.	Applied pressure should be			
	Positive pressure type	Applied pressure exceeds the lower limit of displayable pressure range.	brought within the rated pressure range.			
	Vacuum pressure type	Applied pressure exceeds the upper limit of displayable pressure range.				

#### Wiring

The analog voltage output does not incorporate a shortcircuit protection circuit. Do not directly connect a power supply or a capacitive load.

- Make sure that the power supply is off while wiring.
- Verify that the supply voltage variation is within the rating.
- If power is supplied from a commercial switching regulator, ensure that the frame ground (F.G.) terminal of the power supply is connected to an actual ground.
- In case noise generating equipment (switching regulator, inverter motor, etc.) is used in the vicinity of this sensor, connect the frame ground (F.G.) terminal of the equipment to an actual ground.
- Do not run the wires together with high-voltage lines or power lines or put them in the same raceway. This can cause malfunction due to induction.

# Conditions in use for CE conformity

• The **DP2** series is a CE conformity product complying with EMC Directive. The harmonized standard with regard to immunity that applies to this product is EN 61000-6-2 (Note) and the following condition must be met to conform to that standard.

• The sensor should be connected less than 10 m 32.808 ft from the power supply.

Note: The EN 50082-2 that previously applied to the products for conforming to EMC Directive was replaced by EN 61000-6-2 starting April 1st, 2002.

#### PRECAUTIONS FOR PROPER USE

#### All models

#### Setting

- If key-protect has been set, make sure to release key-protect before operating the keys. (Please refer to 'Key-protect function' on p.801 for the procedure.)
- Set Value 1 (P-1) and Set Value 2 (P-2) can be made common for all the output modes.
- The setting of Set Value 2 (P-2) with respect to Set Value 1 (P-1) can only be towards the high pressure side in case of the positive pressure type sensor and only towards the high vacuum side in case of the vacuum pressure type sensor.
- Set Value 3 (P-3) is automatically set to the mid-value of Set Value 1 (P-1) and Set Value 2 (P-2). (When setting the pressure value for the automatic sensitivity mode)
- The conditions which are set are stored in an EEPROM. Kindly note that the EEPROM has a life span and its guaranteed life is 100,000 write operation cycles.

#### Setting procedure

1 Zero-point adjustment Adjust zero-point

2 Initial setting Set 'Display', 'Output mode', and 'Unit'

### 1 Zero-point adjustment

• The displayed pressure when the pressure port is left open is adjusted to zero.




- The sensor will automatically enter the sensing mode when power is supplied.
- · Let the pressure port be at atmospheric pressure (i.e., no applied pressure condition), and press, simultaneously, the increment and decrement keys continuously.
- \[ \text{\text{\$\pi \text{\$\pi \exitin \text{\$\pi \text{\$\pi \text{\$\pi \text{\$\pi \text{\$\pi \te released, zero-point adjustment is completed and the sensor returns to the sensing mode.

#### 2 Initial setting

· Pressure 'Unit', 'Display' and 'Output mode' of the comparative outputs are set.



- In the sensing mode, press we key while pressing (a) key.
- . Initial setting is displayed.
- If sensor is being used for the first time, PHD is displayed.
- The settable digit blinks.
- The settable digit changes when 👜 key is

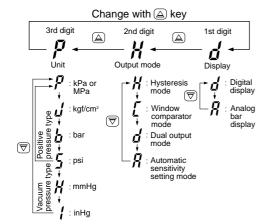

# 3 Pressure value setting

Enter Set Value 1 (P-1), Set Value 2 (P-2), Set Value 3 (P-3)

#### Measurement

Commence measurement on completion of setting

#### ③ Pressure value setting

For the case when output mode is set to either hysteresis mode (H), window comparator mode (L) or dual output mode ( d ).

· 'Set Value 1 (P-1)' and Set Value 2 (P-2)' of the comparative outputs are set.



- Press week key in the sensing mode to set to Set Value 1 (P-1) set mode.
- Enter Set Value 1 (P-1) using 

  key and 

  key.
  - Then, press week key to set to Set Value 2 (P-2) set mode.
- Then, press week key to set to sensing mode.

#### For the case when output mode is set to automatic sensitivity setting mode ( $\ensuremath{\mathcal{R}}$ ).

'Set Value 1 (P-1)', 'Set Value 2 (P-2)' and 'Set Value 3 (P-3)' of the comparative outputs are set.



Value 1 (P-1) set mode. · Within the required permissible pressure range,

• Press woe key in the sensing mode to set to Set

- having created a pressure state which is nearest to the atmospheric pressure, press ♥ key to enter Set Value 1 (P-1).
- Then, press week key to set to Set Value 2 (P-2) set mode.
- · Within the required permissible pressure range, having created a pressure state which is nearest to the high pressure end (for a positive pressure type sensor) or the high vacuum end (for a vacuum pressure type sensor), press ( key to enter Set Value 2 (P-2).
- Then, press key to set to Set Value 3 (P-3)
- · Check Set Value 3 (P-3) which has been set automatically. When Set Value 3 (P-3) is to be changed, enter Set Value 3 (P-3) using (a) key
- After checking and setting, press es key to set to sensing mode.
- The automatically set Set Value 3 (P-3) can be manually changed to a value between Set Value 1 (P-1) and Set Value 2 (P-2).
- · If using the window comparator mode, set the pressure value so that there is a difference of 3 digits, or more, between Set Value 1 (P-1) and Set Value 2 (P-2). No output will be possible with a 0 to 2 digit difference.

#### PRECAUTIONS FOR PROPER USE

#### All models

#### Conversion of pressure units

• In the DP2 series, the conversion to different units is automatically done on changing the setting of the pressure unit. However, this conversion can also be obtained by multiplying the values by the coefficients given in the table on the right.

#### Conversion procedure

· For example, if 2 kPa is to be expressed in kgf/cm2,

since 1 kPa =  $1.01972 \times 10^{-2}$  kgf/cm<sup>2</sup>, 2 kPa becomes

 $2 \times 1.01972 \times 10^{-2} = 0.020 \text{ kgf/cm}^2$ .

#### Conversion table for pressure units

	kPa	MPa	kgf/cm <sup>2</sup>	bar	psi	mmHg (Torr)	inHg	atm
1 kPa	1	1×10 <sup>-3</sup>	1.01972×10 <sup>-2</sup>	1×10 <sup>-2</sup>	1.45038 × 10 <sup>-1</sup>	7.50062	0.2953	9.86923×10 <sup>-3</sup>
1 MPa	1×10³	1	1.01972×10	1×10	1.45038 × 10 <sup>2</sup>	$7.50062 \times 10^{3}$	$0.2953 \times 10^{3}$	9.86923
1 kgf/cm <sup>2</sup>	9.80665×10	9.80665×10 <sup>-2</sup>	1	9.80665×10 <sup>-1</sup>	1.42234×10	7.35559 × 10 <sup>2</sup>	2.8959 × 10	9.67841 × 10 <sup>-1</sup>
1 bar	1×10²	1×10 <sup>-1</sup>	1.01972	1	1.45038×10	7.50062 × 10 <sup>2</sup>	2.953×10	9.86923×10 <sup>-1</sup>
1 psi	6.89473	6.89473×10 <sup>-3</sup>	7.03065×10 <sup>-2</sup>	6.89473×10 <sup>-2</sup>	1	5.17147×10	2.036	6.80457×10 <sup>-2</sup>
1 mmHg (1 Torr)	1.33322 × 10 <sup>-1</sup>	1.33322×10 <sup>-4</sup>	1.35951 × 10 <sup>-3</sup>	1.33322×10 <sup>-3</sup>	1.93368×10 <sup>-2</sup>	1	3.9370×10 <sup>-2</sup>	1.31579×10 <sup>-3</sup>
1 inHg	3.3864	3.3864×10 <sup>-3</sup>	3.4531 × 10 <sup>-2</sup>	3.3864×10 <sup>-2</sup>	0.4912	2.5400×10	1	3.342 × 10 <sup>-2</sup>
1 atm	1.01325 × 10 <sup>2</sup>	1.01325×10 <sup>-1</sup>	1.03323	1.01325	1.46960×10	7.60000 × 10 <sup>2</sup>	2.9921 × 10	1

# **Key-protect function**

· Key-protect is a function which prevents any unintentional change in the conditions which have been entered in each setting mode by making the sensor not to respond to the key operations.

# Setting of key-protect



- In the sensing mode, press week key continuously for about 3 sec. and release it immediately when
- '• Key-protect is set and the sensor returns to the sensing mode.

#### Release of key-protect



- $\bullet$  In the sensing mode, press  $\begin{tabular}{l} \end{tabular}$  key continuously for about 3 sec. and release it immediately when  $\square FF$  is displayed.
  - · Key-protect is released and the sensor returns to the sensing mode.

#### **Others**

- Use within the rated pressure range.
- · Do not apply pressure exceeding the pressure withstandability value. The diaphragm will get damaged and correct operation shall not be maintained.
- Do not use during the initial transient time (0.5 sec.) after the power supply is switched on.
- Avoid use of standard type, flat type and light weight type of sensors in places where steam and dust is excessive.
- Take care that the sensor does not come in direct contact with water, oil, grease, or organic solvents, such as, thinner, etc.
- Do not insert wires, etc., into the pressure port. The diaphragm will get damaged and correct operation shall not be maintained.
- Do not operate the keys with pointed or sharp objects.


#### PRECAUTIONS FOR PROPER USE

### Standard type

#### Setting of pressure lead direction

•The pressure lead direction can be changed by dismantling the pressure port attachment and changing the mounting direction. The tightening torque of the hexagon-socket-head bolt (length: 9 mm 0.354 in or less) should be 0.29 N·m or less.


Note: Make sure to close any unused pressure port with the hexagonsocket-head plug supplied as accessory.

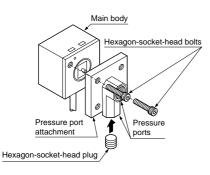

#### **Piping**


· When connecting a hexagon-socket-head plug or coupling to the pressure port, hold the hexagonal part of the pressure port with a 12 mm 0.472 in spanner and make sure that the tightening torque is 9.8 N·m or less. Also, in order to prevent any leakage, wind a sealing tape on the coupling when connecting.

However, sealing tape is not required for North American type (DP2-DFD) using NPTF 1/8 coupling. (Sealing tape is required if NPT 1/8 coupling is used.)

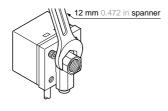

#### Mounting


• When mounting the sensor with the sensor mounting bracket, etc., the tightening torque should be 1.2 N·m or

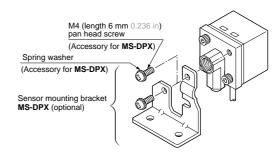

# Flat type Light weight type


#### Setting of pressure lead direction

•The pressure lead direction can be changed by dismantling the pressure port attachment and changing the mounting direction. The tightening torque of the hexagon-socket-head bolt (length: 9 mm 0.354 in or less) should be 0.29 N·m or less.

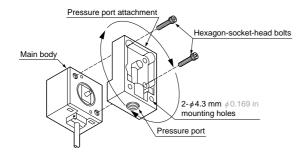

#### **Piping**

• When connecting a coupling to the pressure port, hold the pressure port attachment with a 16 mm 0.630 in (light weight type: 10 mm 0.394 in) spanner and make sure that the tightening torque is 9.8 N·m or less (light weight type: 1.47 N·m or less). Also, in order to prevent any leakage, wind a sealing tape on the coupling when connecting.

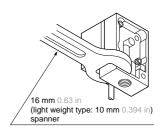

#### PRECAUTIONS FOR PROPER USE


# IP67 type

#### Piping for pressure measurement inlet port

• When connecting a coupling to the pressure measurement inlet port, hold the pressure port attachment with a spanner and make sure that the tightening torque is 9.8 N·m or less. Also, in order to prevent any leakage, wind a sealing tape on the coupling when connecting.


#### Piping for atmospheric pressure inlet port

· If there is a possibility of water entering into the sensor enclosure through the atmospheric pressure inlet port, connect a tube to the atmospheric pressure inlet port through a M5 coupling and extend the other end of the tube to a safe place. In this case, ensure that this end of the tube does not get clogged.

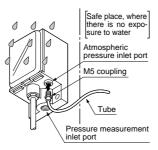


#### Fitting of front cover


• Insert the bosses on the front cover into the guide holes at the bottom of the pressure port attachment, and push in the direction of the arrow to fit the hook. When removing the front cover, release the hook first.

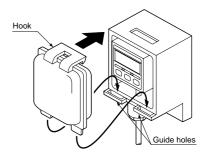


**DIMENSIONS (Unit: mm in)** The CAD data in the dimensions can be downloaded from the SUNX website: http://www.sunx.co.jp/

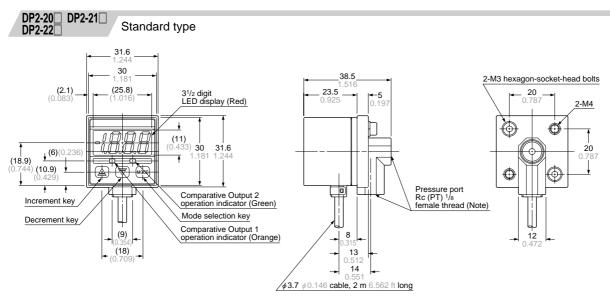


Note: NPTF 1/8 female thread for North American type.

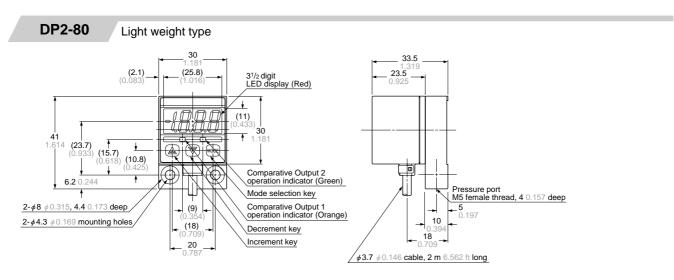

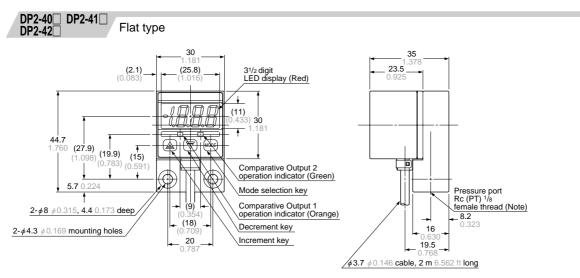

Note: NPT 1/8 female thread for North American type, and G (PF) 1/8 female thread for European type.

# DIMENSIONS (Unit: mm in) The CAD data in the dimensions can be downloaded from the SUNX website: http://www.sunx.co.jp/

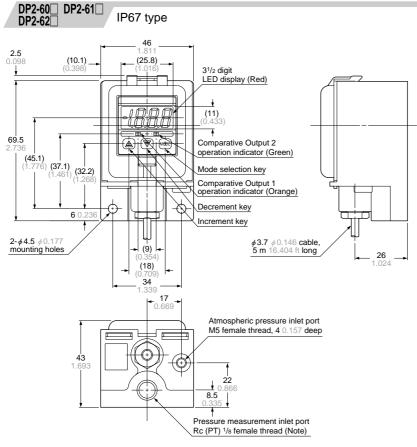


Note: NPT 1/8 for North American type, and G (PF) 1/8 for European type.

# **MS-DPX**

40


Sensor mounting bracket for standard type (Optional)

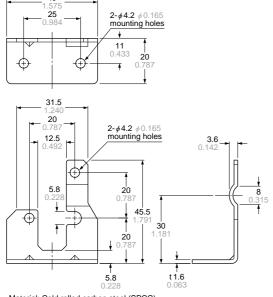

Material: Cold rolled carbon steel (SPCC) (Uni-chrome plated) Two M4 (length 6 mm 0.236 in) pan head screws

and two spring washers are attached.


# Assembly dimensions

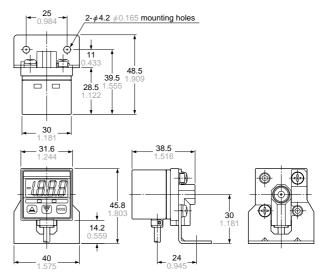


**DIMENSIONS (Unit: mm in)** The CAD data in the dimensions can be downloaded from the SUNX website: http://www.sunx.co.jp/

# MS-DPX-4

Back angled mounting bracket for standard type (Optional)

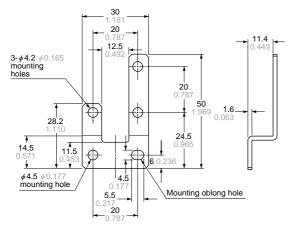

Assembly dimensions

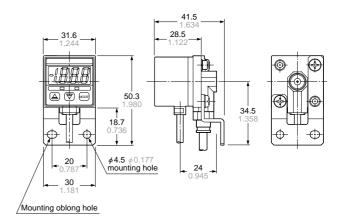


Material: Cold rolled carbon steel (SPCC) (Uni-chrome plated)

Two M4 (length 6 mm 0.236 in) pan head screws and two spring washers are attached.

# MS-DPX-2 DPX-04


Panel mounting bracket, front protection cover for standard type (Optional)

### **Assembly dimensions**

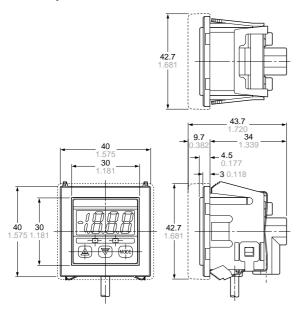

portion shows the front protection cover. Material: Polycarbonate (Front protection cover) Nylon 6, Stainless steel (SUS304)(Panel mounting bracket)

# Panel cut-out dimensions

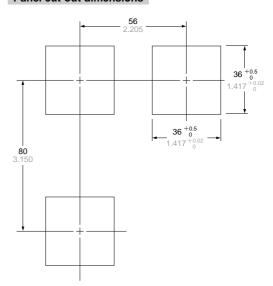

Note: The panel thickness should be 1 to 3.2 mm 0.039 to 0126 in.