

# Long Barrel Inductive Prox

# **E2E2 2-WIRE AC**

# Rugged Inductive Prox Sensors Meet IP67 Requirements

- Solid potted internal circuitry withstands shocks and water washdown to IP67
- Thick nickel-plated brass barrel has wrench flats for easy installation
- High visibility indicator
- Connector and prewired versions



# Ordering Information \_\_\_\_\_

#### **■ PRE-WIRED SENSORS**

Туре	Size	Sensing distance	Part number	
			NO	NC
Shielded	M12	2 mm	E2E2-X2Y1-US	E2E2-X2Y2-US
<u> </u>	M18	5 mm	E2E2-X5Y1-US	E2E2-X5Y2-US
	M30	10 mm	E2E2-X10Y1-US	E2E2-X10Y2-US
Unshielded	M12	5 mm	E2E2-X5MY1-US	E2E2-X5MY2-US
	M18	10 mm	E2E2-X10MY1-US	E2E2-X10MY2-US
	M30	18 mm	E2E2-X18MY1-US	E2E2-X18MY2-US

#### **■ SENSORS WITH CONNECTORS**

Туре	Size	Sensing distance	Part number	
			NO	NC
Shielded	M12	2 mm	E2E2-X2Y1-M4	E2E2-X2Y2-M4
	M18	5 mm	E2E2-X5Y1-M4	E2E2-X5Y2-M4
	M30	10 mm	E2E2-X10Y1-M4	E2E2-X10Y2-M4
Unshielded	M12	5 mm	E2E2-X5MY1-M4	E2E2-X5MY2-M4
	M18	10 mm	E2E2-X10MY1-M4	E2E2-X10MY2-M4
	M30	18 mm	E2E2-X18MY1-M4	E2E2-X18MY2-M4

Note: Connector cordsets, use OMRON Y96E-33  $\square A \square.$ 

## **■** ACCESSORIES

Description		Part number
Mounting brackets	Fits M12 size sensors Fits M18 size sensors Fits M30 size sensors	Y92E-B12 Y92E-B18 Y92E-B30
Silicone rubber covers for shielded sensors	Fits M12 size sensors Fits M18 size sensors Fits M30 size sensors	Y92E-E12-2 Y92E-E18-2 Y92E-E30-2
Connector cordsets	Connector cordsets See Y96E Connector Cordsets data sheet for	

#### **■ REPLACEMENT PARTS**

Description	Part number	
Mounting hardware including one pair of	Fits M12 size sensors	M12-MHWS
metal nuts and one washer	Fits M18 size sensors	M18-MHWS
	Fits M30 size sensors	M30-MHWS

# Specifications \_\_\_\_\_

Part number		E2E2-X2Y□-US	E2E2-X5M□-US	E2E2-X5Y□-US	E2E2-X10MY□-US	E2E2-X10□-US	E2E2-X18MY□-US	
Size M12		M12	12		M18		M30	
Туре		Shielded	Unshielded	Shielded	Unshielded	Shielded	Unshielded	
Sensing distance	)	2 mm (0.08 in) ±10%	5 mm (0.20 in) ±10%	5 mm (0.20 in) ±10%	10 mm (0.39 in) ±10%	10 mm (0.39 in) ±10%	18 mm (0.71 in) ±10%	
Supply voltage (ovoltage range) (See Note 1.)	operating	24 to 240 VAC,	50/60 Hz (20 to 2	64 VAC)				
Leakage current		1.7 mA max.						
Sensing object		Magnetic metals	3					
Setting distance		0 to 1.6 mm (0 to 0.06 in)	0 to 4.0 mm (0 to 0.16 in)	0 to 4.0 mm (0 to 0.16 in)	0 to 8.0 mm (0 to 0.31 in)	0 to 8.0 mm (0 to 0.31 in)	0 to 14.0 mm (0 to 0.55 in)	
Standard object	(mild steel)	12 x 12 x 1 mm (0.47 x 0.47 x 0.04 in)	15 x 15 x 1 mm (0.59 x 0.59 x 0.04 in)	18 x 18 x 1 mm (0.71 x 0.71 x 0.04 in)	30 x 30 x 1 mm (1.18 x 1.18 x 0.04 in)	30 x 30 x 1 mm (1.18 x 1.18 x 0.04 in)	54 x 54 x 1 mm (2.13 x 2.13 x 0.04 in)	
Differential travel		10% max. of sensing distance						
Response frequency		25 Hz						
Operation (with sensing object approaching)		Y1 models: Load ON Y2 models: Load OFF						
Control output (s capacity)	witching	5 to 200 mA	5 to 200 mA 5 to 300 mA (see note 2)					
Indicator		Operation indicator (red LED)						
Ambient temperature	Operating	-40°C to 85°C (	-40°F to 185°F) v	vith no icing				
Ambient humidity	Operating	Operating: 35% to 95%						
Temperature influence		±15% max. of sensing distance at 23°C in temperature range of -40°C to 85°C (-40°F to 185°F) ±10% max. of sensing distance at 23°C in temperature range of -25°C to 70°C (-13°F to 158°F)						
Voltage influence	)	±1% max. of sensing distance in rated voltage range ±15%						
Residual voltage		Refer to Engineering Data						
Insulation resista	nce	50 MΩ min. (at 500 VDC) between current carry parts and case						
Dielectric strengt	h	4,000 VAC for 1	4,000 VAC for 1 min. between current carry parts and case					
Vibration resistar	nce	10 to 55 Hz, 1.5	-mm double ampl	itude for 10 times	each in X, Y, and Z	axes		

(This table continues on the next page.)


Specifications Table - continued from previous page

Part number	er	E2E2-X2Y□-US	E2E2-X2Y□-US					
Shock resis	stance	1,000 m/s <sup>2</sup> (app	1,000 m/s <sup>2</sup> (approx. 100G) for 10 times each in X, Y, and Z axes					
Enclosure	IEC	IP67	P67					
rating	NEMA	1, 4, 6, 12, 13	, 4, 6, 12, 13					
Weight		65 g 150 g 220 g						
Approvals	UL	Recognized, File	Recognized, File Number E76675					
	CSA	Certified, File No	Certified, File Number LR45951					
Material	Body	Brass						
	Sensing face	PBT						


- Note: 1. When using an M18 or M30 size E2E2 at an ambient temperature between 70°C and 85°C (158°F to 185°F), make sure the E2E2 has a control output of 200 mA maximum.
  - 2. When supplying 24 VAC to any of the above models, make sure that the operating ambient temperature range is -25°C to 85°C (-13°F to 185°F).

# Operation

## **■ OUTPUT CIRCUIT**

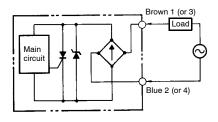


#### **■ TIMING CHART**

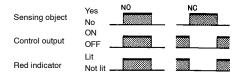


# **Engineering Data**


## **■ OPERATING RANGE (TYPICAL)**


#### Shielded Models E2E2-X Y

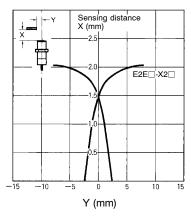

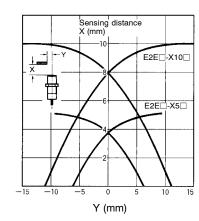


#### Unshielded Models E2E2-X□MY□

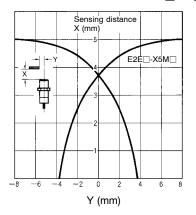


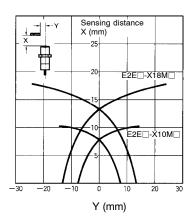



## **■ LEAKAGE CURRENT (TYPICAL)**

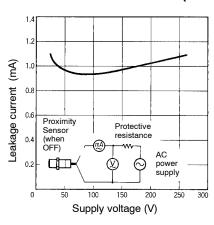

## ■ RESIDUAL OUTPUT VOLTAGE (TYPICAL)

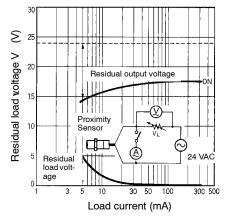


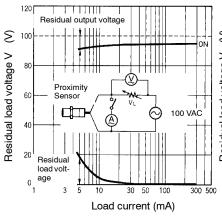

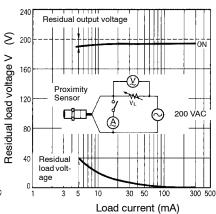


## ■ SENSING DISTANCE VS. SENSING OBJECT (TYPICAL)


#### E2E2-X2Y

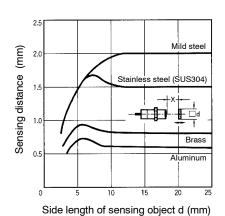


#### E2E2-X5Y

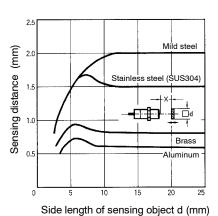


#### E2E2-X10Y

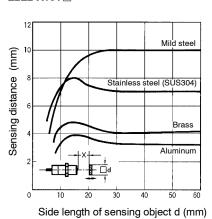


#### E2E2-X5MY

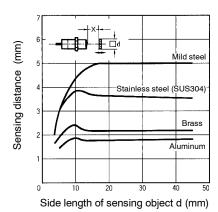

#### E2E2-X10MY

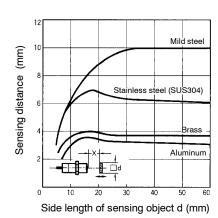

E2E2-X18MY

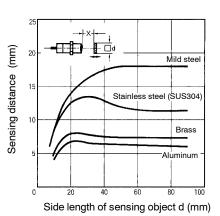


# **Dimensions**


Unit: mm (inch)

#### **■ PRE-WIRED SENSORS**

#### E2E2-X2□□

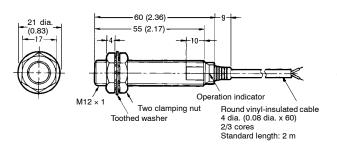


#### E2E2-X5M

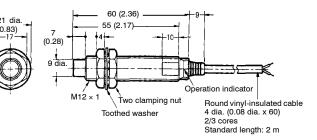


#### E2E2-X5


# E2E2-X10M□□

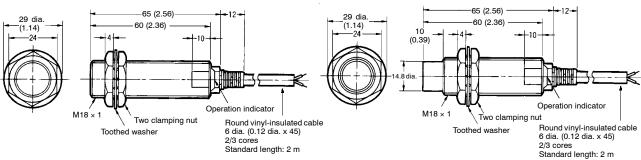

#### E2E2-X10 ...

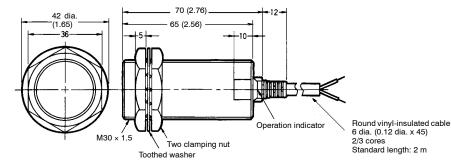


#### E2E2-X18M ...

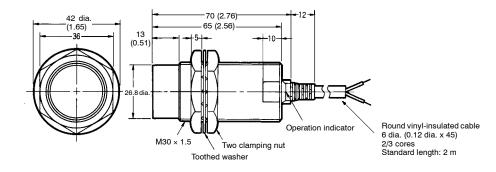


#### **■ SENSORS WITH CONNECTORS**

#### E2E2-X2Y□-M4

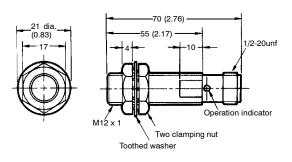


#### E2E2-X5MY -M4

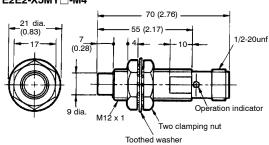


#### E2E2-X5Y□-M4

#### E2E2-X10MY -M4

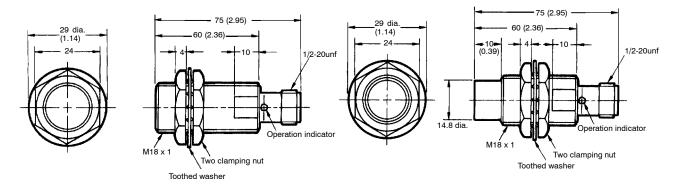

#### E2E2-X10Y .- M4

#### E2E2-X18MY -M4

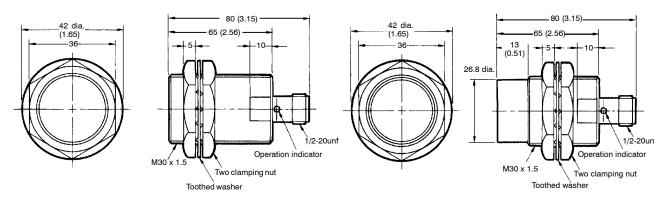

#### **■ MOUNTING HOLES**



Dimensions	M12	M18	M30
F (mm)	12.5 mm (0.49 in) dia.	18.5 mm (0.73 in) dia.	30.5 mm (1.20 in) dia.

# Installation

#### **■ PIN ARRANGEMENT**


#### E2E2-X Y -M4


Applicable models	Pin arrangement
E2E2-X□Y□-M4	Load O AC


#### **■ MOUNTING**

Do not tighten the nut with excessive force. A washer must be used with the nut.



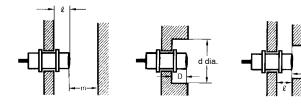

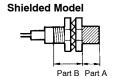

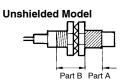

Note: The table below shows the tightening torques for part A and part B nuts. In the previous examples, the nut is on the sensor head side (part B) and hence the tightening torque for part B applies. If this nut is in part A, the tightening torque for part A applies instead.

Туре	Torque
M12	30 N • m (310 kgf • cm)
M18	70 N • m (710 kgf • cm)
M30	180 N • m (1,800 kgf • cm)


#### **■ EFFECTS OF SURROUNDING METAL**

When mounting the E2E2 within a metal panel, ensure that the clearances given in the table below are maintained. Failure to maintain these distances may cause deterioration in the performance of the sensor.

Туре	Dimension	M12	M18	M30
Shielded	$\ell$	0 mm	0 mm	0 mm
	d	12 mm	18 mm	30 mm
	D	0 mm	0 mm	0 mm
	m	8 mm	20 mm	40 mm
	n	18 mm	27 mm	45 mm
Unshielded	$\ell$	15 mm	22 mm	30 mm
	d	40 mm	55 mm	90 mm
	D	15 mm	22 mm	30 mm
	m	20 mm	40 mm	70 mm
	n	36 mm	54 mm	90 mm

## **■ MUTUAL INTERFERENCE**

When installing two or more Sensors face to face or side by side, ensure that the minimum distances given in the following table are maintained.

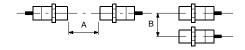

Туре	Dimension	M12	M18	M30
Shielded	А	30 mm	50 mm	100 mm
	В	20 mm	35 mm	70 mm
Unshielded	A	120 mm	200 mm	300 mm
	В	100 mm	110 mm	200 mm

# **Precautions**

#### **■ INSTALLATION**

#### **Power Reset Time**

The Proximity Sensor is ready to operate within 100 ms after power is supplied. If power supplies are connected to the Proximity Sensor and load respectively, be sure to supply power to the Proximity Sensor before supplying power to the load.

#### **Power OFF**

The Proximity Sensor may output a pulse signal when it is turned off. Turn off the load before turning off the Proximity Sensor.

#### **Power Supply Transformer**

When using a DC power supply, make sure that the DC power supply has an insulated transformer. Do not use a DC power supply with an auto-transformer.

#### **Target Object**

#### **Metal Coating**

The sensing distances of the Proximity Sensor vary with the metal coating on target objects.

#### **■** WIRING

#### **High-tension Lines**

#### Wiring through Metal Conduit

If there is a power or high-tension line near the cable of the Proximity Sensor, wire the cable through an independent metal conduit to prevent against Proximity Sensor damage or malfunctioning.

#### **Cable Tractive Force**

Do not pull cables with the tractive forces exceeding the following.

Diameter	Tractive force
4 mm dia. max.	30 N max.
4 mm dia. min.	50 N max.

#### MOUNTING

The Proximity Sensor must not be subjected to excessive shock with a hammer when it is installed, or the Proximity Sensor may be damaged or lose its water-resistance.

#### ■ ENVIRONMENT

#### **Water Resistance**

Do not use the Proximity Sensor underwater, outdoors, or in the rain

#### **Operating Environment**

Be sure to use the Proximity Sensor within its operating ambient temperature range and do not use the Proximity Sensor outdoors so that its reliability and life expectancy can be maintained. Although the Proximity Sensor is water resistant, a cover to protect the Proximity Sensor from water or water-soluble machining oil is recommended so that its reliability and life expectancy can be maintained.

Do not use the Proximity Sensor in an environment with chemical gas (e.g., strong alkaline or acid gasses including nitric, chromic, and concentrated sulfuric acid gases).

#### ■ CONNECTING LOAD

Refer to the following before using AC 2-wire Proximity Sensors.

#### **Surge Protection**

Although the Proximity Sensor has a surge absorption circuit, if there is any machine that has a large surge current (e.g., a motor

or welding machine) near the Proximity Sensor, connect a surge absorber to the machine.

#### Leakage Current


When the Proximity Sensor is OFF, the Proximity Sensor has leakage current. Refer to Leakage Current Characteristics. In this case, the load is imposed with a small voltage and the load may not be reset. Before using the Proximity Sensor, make sure that this voltage is less than the load reset voltage. The AC 2-wire Proximity Sensor cannot be connected to any card-lift-off relay (e.g., the G2A) because contact vibration of the relay will be caused by the leakage current and the life of the relay will be shortened.

#### **Countermeasures Against Leakage Current**

#### **AC 2-wire Models**

Connect a bleeder resistor as the bypass for the leakage current so that the current flowing into the load will be less than the load reset current.

As shown in the following diagram, connect the bleeder resistor so that the current flowing into the Proximity Sensor will be 10 mA minimum and the residual voltage imposed on the load will be less than the load reset voltage.

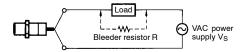

Refer to the following to calculate the bleeder resistance and the allowable power of the bleeder resistor.

 $R \leq V_S/(10 - I) (k\Omega)$ 

 $P > V_S^2/R \text{ (mW)}$ 

- P: The allowable power of the bleeder resistor. (The actual power capacity of the bleeder resistor must be at least a few times as large as the allowable power of the bleeder resistor.)
- I: Load current (mA)

The following resistors are recommended.

100 VAC (supply voltage): A resistor with a resistance of 10  $k\Omega$  maximum and an allowable power of 3 W minimum 200 VAC (supply voltage): A resistor with a resistance of 20  $k\Omega$  maximum and an allowable power of 10 W minimum If these resistors generate excessive heat, use a resistor with a resistance of 10  $k\Omega$  maximum and an allowable power of 5 W minimum at 100 VAC and a resistor with a resistance of 20  $k\Omega$  maximum and an allowable power of 10 W minimum at 200 VAC instead.

NOTE: DIMENSIONS SHOWN ARE IN MILLIMETERS. To convert millimeters to inches divide by 25.4.



One East Commerce Drive Schaumburg, IL 60173

1-800-55-OMRON

**OMRON ON-LINE** 

Global - http://www.omron.com USA - http://www.omron.com/oei Canada - http://www.omron.com/oci OMRON CANADA, INC. 885 Milner Avenue

Scarborough, Ontario M1B 5V8

416-286-6465

# **Mouser Electronics**

**Authorized Distributor** 

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

# Omron: