



General Tools & Instruments™
80 White Street, New York, NY 10013-3567


www.generaltools.com

Zero Adjustment for No.102 Micrometer:



STEP 1: Find set screw and loosen it.

Micrometer will need to be opened to at least 0.1" to reach set screw

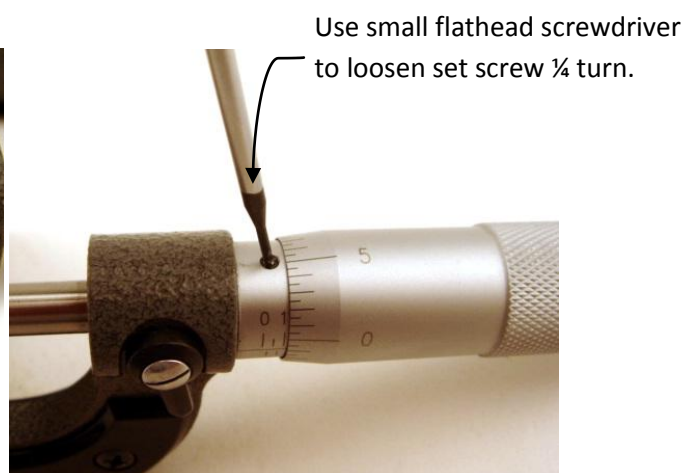

Step 2: Close micrometer using friction stop



Step 3: Insert LARGE end of wrench in hole on external cylinder



Hole that accepts wrench can be found at bottom of external cylinder.



Step 4: Use wrench to rotate cylinder until Zero is aligned.

Step 5: GENTLY Open micrometer to 0.1" and tighten set screw.

