MEMS Differential Pressure Sensor

A Compact, High-accuracy Differential **Pressure Sensor with Superior** Resistance to Environments.

- High accuracy of ±3% R.D.
- · Linearized and temperature compensated
- Digital output (I²C communication)
- High flow impedance to reduce the influence of bypass configuration
- RoHS Compliant



Ordering Information

Measurement Range	Applicable Fluid	Model
0 to 250 Pa (0 to 1 in. H ₂ O)		D6F-PH0025AD1
-50 to +50 Pa (± 0.2 in. H ₂ O)	Air	D6F-PH0505AD3
-500 to +500 Pa (± 2 in. H ₂ O)		D6F-PH5050AD3

Note: The Sensor can be calibrated for different gas types. Consult Omron.


Characteristics

Model	D6F-PH0025AD1	D6F-PH0505AD3	D6F-PH5050AD3				
Measurement Range (See Note 1)	0 to 250 Pa	± 50 Pa	± 500 Pa				
Calibration Gas (See Note 2)		Air					
Port Type	Barb j	oint, Maximum outside diameter: 4	1.9mm				
Power Supply		2.3 to 3.6 VDC					
Current Consumption	6 mA max. wi	th no load and V_{CC} of 3.3 V, GND=	=0 VDC, 25°C				
Resolution		12 bit					
Zero Point Tolerance (See Note 4)		± 0.2 Pa					
Span Tolerance (See Note 4)		± 3% R.D.					
Temperature Compensation		Yes					
Span shift due to Temperature Variation	± 0.5% R.D. per 10°C						
Response Time	25 ms typical at 12 bit resolution (50 ms max). The processing time i	s 6 ms typical at 12 bit resolution.				
Gas Flow through Sensor (See Note 3)	≤ 63 mL/min ≤ 23 mL/min ≤ 100 mL/min						
Interface	I ² C						
Case Material		PPS					
Degree of Protection		IEC IP40					
Withstand Pressure		10 kPa					
Operating Temperature	-20 t	o 80°C (with no condensation or i	cing)				
Operating Humidity	35 to	85% RH (with no condensation or	icing)				
Storage Temperature	-40 t	o 80°C (with no condensation or i	cing)				
Storage Humidity	35 to 85% RH (with no condensation or icing)						
Insulation Resistance	Between Sensor outer cover and lead terminals: 20 MΩ min. (at 500 VDC)						
Dielectric Strength	Between Sensor outer cover and lead	d terminals: 500 VAC, 50/60 Hz min. fo	or 1 min (leakage current: 1 mA max.)				
Weight		5.2 g					

- Note: 1. At standard atmospheric pressure (1013.25 hPa).
 - 2. Dry gas must not contain large particles, e.g., dust, oil or mist.
 - 3. Type D6F-PH is based on thermal flow principle. Air flow is needed to measure the differential pressure. Typical characteristic of air flow by differential pressure is shown in the "Engineering Data" section.
 - 4. The zero point tolerance and span tolerance are independent uncertainties and add according to the principles of error propagation.

Engineering Data

■ Output Characteristics

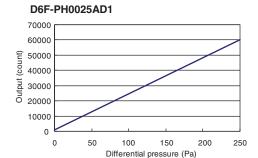

Differential pressure (Pa)	0	50	100	150	200	250
Output	1024	13024	25024	37024	49024	61024
(Hex)	(0x0400)	(0x32E0)	(0x61C0)	(0x90A0)	(0xBF80)	(0xEE60)

Differential pressure conversion formula: DP = (Op - 1024) / 60000 x 250

DP = Differential pressure, OP = Output


70000						
60000						
₹ 50000					_/	
50000 40000 30000 20000						-
₫ 30000						_
Ö 20000						_
10000		_				_
0						
-5	0	-30	-10	10	30	50
			Differential	pressure ((Pa)	

Differential pressure (Pa)	-50	-30	-10	0	10	30	50
Output	1024	13024	25024	31024	37024	49024	61024
(Hex)	(0x0400)	(0x32E0)	(0x61C0)	(0x7930)	(0x90A0)	(0xBF80)	(0xEE60)

Differential pressure conversion formula: DP = $(Op - 1024) / 60000 \times 100 - 50$ DP = Differential pressure, OP = Output

D6F-PH5050AD3

D6F-PH0505AD3

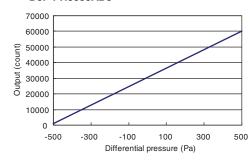


Differential pressure (Pa)	-500	-300	-100	0	100	300	500
Output	1024	11024	13024	16024	21024	31024	61024
(Hex)	(0x0400)	(0x2B10)	(0x32E0)	(0x3E98)	(0x5220)	(0x7930)	(0xEE60)


Differential pressure conversion formula: DP = (Op - 1024) / 60000 x 1000 - 500 DP = Differential pressure, OP = Output

Note: Measurement conditions: Power supply voltage of 3.3 ± 0.1 VDC, ambient temperature of 25 ± 5 °C, and ambient humidity of 25% to 75%.

Relation Between Pressure and Flow Rate

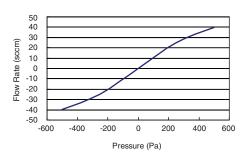


Electrical Connection

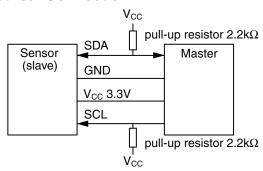

■ Communication

Method		I ² C	
Master/Slave		Slave / Address: HEX: 0x6C	
		BIN: 110_1100 (7bit)	
Speed mode		Fast Mode 400kHz	
Signals			
SCL		Serial Clock	
SDA		Data Signal	

Dimensions (unit: mm)

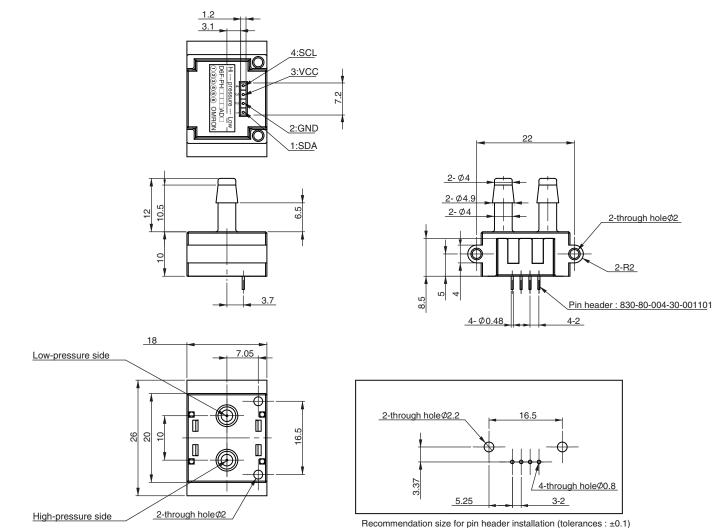

Precautions

-<u>/!</u> WARNING

The D6F is built for use with general-purpose devices. In cases such as those described below, where safety is required, implement measures to ensure the safety of the system and all devices, such as fail-safe designs, redundancy designs, and regular maintenance.

- Safety devices for ensuring safety for persons
- Transportation equipment control and Automotive control (such as applications to stop operation)
- Aviation and space equipment
- Nuclear power equipment

Do not use the D6F for applications in which D6F operation would directly affect human life.

(I) CAUTION

Make sure that the power to all equipment is turned OFF before you install the Sensor. Installing the Sensor while the power supply is ON may result in electrical shock or abnormal operation.

■ Correct Use

Fluids, Tubes, and Sensor Installation **All Models**

(1) Use clean fluids. Dust and mist can affect the characteristics of the Sensor or damage the Sensor. Install a filter and mist separator on the upstream tube.

(Not required for the D6F-W A1, D6F-P and D6F-PH.)

- (2) Do not use combustible gases (e.g., hydrogen), corrosive gases (e.g., chlorine, sulfur, acidic, or alkali gas), or other non-approved fluids. They may damage the Sensor.
- (3) The performance specifications that are given for the D6F do not apply if any fluids other than the specified applicable fluid are used.
- (4) Foreign matter in the tubes that are connected to the Sensor may damage the Sensor. Prevent any foreign matter from entering the tubes after the Sensor is removed from its packaging.
- (5) Attach the tubes so that fluid flows only in the direction designated by the "Hi/Low" pressure markings on the Sensor. Correct measurements cannot be obtained if the fluid flows in the wrong direction.
- (6) We recommend that you install the tubes horizontally. If the tubes are not installed horizontally, an error of ±1% FS or higher may result. (This does not apply to the D6F-03A3.)
- (7) Install the Sensor on a flat surface. Incorrect installation may damage the Sensor and make it impossible to obtain correct measurements.
- (8) After the Sensor is installed, check to confirm that it operates correctly.
- (9) Do not drop the Sensor, remove the cover, or attempt to disassemble the Sensor in any way.

D6F-PH0025AD1, D6F-PH0505AD3, and D6F-PH5050AD3

- (1) Depending on the ambient environment and installation location, dust, dirt, and other foreign matter may come inside the Sensor and block a part or all of the flow path or accumulate on internal components. This may result in the Sensor not being able to perform to the specifications given above. Always perform a pre-evaluation on your actual equipment and be aware of the possible problems that may occur before you use the Sensor with the actual equipment.
- (2) Attach all tubes so that the fluid flows only in the direction from the positive side (+) to the negative side (-).
- (3) For PCB-mounting, perform terminal soldering only after the Sensor is secured into place on the PCB.
- (4) Use M1.8 panhead screws or equivalent tapping screws to mount the Sensor, and tighten the screws to a maximum torque of 0.36 N·m.
- (5) The sensor output is minimally affected with the length of a tube. The error is less than 1% with a tube (ID:4mm) length up to 800mm.
- (6) Soldering
 - · Please solder properly
 - Do not use flow soldering
 - · Please solder after fixed on the circuit board by screw
 - · Please use a soldering iron

Soldering condition Pressure: Max.100qf 350 °C Temperature: Time:

(7) About handling

• The sensor is a precision device, and if large shock and load is applied, it may cause a failure or characteristic change. Please do not use the sensor which has experienced excessive shock to the terminals, a damaged cover, or has fallen.

Max.5s

• The sensor shall only be handled in electrostatic discharge protected areas (EPA) under protected and controlled conditions.

Operating Environment

Do not use the Sensor in the following locations:

- · Locations directly subject to heat radiated from heating equipment
- · Locations subject to water or oil
- Locations subject to direct sunlight
- · Locations subject to intense temperature changes
- · Locations subject to icing or condensation
- · Locations subject to excessive vibration or shock

Countermeasures against Noise

Noise may make it impossible to obtain correct measurements.

Consider the following countermeasures.

- Allow as much space as possible between the Sensor and devices that generate high frequencies (such as high-frequency welders and high-frequency sewing machines) or surges.
- · Attach surge absorbers or noise filters to noise-generating devices that are near the Sensor (in particular, equipment with inductance, such as motors, transformers, solenoids, and magnetic coils).

(It also helps to separate pipes and ducts, and to use shielded cables.)

Power Supply

- Do not directly solder power supply leads to the connector terminals. Use only the appropriate connectors.
- Wire with the correct terminal names and polarities. Incorrect wiring will cause failure of internal components.
- · When using a commercially available switching regulator, ground the FG (frame ground) and G (ground) terminals.

RoHS Directive

The RoHS mark is displayed on the packing of products for which the six substances banned by the RoHS Directive have been abolished (both in processing and in the electronic components mounted to the PCBs).

*RoHS marking may be terminated if it is later determined that parts that were previously treated as RoHS compliant are not compliant due to circumstances at the supplier of the parts.

RoHS Compliance Criteria

The following standards are used to determine RoHS compliance for the six banned substances. (Items to which the RoHS Directive is not applicable are not given.)

• Lead: 1,000 ppm max.

Hexavalent chromium: 1,000 ppm max.

• Mercury: 1,000 ppm max. • PBB: 1,000 ppm max. · Cadmium: 100 ppm max. • PBDE: 1,000 ppm max.

Gas Density and Atmospheric Pressure

Change of gas density affects the sensor output.

Change of atmospheric pressure is compensated by the following formula:

Dpeff = Dp x (Pstd / Pamb)


Dpeff: Effective differential pressure

Dp: Differential pressure of the sensor output

Pstd: Standard atmospheric pressure (1,013.25 hPa)

Pamb: Actual ambient atmospheric pressure (hPa)

OMRON

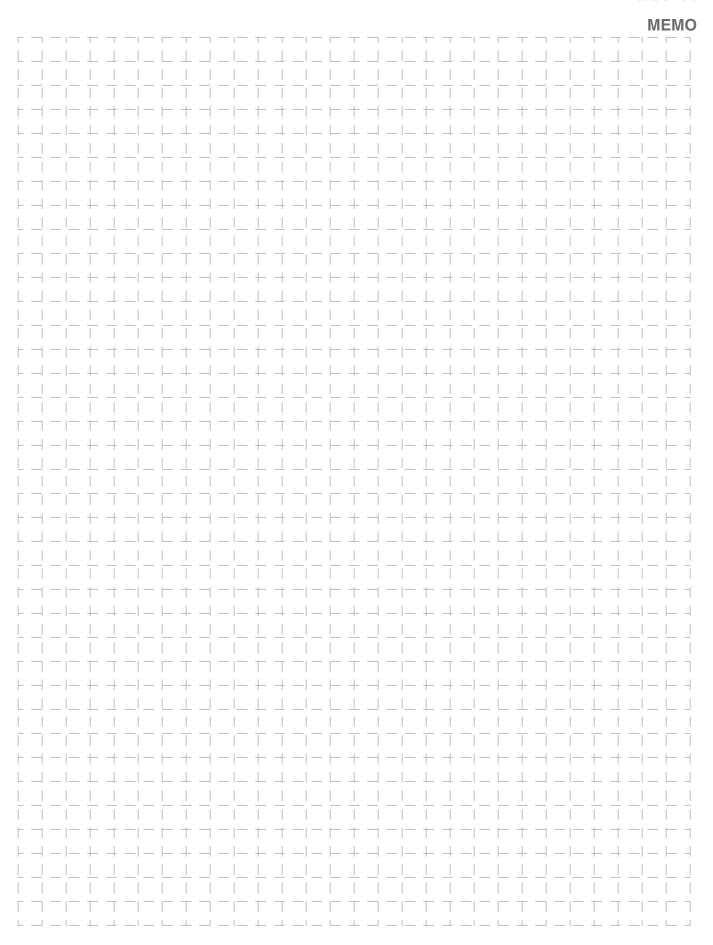

All sales are subject to Omron Electronic Components LLC standard terms and conditions of sale, which can be found at http://www.components.omron.com/components/web/webfiles.nsf/sales_terms.html

ALL DIMENSIONS SHOWN ARE IN MILLIMETERS.To convert millimeters into inches, multiply by 0.03937. To convert grams into ounces, multiply by 0.03527.

OMRON:

OMRON ELECTRONIC **COMPONENTS LLC** 55 E. Commerce Drive, Suite B Schaumburg, IL 60173

847-882-2288

Cat. No. D6F-PH_E_ver.1

05/13

Specifications subject to change without notice

OMRON ON-LINE

Global - http://www.omron.com USA - http://www.components.omron.com

Printed in USA

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Omron:

D6F-PH0025AD1 D6F-PH5050AD3 D6F-PH0505AD3