


TruStability[®] Board Mount Pressure Sensors: HSC Series—High Accuracy Amplified Compensated Analog Output, ± 2.5 mbar to ± 40 mbar [± 1 inH₂O to ± 30 inH₂O]

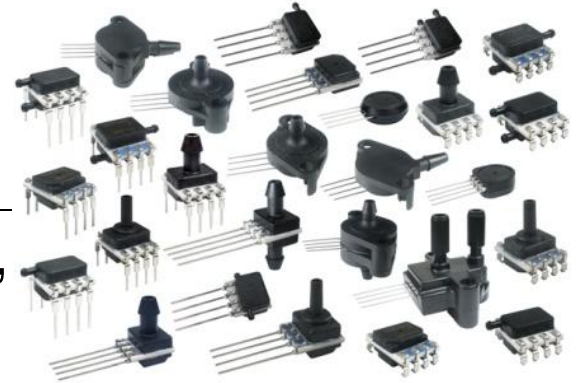

DESCRIPTION

The TruStability[®] High Accuracy Silicon Ceramic (HSC) Series is a piezoresistive silicon pressure sensor offering a ratiometric analog output for reading pressure over the specified full scale pressure span and temperature range.

The HSC Series is fully calibrated and temperature compensated for sensor offset, sensitivity, temperature effects, and non-linearity using an on-board Application Specific Integrated Circuit (ASIC). Calibrated output values for pressure are updated at approximately 1 kHz.

The HSC Series is calibrated over the temperature range of 0 °C to 50 °C [32 °F to 122 °F]. The sensor is characterized for operation from a single power supply of either 3.3 Vdc or 5.0 Vdc.

These sensors measure differential and gage pressures. Differential versions allow application of pressure to either side of the sensing diaphragm. Gage versions are referenced to atmospheric pressure and provide an output proportional to pressure variations from atmosphere.

The HSC Series sensors are intended for use with non-corrosive, non-ionic working fluids. They are designed and manufactured according to standards in ISO 9001.

FEATURES AND BENEFITS (★=competitive differentiator)

- ★ **Proprietary Honeywell technology:** Combines high sensitivity with high overpressure and burst pressure—two performance factors that are difficult to achieve in the same product; this gives the customer more flexibility in sensor implementation and reduces the customer design requirements for protecting the sensor without sacrificing the ability to sense very small changes in pressure
- ★ **Industry-leading long-term stability:** Even after long-term use and thermal extremes, these sensors perform substantially better relative to stability than any other pressure sensor available in the industry today:
 - Minimizes system calibration needs
 - Maximizes system performance
 - Helps support system uptime by eliminating the need to service or replace the sensor during its application life
- ★ **Industry-leading Total Error Band (TEB):** Honeywell specifies TEB—the most comprehensive, clear, and meaningful measurement—that provides the sensor's true accuracy over a compensated range of 0 °C to 50 °C [32 °F to 122 °F]:
 - Eliminates individually testing and calibrating every sensor, which can increase their manufacturing time and process
 - Supports system accuracy and warranty requirements
 - Helps to optimize system uptime
 - Provides excellent sensor interchangeability—there is minimal part-to-part variation in accuracy

TruStability® Board Mount Pressure Sensors: HSC Series—High Accuracy

- ★ **Industry-leading accuracy:** Extremely tight accuracy of ± 0.25 %FSS BFSL (Full Scale Span Best Fit Straight Line):
 - Reduces software needs to correct system inaccuracies, minimizing system design time
 - Supports system accuracy and warranty requirements
 - Helps to optimize system uptime
- ★ **High burst pressures above 415 inH₂O (1034 mbar):**
 - Allows the sensor to endure a wide range of conditions while maintaining a high level of sensitivity which measures even the smallest change in pressure
 - Can simplify the design process
- ★ **High working pressure ranges above 135 inH₂O (336 mbar):** Allows ultra-low pressure sensors to be used continuously well above the calibrated pressure range
- ★ **Industry-leading flexibility**
 - Modular, flexible design with many package styles (with the same industry-leading stability), pressure ports, and options simplify integration into the device manufacturer's application
 - Available soon: single side liquid media option allows the end customer to use one port of the sensor with condensing humidity or directly with non-corrosive liquid media
- ★ **Repeatability:** Provides excellent repeatability, high accuracy and reliability under many demanding conditions
- ★ **Onboard signal conditioning:** Typically allows for the removal of signal conditioning components from the PCB, reducing costs and simplifying production processes
- ★ **Wide variety of pressure ranges:** From ± 2.5 mbar to ± 40 mbar [± 1 inH₂O to ± 30 inH₂O] provide support for many unique applications
- ★ **Meets IPC/JEDEC J-STD-020D.1 Moisture Sensitivity Level 1 requirements:**
 - Allows the customer to avoid the thermal and mechanical damage during solder reflow attachment and/or repair that lesser rated products would incur
- Allows unlimited floor life when stored as specified (≤ 30 °C/85 %RH), simplifying storage and reducing scrap
- ★ **Insensitive to mounting orientation:**
 - Allows customers to position the sensor in the most optimal point in the system, eliminating the concern for positional effects
 - Increases flexibility of use within the application
- ★ **Insensitive to vibration:** Reduces susceptibility to application-specific vibration that occurs with changes in pressure, minimizing inaccurate pressure readings
- ★ **Custom calibration:** Typically allows for the removal of additional components associated with signal conditioning from the PCB, reducing PCB size as well as costs often associated with those components (e.g., acquisition, inventory, assembly)
- ★ **Internal diagnostic functions:** Increases system reliability
- **Energy efficient:** Extremely low power consumption (less than 10 mW, typ.):
 - Reduces power consumption
 - Provides extended battery life
 - Promotes energy efficiency
- **Output:** Ratiometric analog; I²C- or SPI-compatible 14-bit digital output (min. 12-bit sensor resolution) available
- **Small size:** Miniature 10 mm x 10 mm [0.39 in x 0.39 in] package is very small when compared to most board mount pressure sensors:
 - Occupies less area on the PCB
 - Typically allows for easy placement on crowded PCBs or in small devices
- **RoHS compliant**
- **Protected by multiple global patents**

POTENTIAL APPLICATIONS

- **Medical:**
 - Ventilators
 - Anesthesia machines
 - Spirometers
 - Nebulizers
 - Hospital room air pressure
- **Industrial:**
 - VAV (Variable Air Volume) control
 - Static duct pressure
 - Clogged HVAC (Heating, Ventilation, and Air Conditioning) filter detection
 - HVAC transmitters
 - Indoor air quality

For more information on these potential applications, please see the application note [“Honeywell TruStability® Board Mount Pressure Sensors: HSC Series and SSC Series, Amplified Compensated Digital or Analog Output, \$\pm 2.5\$ mbar to \$\pm 40\$ mbar \[\$\pm 1\$ inH₂O to \$\pm 30\$ inH₂O\]”](#).

± 2.5 mbar to ± 40 mbar [± 1 inH₂O to ± 30 inH₂O]

Table 1. Absolute Maximum Ratings¹

Parameter	Min.	Max.	Unit
Supply voltage (V _{supply})	-0.3	6.0	Vdc
Voltage on any pin	-0.3	V _{supply} + 0.3	V
ESD susceptibility (human body model)	2	-	kV
Storage temperature	-40 [-40]	85 [185]	°C [°F]
Soldering time and temperature: Lead solder temperature (SIP, DIP) Peak reflow temperature (SMT)	4 s max. at 250 °C [482 °F] 15 s max. at 250 °C [482 °F]		

Table 2. Operating Specifications

Parameter	Min.	Typ.	Max.	Unit
Supply voltage (V _{supply}) ² : 3.3 Vdc 5.0 Vdc	3.27 4.95	3.3 ³ 5.0 ³	3.33 5.05	Vdc
<i>Sensors are either 3.3 Vdc or 5.0 Vdc based on listing selected.</i>				
Supply current: 3.3 Vdc supply 5.0 Vdc supply	- -	1.6 2	2.1 3	mA
Compensated temperature range ⁴	0 [32]	-	50 [122]	°C [°F]
Operating temperature range ⁵	-20 [-4]	-	85 [185]	°C [°F]
Startup time (power up to data ready)	-	2.8	7.3	ms
Response time	-	0.46	-	ms
Upper output clipping limit	-	-	97.5	V _{supply}
Lower output clipping limit	2.5	-	-	V _{supply}
Accuracy ⁶	-	-	±0.25	%FSS ⁸
Orientation sensitivity (±1 g) ⁷	-	-	±0.15	%FSS
Output resolution	0.03	-	-	%FSS

TruStability® Board Mount Pressure Sensors: HSC Series—High Accuracy

Table 3. Environmental Specifications

Parameter	Characteristic
Humidity:	
Gases only (See “Options N and D” in Figure 1.)	0% to 95% RH, non-condensing
Liquid media (See “Options T and V” in Figure 1.)	100% condensing or direct liquid media on Port 1
Vibration	MIL-STD-202F, Method 214, Condition F (20.7 g random)
Shock	MIL-STD-202F, Method 213B, Condition F
Life ⁹	1 million cycles to working pressure min. ¹⁰
Solder reflow	J-STD-020D.1, Moisture Sensitivity Level 1 (unlimited floor life when stored as specified ($\leq 30^{\circ}\text{C}/85\% \text{RH}$))

Table 4. Wetted Materials¹¹

Parameter	Port 1 (Pressure Port)	Port 2 (Reference Port)
Covers	high temperature polyamide	high temperature polyamide
Substrate	alumina ceramic	alumina ceramic
Adhesives	epoxy, silicone	epoxy, silicone
Electronic components	ceramic, glass, solder, silicon	silicon, glass, gold, solder

Notes:

1. Absolute maximum ratings are the extreme limits the device can withstand without damage to the product. Stresses above these ratings may cause permanent damage. Exposure to absolute maximum conditions for extended periods may degrade device reliability.
2. Ratiometricity of the sensor (the ability of the analog device to maintain performance parameters independent of supply voltage) is achieved when the supply voltage is within the operating specification range.
3. The sensor is not reverse polarity protected. Incorrect application of supply voltage or ground to the wrong pin may cause electrical failure.
4. The compensated temperature range is the temperature range over which the sensor will produce an output proportional to pressure within the specified performance limits.
5. The operating temperature range is the temperature range over which the sensor will produce an output proportional to pressure but may not remain within the specified performance limits.
6. Accuracy: The maximum deviation in output from a Best Fit Straight Line (BFSL) fitted to the output measured over the pressure range at 25°C [77°F]. Includes all errors due to pressure non-linearity, pressure hysteresis, and non-repeatability. (See Figure 3.)
7. Orientation sensitivity: The maximum change in offset of the sensor due to a change in position or orientation relative to Earth's gravitational field.
8. Full Scale Span (FSS): The algebraic difference between the output signal measured at the maximum (P_{max}) and minimum (P_{min}) limits of the pressure range. (See Figure 1 for ranges.)
9. Life may vary depending on specific application in which sensor is utilized. Contact Honeywell Sales and Service for Mean Time to Failure (MTTF) data.
10. Working Pressure: The maximum pressure that may be applied to any port of the sensor in continuous use. This pressure may be outside the operating pressure range limits (P_{min} to P_{max}) in which case the sensor may not provide a valid output until pressure is returned to within the operating pressure range. Tested to 1 million cycles, min. (See Figure 5.)
11. Contact Honeywell Sales and Service for detailed material information.

± 2.5 mbar to ± 40 mbar [± 1 inH₂O to ± 30 inH₂O]

Figure 1. Nomenclature and Order Guide

Series HSC			Supply Voltage 3 = 3.3 Vdc 5 = 5.0 Vdc																																																																																	
Package D = DIP (Dual Inline Pin) M = SMT (Surface Mount Technology) S = SIP (Single Inline Pin)			Transfer Function ¹² A = 10% to 90% of Vsupply																																																																																	
Pressure Port			Output Type ¹³ A = Analog voltage																																																																																	
<table border="1"> <thead> <tr> <th>DIP</th> <th>SMT</th> <th>SIP</th> </tr> </thead> <tbody> <tr> <td> NN = No ports </td> <td> NN = No ports </td> <td> NN = No ports </td> </tr> <tr> <td>-</td> <td>-</td> <td> AA = Dual axial barbed ports, opposite sides </td> </tr> <tr> <td> AN = Single axial barbed port </td> <td> AN = Single axial barbed port </td> <td> AN = Single axial barbed port </td> </tr> <tr> <td> LN = Single axial barbless port </td> <td> LN = Single axial barbless port </td> <td> LN = Single axial barbless port </td> </tr> <tr> <td>-</td> <td>-</td> <td> FF = Fastener mount, dual axial barbed ports, opposite sides* </td> </tr> <tr> <td>-</td> <td>-</td> <td> FN = Fastener mount, single axial barbed port * </td> </tr> <tr> <td>-</td> <td>-</td> <td> GN = Ribbed fastener mount, single axial barbed port* </td> </tr> <tr> <td>-</td> <td>-</td> <td> NB = Fastener mount, dual axial ports, same side* </td> </tr> <tr> <td> RN = Single radial barbed port </td> <td> RN = Single radial barbed port </td> <td> RN = Single radial barbed port </td> </tr> <tr> <td> RR = Dual radial barbed ports, same side </td> <td> RR = Dual radial barbed ports, same side </td> <td> RR = Dual radial barbed ports, same side </td> </tr> <tr> <td> DR = Dual radial barbed ports, opposite sides </td> <td> DR = Dual radial barbed ports, opposite sides </td> <td> DR = Dual radial barbed ports, opposite sides </td> </tr> <tr> <td>-</td> <td>-</td> <td> HH = Fastener mount, dual radial barbed ports, same side* </td> </tr> <tr> <td>-</td> <td>-</td> <td> HN = Fastener mount, single radial barbed port* </td> </tr> <tr> <td>-</td> <td>-</td> <td> MN = Manifold mount, outer diameter seal* </td> </tr> <tr> <td>-</td> <td>-</td> <td> SN = Manifold mount, inner diameter seal* </td> </tr> </tbody> </table>			DIP	SMT	SIP	NN = No ports 	NN = No ports 	NN = No ports 	-	-	AA = Dual axial barbed ports, opposite sides 	AN = Single axial barbed port 	AN = Single axial barbed port 	AN = Single axial barbed port 	LN = Single axial barbless port 	LN = Single axial barbless port 	LN = Single axial barbless port 	-	-	FF = Fastener mount, dual axial barbed ports, opposite sides* 	-	-	FN = Fastener mount, single axial barbed port * 	-	-	GN = Ribbed fastener mount, single axial barbed port* 	-	-	NB = Fastener mount, dual axial ports, same side* 	RN = Single radial barbed port 	RN = Single radial barbed port 	RN = Single radial barbed port 	RR = Dual radial barbed ports, same side 	RR = Dual radial barbed ports, same side 	RR = Dual radial barbed ports, same side 	DR = Dual radial barbed ports, opposite sides 	DR = Dual radial barbed ports, opposite sides 	DR = Dual radial barbed ports, opposite sides 	-	-	HH = Fastener mount, dual radial barbed ports, same side* 	-	-	HN = Fastener mount, single radial barbed port* 	-	-	MN = Manifold mount, outer diameter seal* 	-	-	SN = Manifold mount, inner diameter seal* 	Pressure Range ^{14, 15} <table border="1"> <thead> <tr> <th>inH₂O (at 4 °C)</th> <th>mbar</th> </tr> </thead> <tbody> <tr> <td>Differential</td> <td>Differential</td> </tr> <tr> <td>001ND = ± 1 inH₂O</td> <td>2.5MD = ± 2.5 mbar</td> </tr> <tr> <td>002ND = ± 2 inH₂O</td> <td>004MD = ± 4 mbar</td> </tr> <tr> <td>004ND = ± 4 inH₂O</td> <td>006MD = ± 6 mbar</td> </tr> <tr> <td>005ND = ± 5 inH₂O</td> <td>010MD = ± 10 mbar</td> </tr> <tr> <td>010ND = ± 10 inH₂O</td> <td>016MD = ± 16 mbar</td> </tr> <tr> <td>020ND = ± 20 inH₂O</td> <td>025MD = ± 25 mbar</td> </tr> <tr> <td>030ND = ± 30 inH₂O</td> <td>040MD = ± 40 mbar</td> </tr> <tr> <td>Gage</td> <td>Gage</td> </tr> <tr> <td>002NG = 0 inH₂O to 2 inH₂O</td> <td>004MG = 0 mbar to 4 mbar</td> </tr> <tr> <td>004NG = 0 inH₂O to 4 inH₂O</td> <td>006MG = 0 mbar to 6 mbar</td> </tr> <tr> <td>005NG = 0 inH₂O to 5 inH₂O</td> <td>010MG = 0 mbar to 10 mbar</td> </tr> <tr> <td>010NG = 0 inH₂O to 10 inH₂O</td> <td>016MG = 0 mbar to 16 mbar</td> </tr> <tr> <td>020NG = 0 inH₂O to 20 inH₂O</td> <td>025MG = 0 mbar to 25 mbar</td> </tr> <tr> <td>030NG = 0 inH₂O to 30 inH₂O</td> <td>040MG = 0 mbar to 40 mbar</td> </tr> </tbody> </table>		inH ₂ O (at 4 °C)	mbar	Differential	Differential	001ND = ± 1 inH ₂ O	2.5MD = ± 2.5 mbar	002ND = ± 2 inH ₂ O	004MD = ± 4 mbar	004ND = ± 4 inH ₂ O	006MD = ± 6 mbar	005ND = ± 5 inH ₂ O	010MD = ± 10 mbar	010ND = ± 10 inH ₂ O	016MD = ± 16 mbar	020ND = ± 20 inH ₂ O	025MD = ± 25 mbar	030ND = ± 30 inH ₂ O	040MD = ± 40 mbar	Gage	Gage	002NG = 0 inH ₂ O to 2 inH ₂ O	004MG = 0 mbar to 4 mbar	004NG = 0 inH ₂ O to 4 inH ₂ O	006MG = 0 mbar to 6 mbar	005NG = 0 inH ₂ O to 5 inH ₂ O	010MG = 0 mbar to 10 mbar	010NG = 0 inH ₂ O to 10 inH ₂ O	016MG = 0 mbar to 16 mbar	020NG = 0 inH ₂ O to 20 inH ₂ O	025MG = 0 mbar to 25 mbar	030NG = 0 inH ₂ O to 30 inH ₂ O	040MG = 0 mbar to 40 mbar
DIP	SMT	SIP																																																																																		
NN = No ports 	NN = No ports 	NN = No ports 																																																																																		
-	-	AA = Dual axial barbed ports, opposite sides 																																																																																		
AN = Single axial barbed port 	AN = Single axial barbed port 	AN = Single axial barbed port 																																																																																		
LN = Single axial barbless port 	LN = Single axial barbless port 	LN = Single axial barbless port 																																																																																		
-	-	FF = Fastener mount, dual axial barbed ports, opposite sides* 																																																																																		
-	-	FN = Fastener mount, single axial barbed port * 																																																																																		
-	-	GN = Ribbed fastener mount, single axial barbed port* 																																																																																		
-	-	NB = Fastener mount, dual axial ports, same side* 																																																																																		
RN = Single radial barbed port 	RN = Single radial barbed port 	RN = Single radial barbed port 																																																																																		
RR = Dual radial barbed ports, same side 	RR = Dual radial barbed ports, same side 	RR = Dual radial barbed ports, same side 																																																																																		
DR = Dual radial barbed ports, opposite sides 	DR = Dual radial barbed ports, opposite sides 	DR = Dual radial barbed ports, opposite sides 																																																																																		
-	-	HH = Fastener mount, dual radial barbed ports, same side* 																																																																																		
-	-	HN = Fastener mount, single radial barbed port* 																																																																																		
-	-	MN = Manifold mount, outer diameter seal* 																																																																																		
-	-	SN = Manifold mount, inner diameter seal* 																																																																																		
inH ₂ O (at 4 °C)	mbar																																																																																			
Differential	Differential																																																																																			
001ND = ± 1 inH ₂ O	2.5MD = ± 2.5 mbar																																																																																			
002ND = ± 2 inH ₂ O	004MD = ± 4 mbar																																																																																			
004ND = ± 4 inH ₂ O	006MD = ± 6 mbar																																																																																			
005ND = ± 5 inH ₂ O	010MD = ± 10 mbar																																																																																			
010ND = ± 10 inH ₂ O	016MD = ± 16 mbar																																																																																			
020ND = ± 20 inH ₂ O	025MD = ± 25 mbar																																																																																			
030ND = ± 30 inH ₂ O	040MD = ± 40 mbar																																																																																			
Gage	Gage																																																																																			
002NG = 0 inH ₂ O to 2 inH ₂ O	004MG = 0 mbar to 4 mbar																																																																																			
004NG = 0 inH ₂ O to 4 inH ₂ O	006MG = 0 mbar to 6 mbar																																																																																			
005NG = 0 inH ₂ O to 5 inH ₂ O	010MG = 0 mbar to 10 mbar																																																																																			
010NG = 0 inH ₂ O to 10 inH ₂ O	016MG = 0 mbar to 16 mbar																																																																																			
020NG = 0 inH ₂ O to 20 inH ₂ O	025MG = 0 mbar to 25 mbar																																																																																			
030NG = 0 inH ₂ O to 30 inH ₂ O	040MG = 0 mbar to 40 mbar																																																																																			
Options N = Gases only, no special options D = Gases only, diagnostics on T = Liquid media on Port 1, no diagnostics* V = Liquid media on Port 1, diagnostics on*																																																																																				
CAUTION PRODUCT DAMAGE - Ensure liquid media is applied to Port 1 only; Port 2 is not compatible with liquids. - Ensure liquid media contains no particulates. All TruStability® sensors are dead-ended devices. Particulates can accumulate inside the sensor, causing damage or affecting sensor output. - Recommend that the sensor be positioned with Port 1 facing downwards; any particulates in the system are less likely to enter and settle within the pressure sensor if it is in this position. - Ensure liquid media does not create a residue when dried; build-up inside the sensor may affect sensor output. Rinsing of a dead-ended sensor is difficult and has limited effectiveness for removing residue. - Ensure liquid media are compatible with wetted materials. Non-compatible liquid media will degrade sensor performance and may lead to sensor failure. Failure to comply with these instructions may result in product damage.																																																																																				

*Indicates available soon.

Notes:

- The transfer function limits define the output of the sensor at a given pressure input. By specifying Pmin. and Pmax., the output at Pmin. and Pmax., the complete transfer function of the sensor is defined. See Figure 2 for a graphical representation of the transfer function. Other transfer functions are available. Contact Honeywell Sales and Service for more information.
- Analog output is also available. Contact Honeywell Sales and Service for more information.
- Custom pressure ranges are available. Contact Honeywell Sales and Service for more information.
- See Table 5 for an explanation of sensor pressure types.

TruStability® Board Mount Pressure Sensors: HSC Series–High Accuracy

Figure 2. Completed Catalog Listing Example for HSCSANN010NGAA3

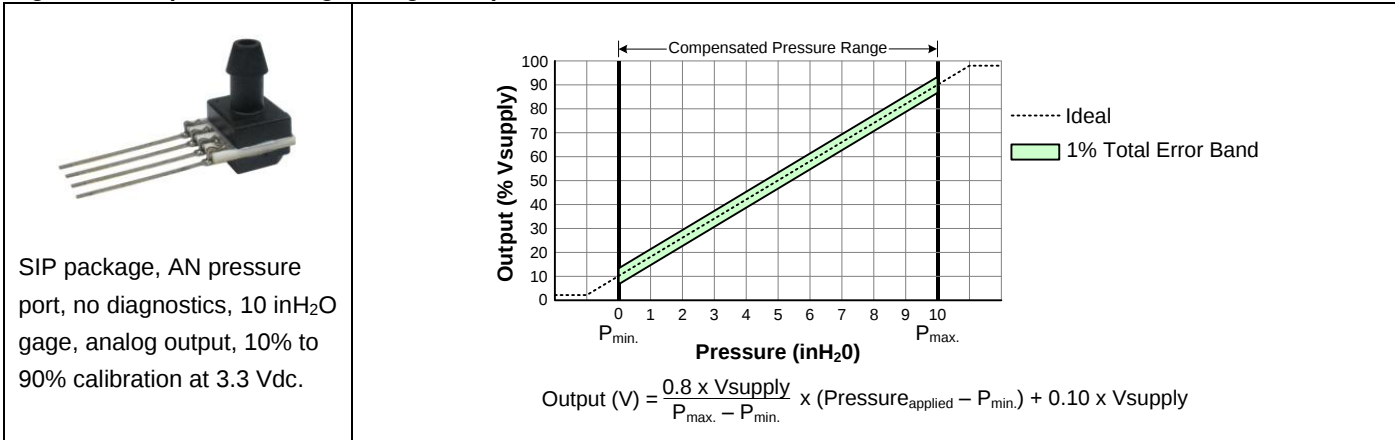


Table 5. Pressure Types

Pressure Type	Description
Differential	Output is proportional to the difference between the pressures applied to each port (Port 1 – Port 2). 50% point of transfer function set at Port 1 = Port 2.
Gage	Output is proportional to the difference between applied pressure and atmospheric (ambient) pressure. P _{min.} is set at atmospheric pressure.

Table 6. Pressure Range Specifications for ±1 inH₂O to ±30 inH₂O

Order Code (See Fig. 1)	Pressure Range		Total Error Band ¹⁶	Total Error Band after Auto-Zero ¹⁷	Long-term Stability (1000 hr, 25 °C [77 °F])	Working Pressure ¹⁰	Over-pressure ¹⁸	Burst Pressure ¹⁹	Common Mode Pressure ²⁰
	P _{min.}	P _{max.}							
Differential									
001ND	-1 inH ₂ O	1 inH ₂ O	±3 %FSS	±1.5 %FSS	±0.5 %FSS	135 inH ₂ O	270 inH ₂ O	415 inH ₂ O	1400 inH ₂ O
002ND	-2 inH ₂ O	2 inH ₂ O	±1.5%FSS	±1 %FSS	±0.5 %FSS	135 inH ₂ O	270 inH ₂ O	415 inH ₂ O	1400 inH ₂ O
004ND	-4 inH ₂ O	4 inH ₂ O	±1 %FSS	±0.75 %FSS	±0.5 %FSS	150 inH ₂ O	300 inH ₂ O	500 inH ₂ O	2200 inH ₂ O
005ND	-5 inH ₂ O	5 inH ₂ O	±1 %FSS	±0.75 %FSS	±0.5 %FSS	150 inH ₂ O	300 inH ₂ O	500 inH ₂ O	2200 inH ₂ O
010ND	-10 inH ₂ O	10 inH ₂ O	±1 %FSS	±0.75 %FSS	±0.5 %FSS	175 inH ₂ O	350 inH ₂ O	550 inH ₂ O	4200 inH ₂ O
020ND	-20 inH ₂ O	20 inH ₂ O	±1 %FSS	±0.75 %FSS	±0.35 %FSS	175 inH ₂ O	350 inH ₂ O	550 inH ₂ O	4200 inH ₂ O
030ND	-30 inH ₂ O	30 inH ₂ O	±1 %FSS	±0.75 %FSS	±0.35 %FSS	175 inH ₂ O	350 inH ₂ O	550 inH ₂ O	4200 inH ₂ O
Gage									
002NG	0 inH ₂ O	2 inH ₂ O	±3 %FSS	±1.5 %FSS	±0.5 %FSS	135 inH ₂ O	270 inH ₂ O	415 inH ₂ O	1400 inH ₂ O
004NG	0 inH ₂ O	4 inH ₂ O	±1.5 %FSS	±1 %FSS	±0.5 %FSS	135 inH ₂ O	270 inH ₂ O	415 inH ₂ O	1400 inH ₂ O
005NG	0 inH ₂ O	5 inH ₂ O	±1.5 %FSS	±1 %FSS	±0.5 %FSS	135 inH ₂ O	270 inH ₂ O	415 inH ₂ O	1400 inH ₂ O
010NG	0 inH ₂ O	10 inH ₂ O	±1 %FSS	±0.75 %FSS	±0.5 %FSS	150 inH ₂ O	300 inH ₂ O	500 inH ₂ O	2200 inH ₂ O
020NG	0 inH ₂ O	20 inH ₂ O	±1 %FSS	±0.75 %FSS	±0.5 %FSS	175 inH ₂ O	350 inH ₂ O	550 inH ₂ O	4200 inH ₂ O
030NG	0 inH ₂ O	30 inH ₂ O	±1 %FSS	±0.75 %FSS	±0.35 %FSS	175 inH ₂ O	350 inH ₂ O	550 inH ₂ O	4200 inH ₂ O

± 2.5 mbar to ± 40 mbar [± 1 inH₂O to ± 30 inH₂O]

Table 7. Pressure Range Specifications for ± 2.5 mbar to ± 40 mbar

Order Code (See Fig. 1)	Pressure Range		Total Error Band ¹⁶	Total Error Band after Auto-Zero ¹⁷	Long-term Stability (1000 hr, 25 °C [77 °F])	Working Pressure ¹⁰	Over-pressure ¹⁸	Burst Pressure ¹⁹	Common Mode Pressure ²⁰
	P _{min.}	P _{max.}							
Differential									
2.5MD	-2.5 mbar	2.5 mbar	±3 %FSS	±1.5 %FSS	±0.5 %FSS	335 mbar	675 mbar	1000 mbar	3450 mbar
004MD	-4 mbar	4 mbar	±2 %FSS	±1.25 %FSS	±0.5 %FSS	335 mbar	675 mbar	1000 mbar	3450 mbar
006MD	-6 mbar	6 mbar	±1.5 %FSS	±1 %FSS	±0.5 %FSS	335 mbar	675 mbar	1000 mbar	3450 mbar
010MD	-10 mbar	10 mbar	±1 %FSS	±0.75 %FSS	±0.5 %FSS	375 mbar	750 mbar	1250 mbar	5450 mbar
016MD	-16 mbar	16 mbar	±1 %FSS	±0.75 %FSS	±0.5 %FSS	375 mbar	750 mbar	1250 mbar	5450 mbar
025MD	-25 mbar	25 mbar	±1 %FSS	±0.75 %FSS	±0.35 %FSS	435 mbar	850 mbar	1350 mbar	10450 mbar
040MD	-40 mbar	40 mbar	±1 %FSS	±0.75 %FSS	±0.35 %FSS	435 mbar	850 mbar	1350 mbar	10450 mbar
Gage									
004MG	0 mbar	4 mbar	±3 %FSS	±1.5 %FSS	±0.5 %FSS	335 mbar	675 mbar	1000 mbar	3450 mbar
006MG	0 mbar	6 mbar	±2.5 %FSS	±1.25 %FSS	±0.5 %FSS	335 mbar	675 mbar	1000 mbar	3450 mbar
010MG	0 mbar	10 mbar	±1.5 %FSS	±1 %FSS	±0.5 %FSS	335 mbar	675 mbar	1000 mbar	3450 mbar
016MG	0 mbar	16 mbar	±1.5 %FSS	±1 %FSS	±0.5 %FSS	335 mbar	675 mbar	1000 mbar	3450 mbar
025MG	0 mbar	25 mbar	±1 %FSS	±0.75 %FSS	±0.5 %FSS	375 mbar	750 mbar	1250 mbar	5450 mbar
040MG	0 mbar	40 mbar	±1 %FSS	±0.75 %FSS	±0.5 %FSS	375 mbar	750 mbar	1250 mbar	5450 mbar

Notes:

16. Total Error Band: The maximum deviation from the ideal transfer function over the entire compensated temperature and pressure range. Includes all errors due to offset, full scale span, pressure non-linearity, pressure hysteresis, repeatability, thermal effect on offset, thermal effect on span, and thermal hysteresis. (See Figures 3 and 4.)
17. Total Error Band After Auto-Zero: The maximum deviation from the ideal transfer function over the entire compensated pressure range at a constant temperature and supply voltage for a minimum of 24 hours after an auto-zero operation. Includes all errors due to full scale span, pressure non-linearity, pressure hysteresis, and thermal effect on span.
18. Overpressure: The absolute maximum rating for pressure which may safely be applied to the product for it to remain in specification once pressure is returned to the operating pressure range. Exposure to higher pressures may cause permanent damage to the product. Unless otherwise specified this applies to all available pressure ports at any temperature with the operating temperature range. Tested to 10,000 cycles, minimum. (See Figure 5.)
19. Burst Pressure: The maximum pressure that may be applied to any port of the product without causing escape of pressure media. Product should not be expected to function after exposure to any pressure beyond the burst pressure. (See Figure 5.)
20. Common Mode Pressure: The maximum pressure that can be applied simultaneously to both ports of a differential pressure sensor without causing changes in specified performance.

Table 8. Pinout for SMT and DIP Packages

Output Type	Pin 1	Pin 2	Pin 3	Pin 4	Pin 5	Pin 6	Pin 7	Pin 8
analog	NC	V _{supply}	OUTPUT+	GND	NC	NC	NC	NC

Table 9. Pinout for SIP Package

Output Type	Pin 1	Pin 2	Pin 3	Pin 4
analog	NC	V _{supply}	OUTPUT+	GND

TruStability® Board Mount Pressure Sensors: HSC Series–High Accuracy

Figure 3. Total Error Band Explanation

Total Error Band should not be confused with accuracy, which is actually a component of Total Error Band, as shown to the right.

Many competitors simply specify the accuracy of their device; however, the specification may exclude errors, or may be calculated over a very narrow range, at only one point in the range, or at their absolute best accuracy level. It is then up to the customer to calibrate the device to make sure it has the accuracy needed for the life of the application.

Honeywell provides the Total Error Band to its customers so that they can implement the TruStability® sensors quickly and easily without having to calculate the effects of individual errors that might be encountered in their application.

All TruStability® products are designed to remain within Total Error Band after exposure to the environmental conditions in Table 3, including the solder reflow process.

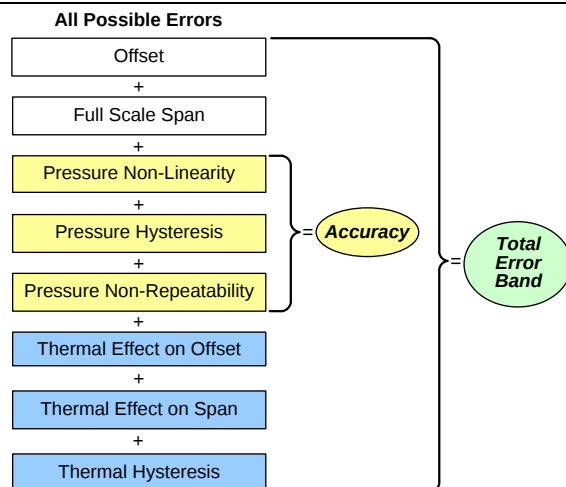


Figure 4. HSC Series Total Error Band Values for Full Scale Span Pressure Ranges


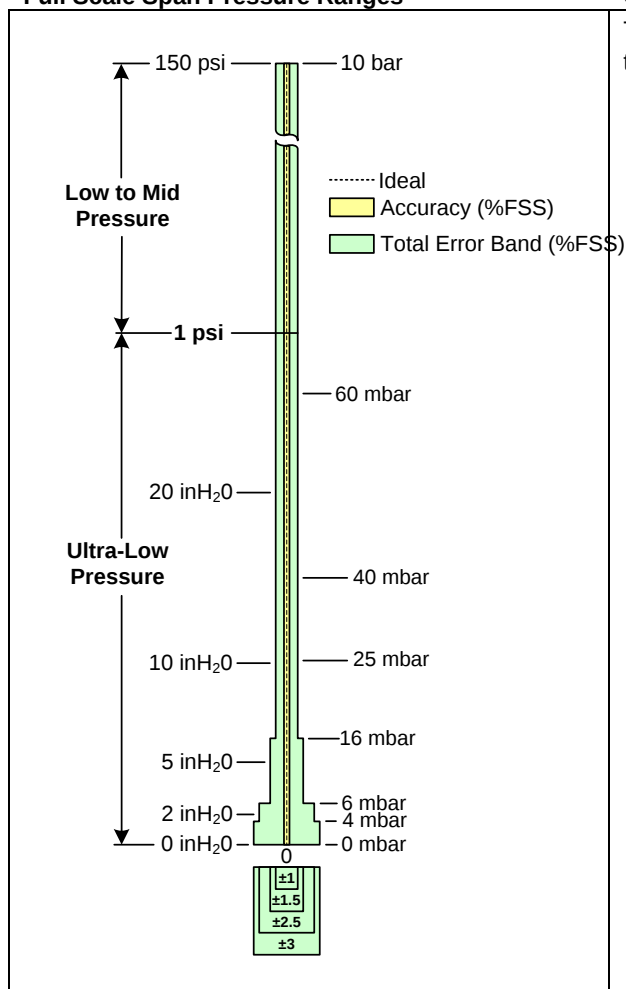



Figure 5. Calibrated Pressure Range, Working Pressure, Overpressure and Burst Pressure Relationship

The graphic below shows the relationship of the four pressure types at three locations: 30 inH₂O, 10 inH₂O and 4 mbar.

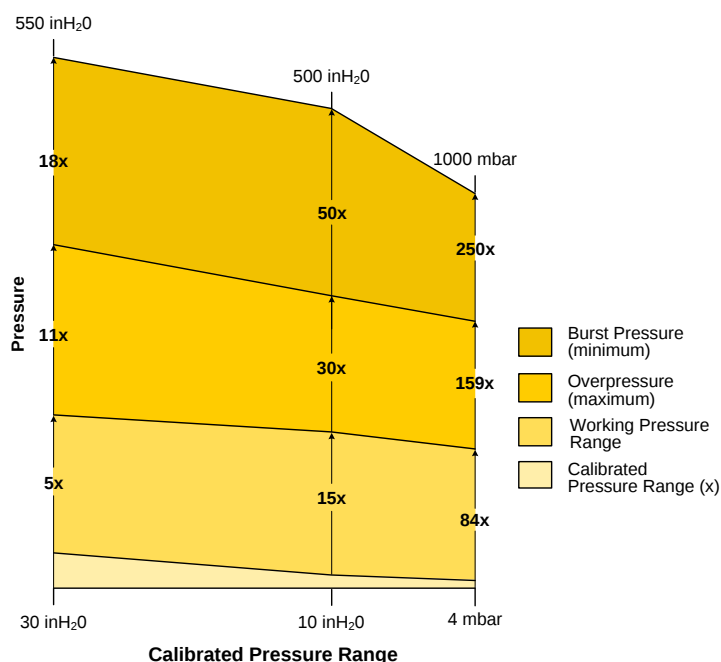


± 2.5 mbar to ± 40 mbar [± 1 inH₂O to ± 30 inH₂O]

Figure 6. DIP Pressure Port Dimensional Drawings (For reference only: mm [in])

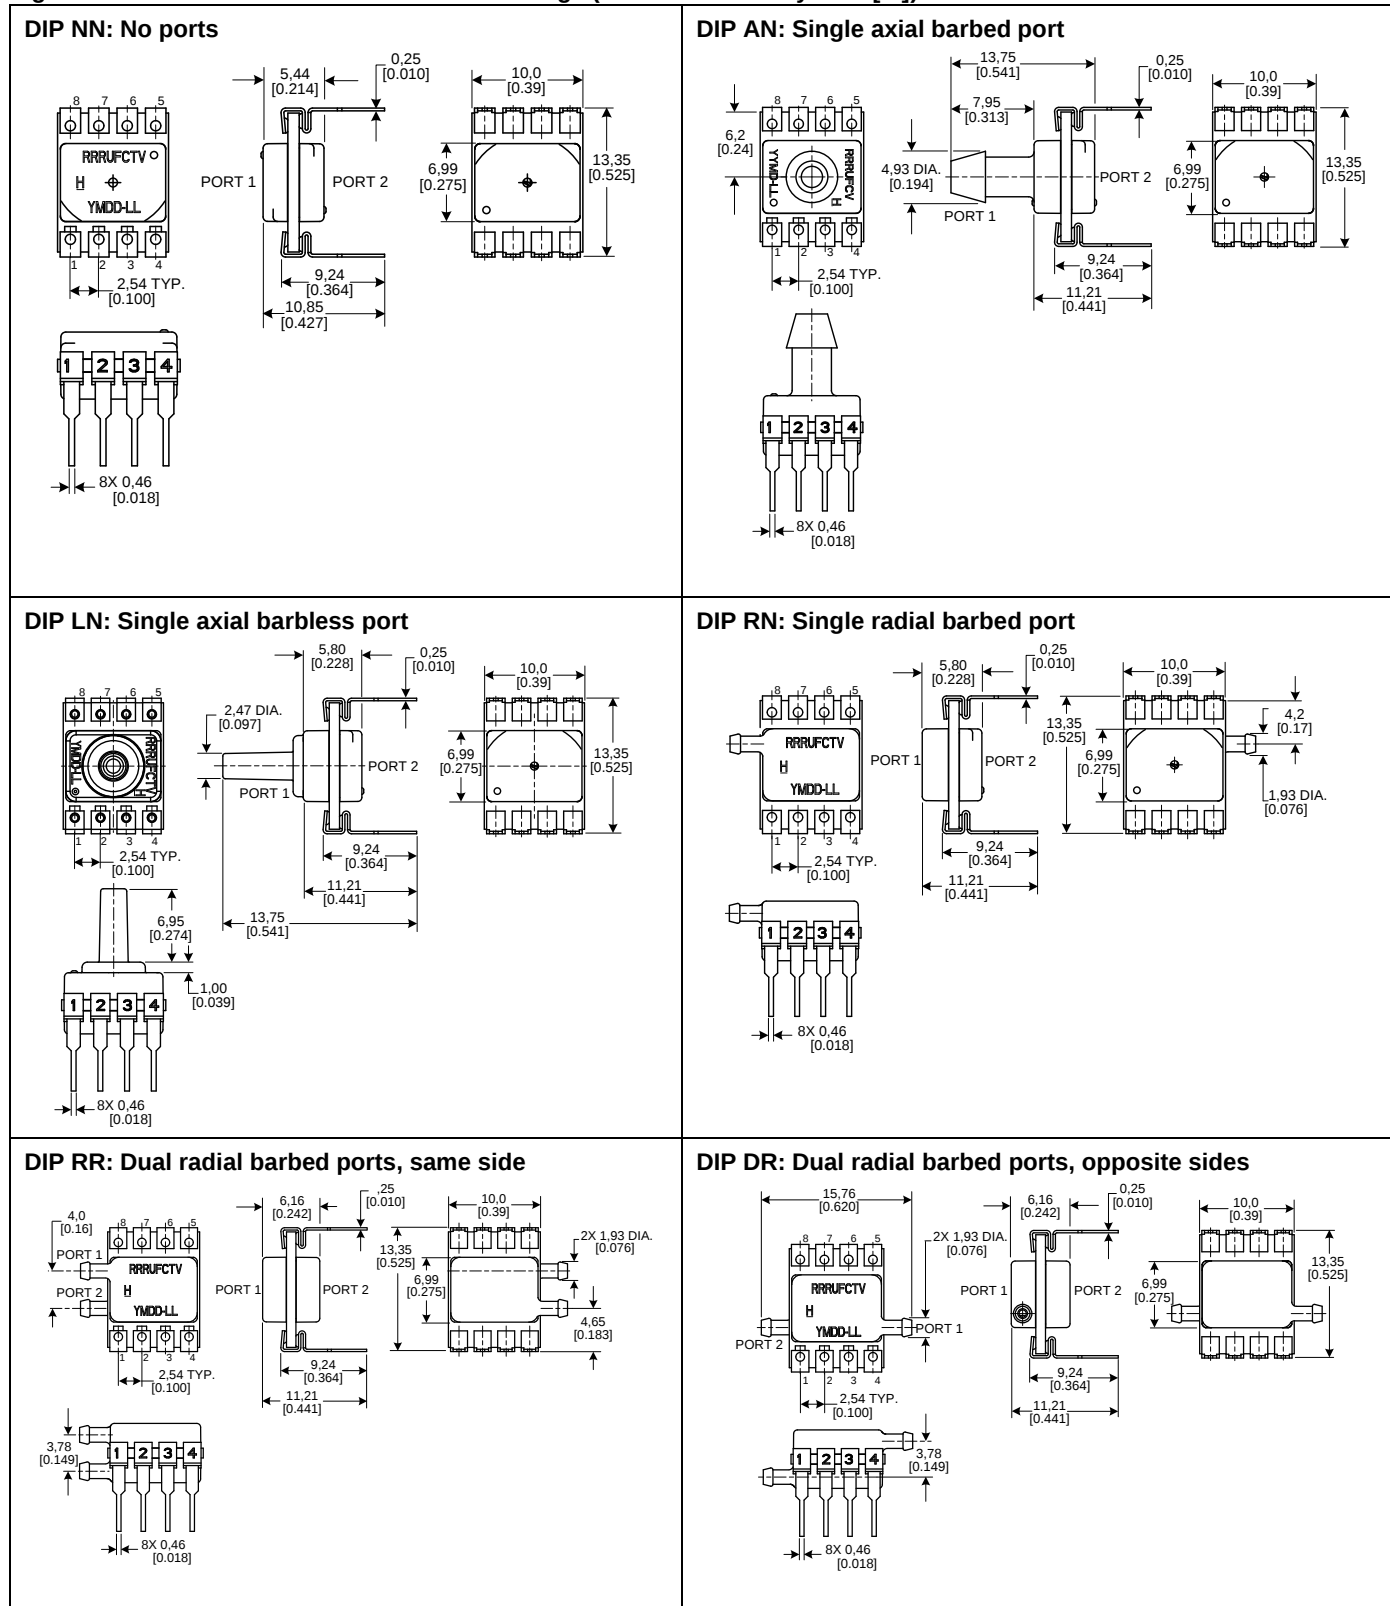


TruStability® Board Mount Pressure Sensors: HSC Series–High Accuracy

Figure 7. SMT Pressure Port Dimensional Drawings (For reference only: mm [in])

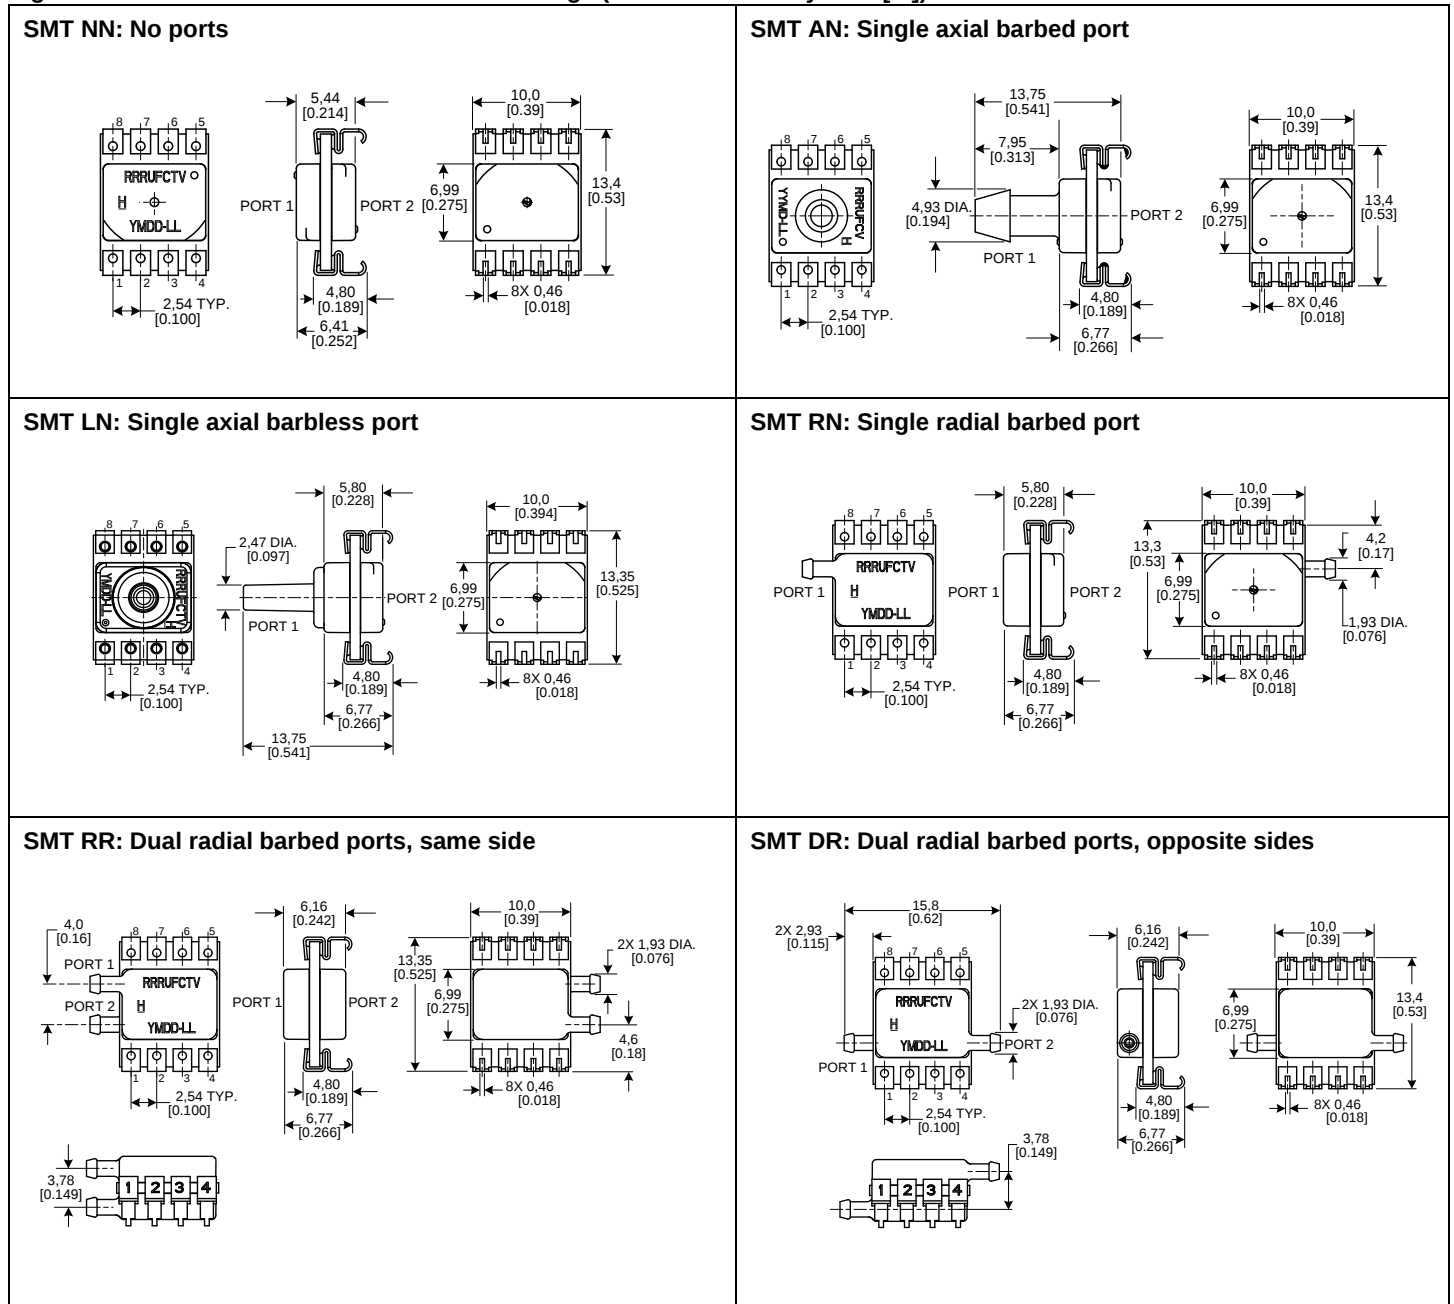

± 2.5 mbar to ± 40 mbar [± 1 inH₂O to ± 30 inH₂O]


Figure 8. SIP Package Dimensional Drawings (For reference only: mm [in])

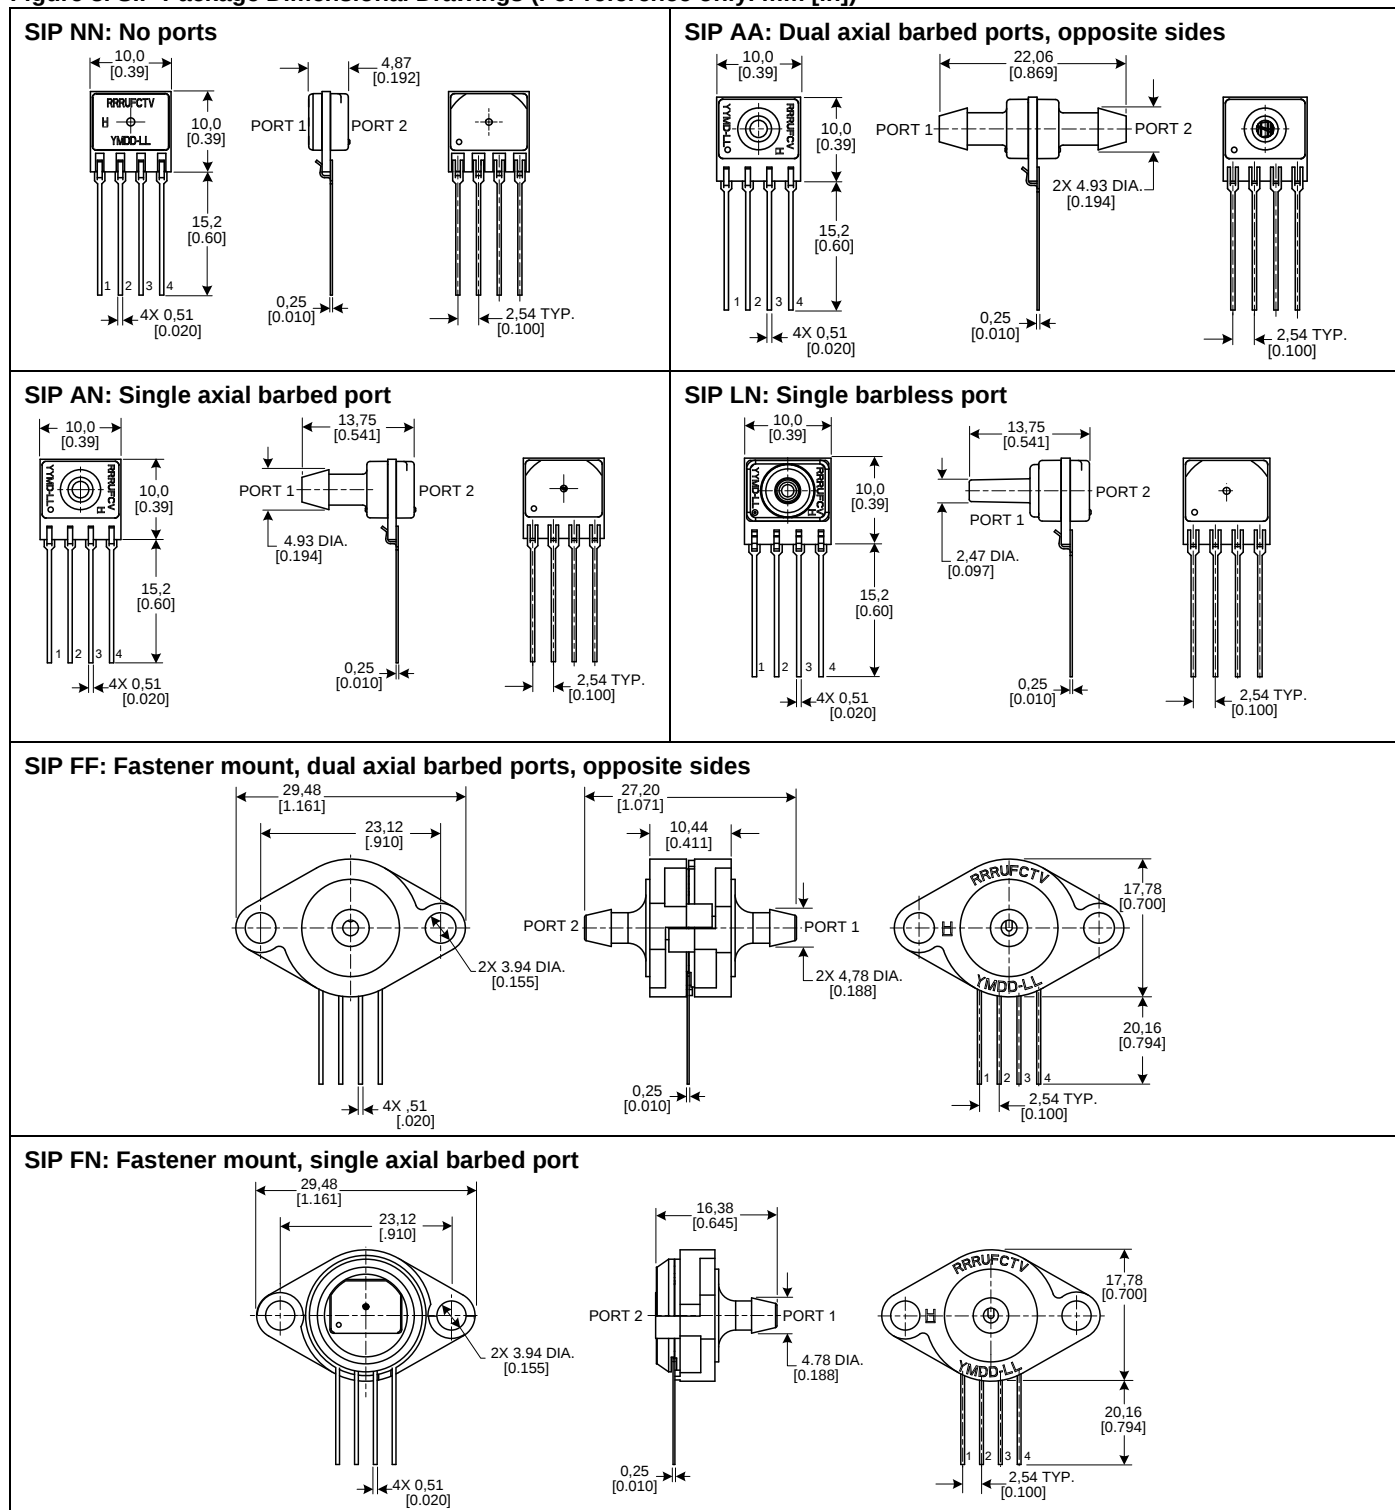


TruStability® Board Mount Pressure Sensors: HSC Series–High Accuracy

Figure 8. SIP Package Dimensional Drawings (continued)


SIP GN: Ribbed fastener mount, single axial barbed port

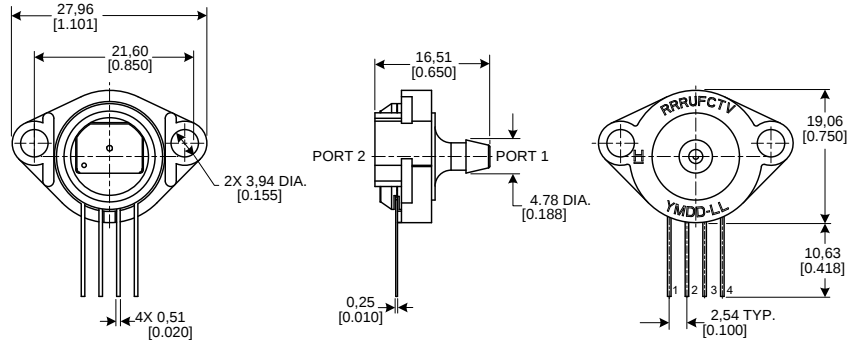


SIP NB: Fastener mount, dual axial ports, same side

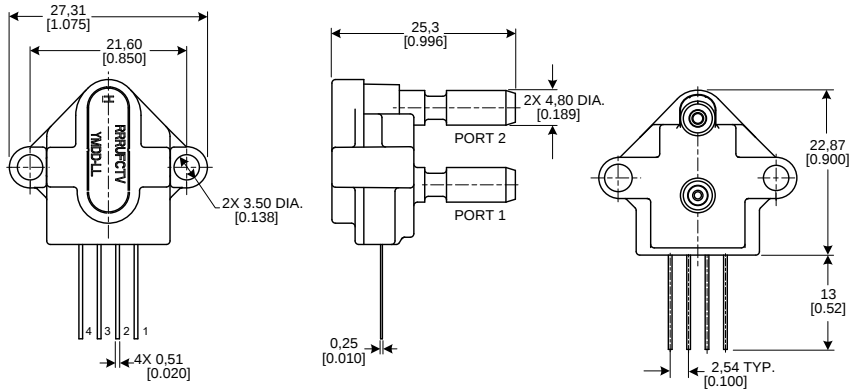

SIP RN: Single radial barbed port

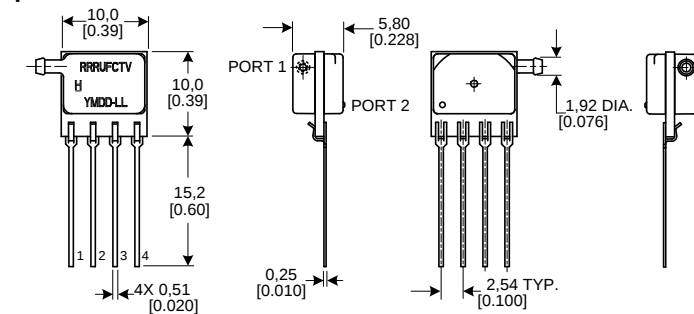


SIP RR: Dual radial barbed ports, same side

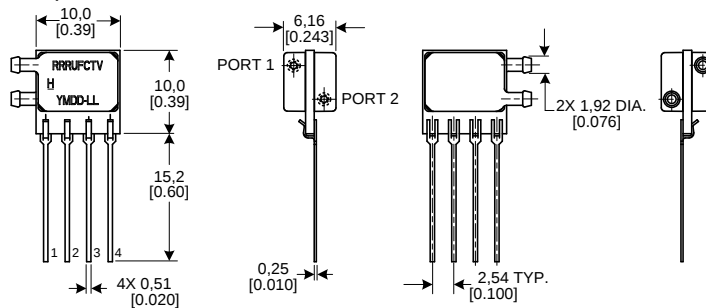

± 2.5 mbar to ± 40 mbar [± 1 inH₂O to ± 30 inH₂O]

Figure 8. SIP Package Dimensional Drawings (continued)

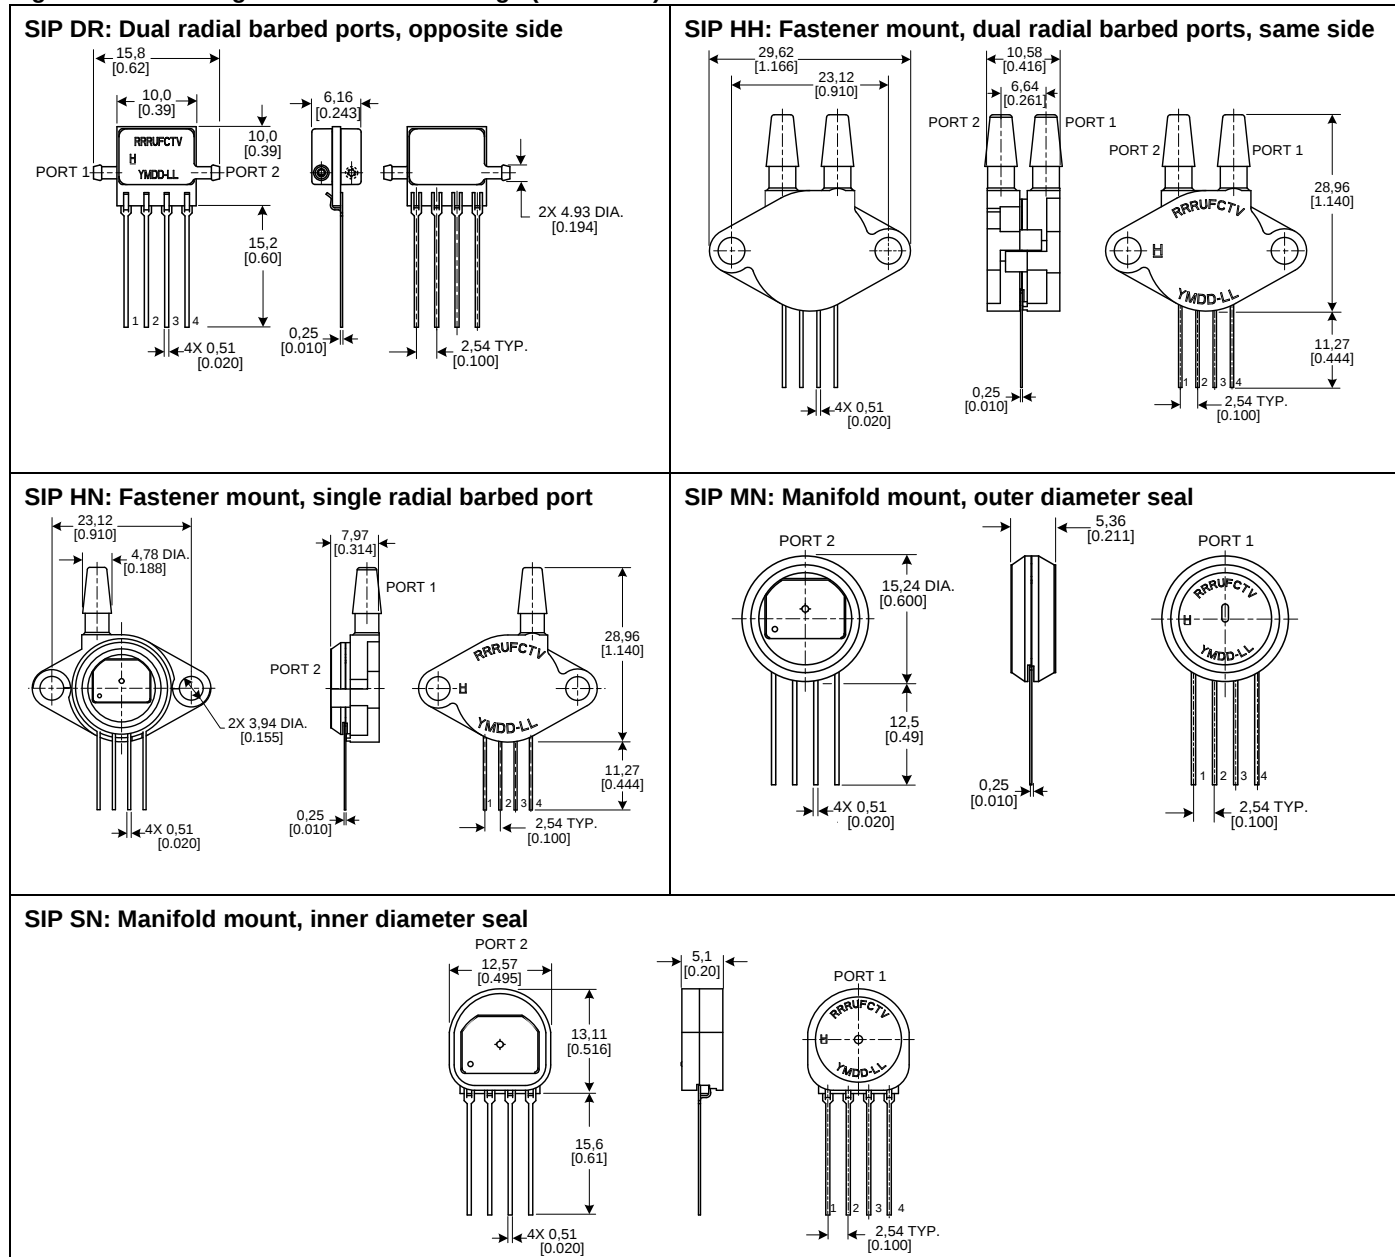

WARNING

PERSONAL INJURY

DO NOT USE these products as safety or emergency stop devices or in any other application where failure of the product could result in personal injury.

Failure to comply with these instructions could result in death or serious injury.

WARRANTY/REMEDY

Honeywell warrants goods of its manufacture as being free of defective materials and faulty workmanship. Honeywell's standard product warranty applies unless agreed to otherwise by Honeywell in writing; please refer to your order acknowledgement or consult your local sales office for specific warranty details. If warranted goods are returned to Honeywell during the period of coverage, Honeywell will repair or replace, at its option, without charge those items it finds defective. **The foregoing is buyer's sole remedy and is in lieu of all other warranties, expressed or implied, including those of merchantability and fitness for a particular purpose. In no event shall Honeywell be liable for consequential, special, or indirect damages.**

While we provide application assistance personally, through our literature and the Honeywell web site, it is up to the customer to determine the suitability of the product in the application.

Specifications may change without notice. The information we supply is believed to be accurate and reliable as of this printing. However, we assume no responsibility for its use.

WARNING

MISUSE OF DOCUMENTATION

- The information presented in this product sheet is for reference only. DO NOT USE this document as a product installation guide.
- Complete installation, operation, and maintenance information is provided in the instructions supplied with each product.

Failure to comply with these instructions could result in death or serious injury.

SALES AND SERVICE

Honeywell serves its customers through a worldwide network of sales offices, representatives and distributors. For application assistance, current specifications, pricing or name of the nearest Authorized Distributor, contact your local sales office or:

E-mail: info.sc@honeywell.com

Internet: www.honeywell.com/sensing

Phone and Fax:

Asia Pacific	+65 6355-2828; +65 6445-3033 Fax
Europe	+44 (0) 1698 481481; +44 (0) 1698 481676 Fax
Latin America	+1-305-805-8188; +1-305-883-8257 Fax
USA/Canada	+1-800-537-6945; +1-815-235-6847 +1-815-235-6545 Fax

Sensing and Control
Honeywell
1985 Douglas Drive North
Golden Valley, MN 55422
www.honeywell.com/sensing

50066342-1-EN IL50 GLO Printed in USA
August 2011
© 2011 Honeywell International Inc.

Honeywell