


REV	DESCRIPTION	DATE
A	RELEASE	6/26/08
B	P/N 128677 WAS 508032	3/11/09
C	OBSOLETE SUPERSEDED BY 99-7820CX	06/10/13

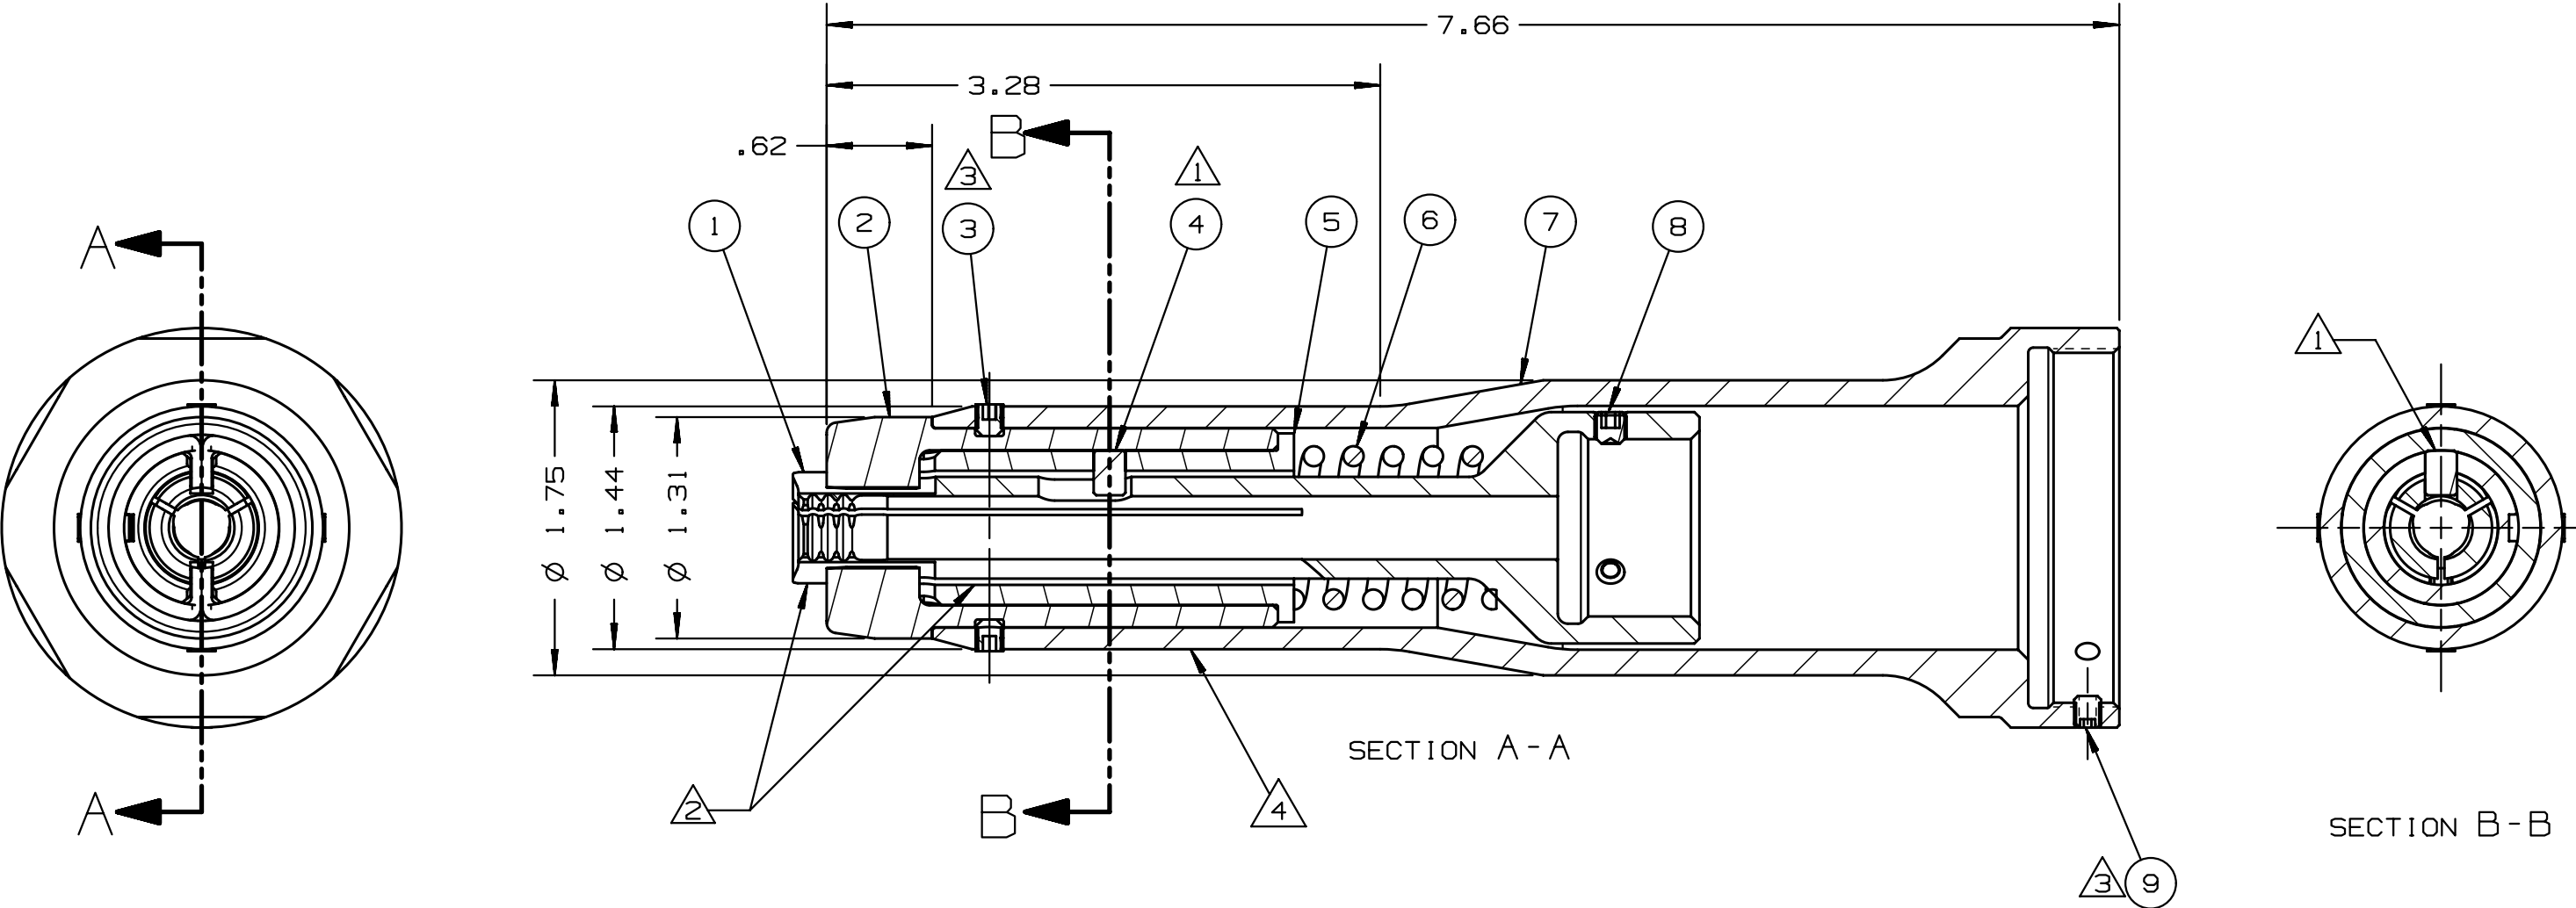

50 1736	1	C.P.S.S. #8-32 X 3/16	9
50 1920	3	C.P.S.S. #10-32 X 3/16	8
128905	1	ANVIL HOLDER, COLLAR CUTTER	7
50 8361	1	SPRING	6
128908	1	SLEEVE	5
128677	1	DOWEL PIN, 3/16 X 1/4	4
50 1781	4	F.P.S.S. #8-32 X 3/16	3
128906	1	ANVIL ASSY, COLLAR CUTTER	2
128909	1	PULLER, COLAR CUTTER	1
PART NO.	QTY	DESCRIPTION	ITEM

IDENTIFICATION PER SPEC 42-311: ★ PERMANENT			
ITAR:		HUCK INTERNATIONAL, INC., I.S.D. 1 CORPORATE DR KINGSTON, NEW YORK 12401	
ECCN: EAR99		ASSY, BTT-M12 COLLAR CUTTER BTT35LS TOOL	
SCH B#: 8467.99.0190		DET: TRK	CK: DATE: 6/26/08 SCALE: 1:1
HTS: 8467.99.0190		B	99-7820CC

NOTES:

- 1 PRESS DOWEL PIN 128677 FLUSH TO .010 BELOW O.D. SURFACE OF SLEEVE 128798.
- 2 APPLY ANTI-SEIZE LUBRICANT P/N: 508183 TO OUTSIDE OF PULLER AND INSIDE OF SLEEVE.
- 3 APPLY VIBRA-TITE P/N: 505125 TO SET SCREW THREADS PER MFR'S INSTRUCTIONS.
- 4 APPLY WARNING STICKER P/N: 590273 TO ANVIL HOLDER. DO NOT PERMIT STICKER TO OVERLAP ONTO ANVIL.