


# HRS MXR Series

## MXR Type Connectors Miniature Push-Pull Connectors with Ground Function

### ■ GENERAL

MXR type connectors are miniature, lightweight, push-pull lock connectors with a ground function which has been developed for use with VTR camera and system camera interfaces.

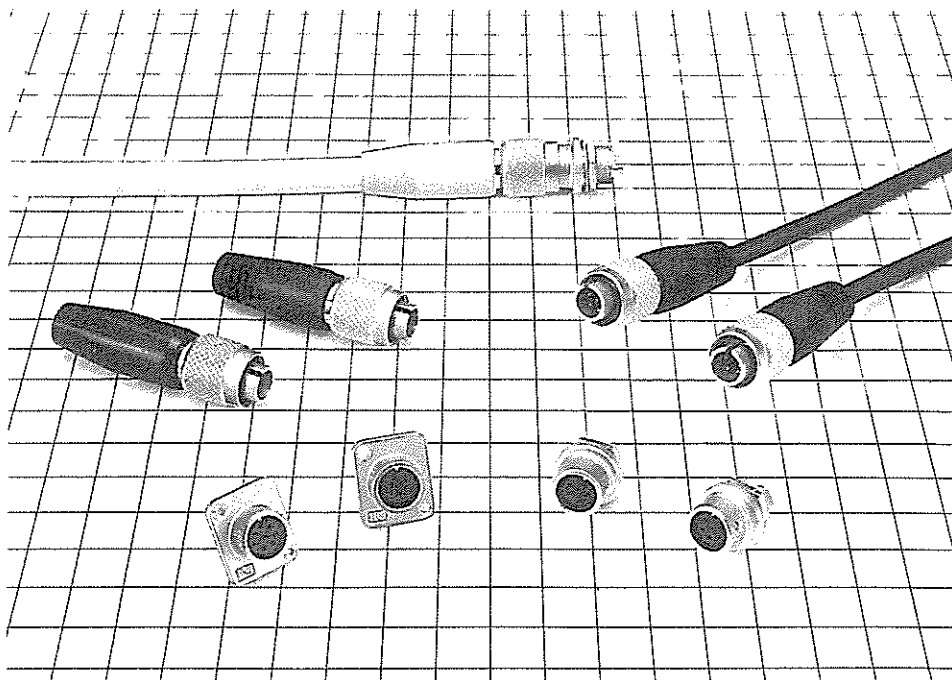

### ■ FEATURES

- (1) The single action push-pull lock function allows quick connections and disconnections as well as high density mounting.
- (2) Verification of a secure engagement is afforded by a click sound which exemplifies the fine feel of this lock system.
- (3) Use of aluminum alloy for the shell has contributed to the lightweight design.
- (4) The metal portion of the shell forms part of the contacting structure as a measure toward FCC radiation requirements.
- (5) One of the conductors makes contact before the others in this sequenced design.
- (6) A simple tightening of the cable tube around the conductors permits the cable to be clamped, affording an increase in workability and a reduction in special tools.

### ■ APPLICATIONS


VTR cameras, system cameras, audio equipment, etc.

## MATERIALS AND PROCESSING

| Part Name   | Material        | Processing           |
|-------------|-----------------|----------------------|
| Shell       | Aluminum alloy  | Nickel plating       |
| Insulation  | PBT resin*      | (Black)              |
| Male pins   | Brass           | Gold plating         |
| Female pins | Phosphor bronze | Partial gold plating |



\*UL94V-0

## STRUCTURE OF THE PRODUCT NUMBER

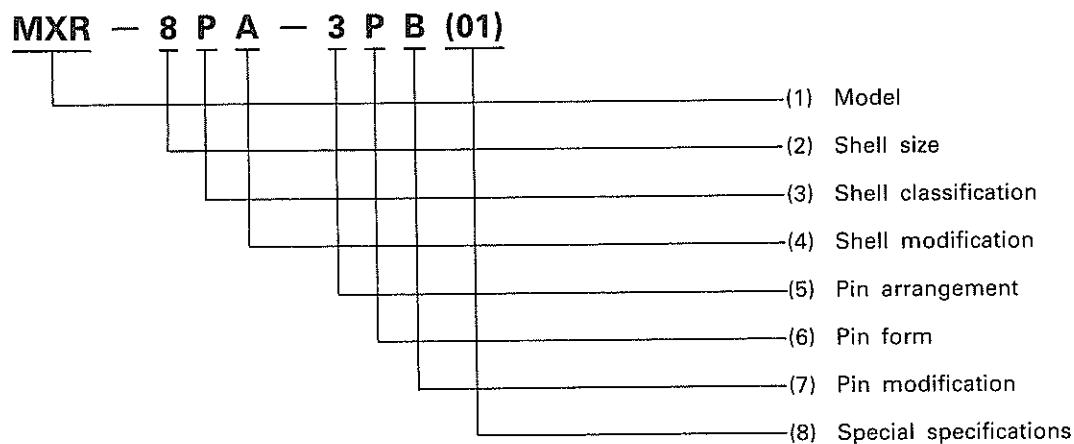

- (1) Model : Indicates the MXR Series
- (2) Shell size : Indicates the shell outer diameter at the plug engagement portion
- (3) Shell classification : Classified as follows  
P: Plug  
R: Receptacle
- (4) Shell modification : Each time there is a modification of form related to the shell, the indicator changes in the sequence of A, B, D, E, etc.
- (5) Pin arrangement : Indicated by the number of pins: 3 or 8.
- (6) Pin form : Classified as follows  
P: Male contacts  
S: Female contacts
- (7) Pin modification : Each time a modification is made to the pin form, the indicator changes in the sequence of A, B, D, E, etc.
- (8) Special specifications : Each time there is a change in specifications other than the aforementioned, the indicator changes in the sequence of (01), (02), (03), etc.



## ■ Plug

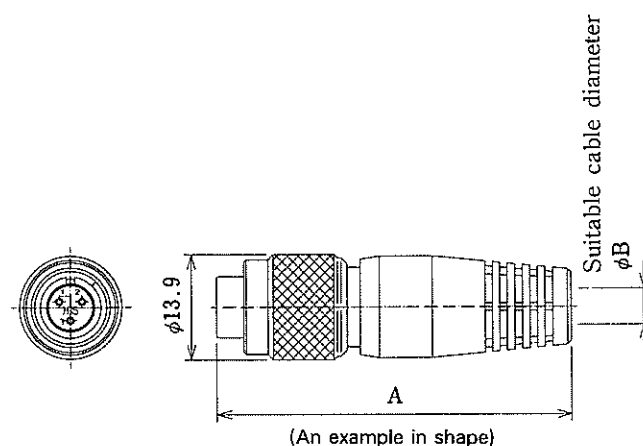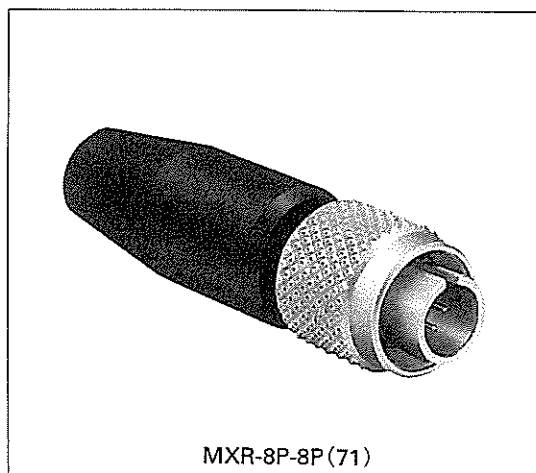

| HRS No.       | Part No.        | A  | φB | Weight | Bussing | Remarks                | RoHS |
|---------------|-----------------|----|----|--------|---------|------------------------|------|
| 127-0003-6-71 | MXR-8PA-3PB(71) | 47 | 5  | 8g     | Black   | Sequenced construction | ○    |
| 127-0004-9-71 | MXR-8PA-4PB(71) | 47 | 5  | 8g     | Black   | Sequenced construction |      |
| 127-0005-1-71 | MXR-8PA-6PB(71) | 47 | 5  | 8g     | Black   | Sequenced construction |      |
| 127-0002-3-71 | MXR-8P-8P(71)   | 50 | 8  | 9g     | Black   | _____                  |      |
| 127-0002-3-72 | MXR-8P-8P(72)   | 50 | 8  | 9g     | White   | _____                  |      |

## ■ Receptacle (to be tightened with nut)



(To be soldered)

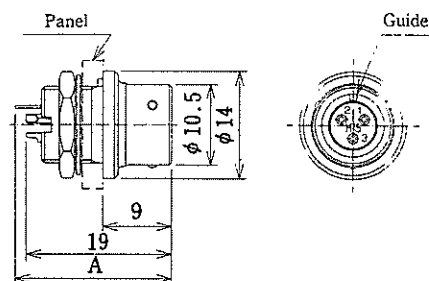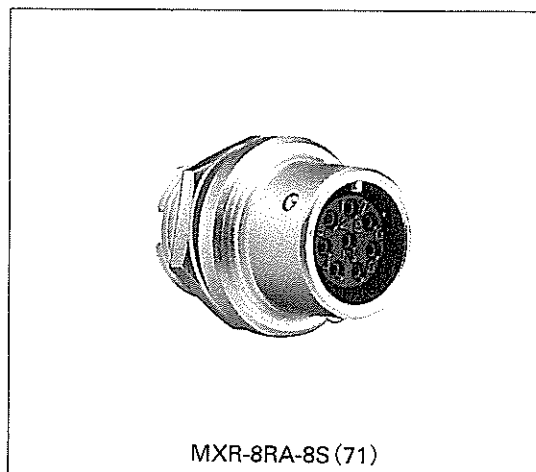

| HRS No.       | Part No.       | Weight | A    | Remarks | RoHS |
|---------------|----------------|--------|------|---------|------|
| 127-0121-2-71 | MXR-8RA-3S(71) | 3.5g   | 19.3 | _____   | ○    |
| 127-0122-5-71 | MXR-8RA-4S(71) | 3.5g   | 19.3 | _____   |      |
| 127-0123-8-71 | MXR-8RA-6S(71) | 3.5g   | 19.3 | _____   |      |
| 127-0124-0-71 | MXR-8RA-8S(71) | 3.5g   | 20.4 | _____   |      |

## ■ Receptacle (Flange type)

(Dip type)

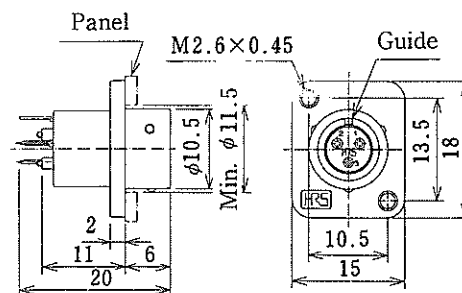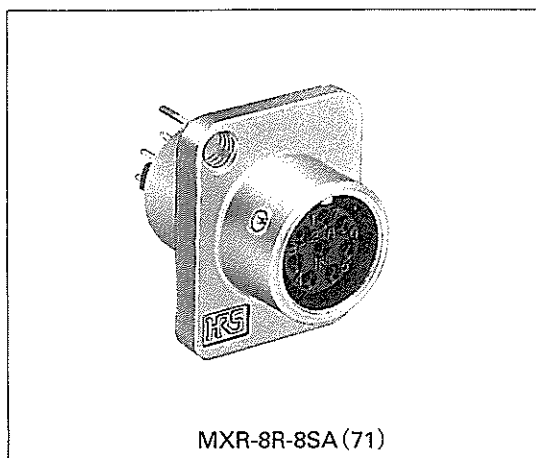


(An example in shape)


| HRS No.       | Part No.       | Weight | Remarks                   | RoHS |
|---------------|----------------|--------|---------------------------|------|
| 127-0101-5-71 | MXR-8R-3SA(71) | 3.5g   | with gold-plated contacts | ○    |
| 127-0103-0-71 | MXR-8R-4SA(71) | 3.5g   | with gold-plated contacts |      |
| 127-0104-3-71 | MXR-8R-6SA(71) | 3.5g   | with gold-plated contacts |      |
| 127-0102-8-71 | MXR-8R-8SA(71) | 3.5g   | with gold-plated contacts |      |

## ◆ Dip Post Arrangement Dimensions


3 cores

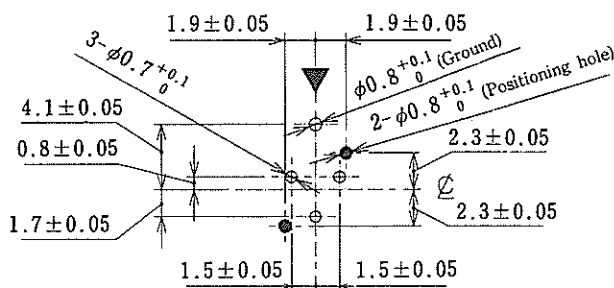


4 cores

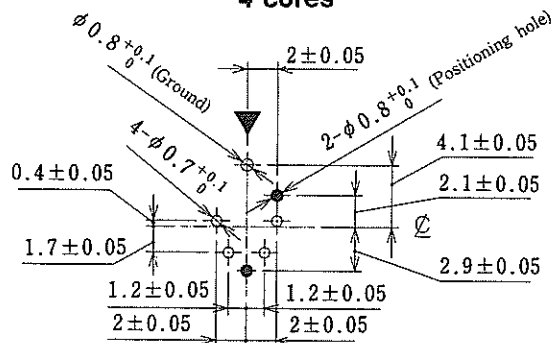

6 cores

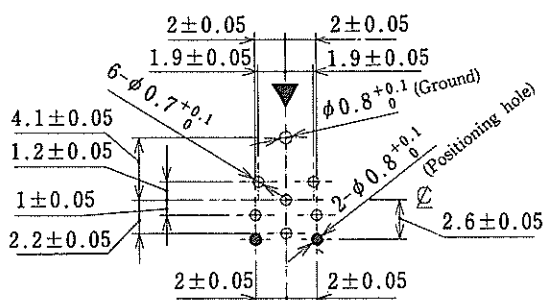

8 cores

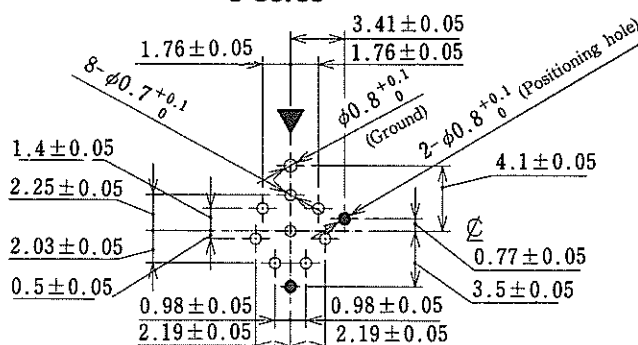


Remarks: The above figures are as viewed from the mating side (wiring side of the plug) of the receptacle.

Marks ▼ show the position of the guide.

## ◆ Outline of the Wiring Work

### ● MXR-8PA-3PB

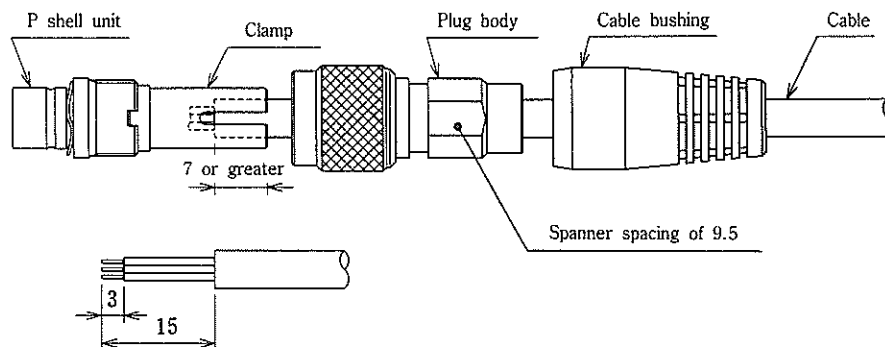


#### Work Procedure

1. Pass the cable bushing, plug body, and clamp over the cable in order and perform the end processing.
2. Solder the wires to the P shell unit.
3. Align the protruding portion of the clamp with the recessed portion of the P shell unit and mount.
4. Align the plug and cable sheath strip position, then tighten the plug body to the screw portion of the P shell unit with a torque of 1 N·m.

Note that to prevent loosening, an application of Locktight 271 manufactured by Nihon Locktight K.K. is recommended.

5. Put the cable bushing over the clamp body to complete the job.

### ● MXR-8P-8P

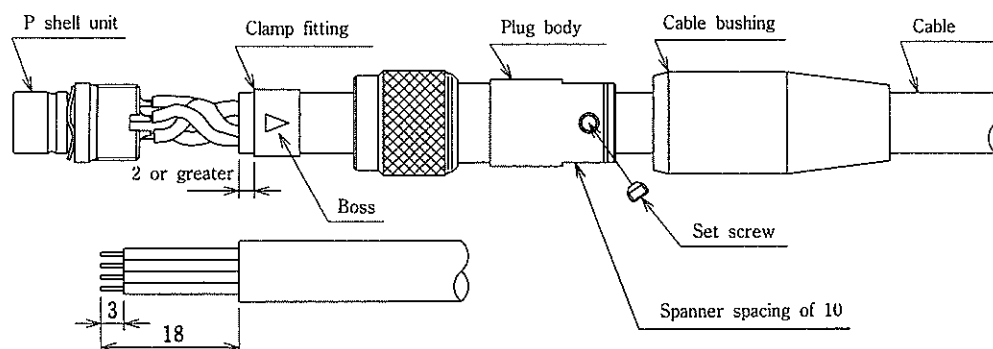



#### Work Procedure

1. Pass the cable bushing and plug body over the cable in order and perform the end processing.
2. Solder the wires to the P shell unit.
3. Fasten the clamp fitting to the cable with the cable crimping tool (HR10A-TC-04).
4. Tighten the clamp body to the screw portion of the P shell unit with a torque of 1 N·m.

Note that to prevent loosening, an application of Locktight 271 manufactured by Nihon Locktight K.K. is recommended.

5. Tighten the set screw so that the tip falls into one of the two bosses of the clamp fitting.  
Note that a tightening torque of 0.3 N·m is specified.
6. Put the cable bushing over the clamp body to complete the job.

## Scale drawing of receptacle mounting holes

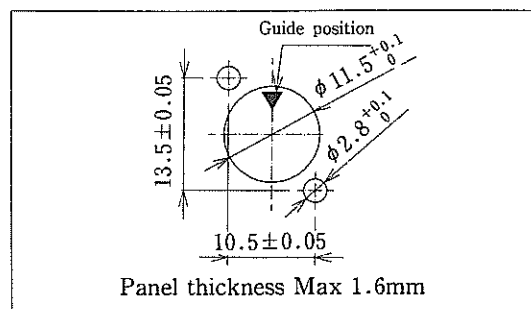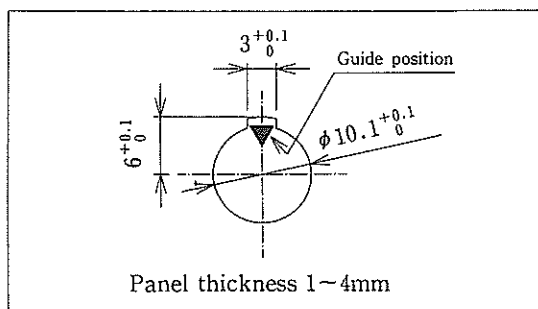


### NOTES: (Jam Nut Type)

- The diagram shows the view from the engagement side (i.e., plug wiring side) of the receptacle. Also note that the ▼ symbol indicates the guide position.


### (Flange Type)

## Applicable Tools

| Type                    | HRS No.    | Part No.    | Applicable Connectors |
|-------------------------|------------|-------------|-----------------------|
| Tightening jig          | 150-0092-3 | MXR-8P-T01  | All plug products     |
| Cable crimping tool     | 150-0058-5 | HR10A-TC-04 | MXR-8P-8P             |
| Hexagonal wrench driver | 150-0066-3 | PB205/1.27  | MXR-8P-8P             |

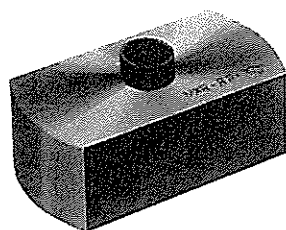

MXR-8P-T01

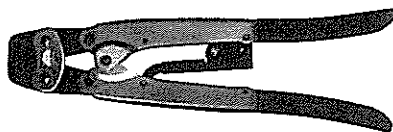

HR10A-TC-04



PB205/1.27

## Pin Arrangement and Major Ratings

| Number of poles       | 3                              | 4 | 6 | 8 |
|-----------------------|--------------------------------|---|---|---|
| Pin arrangement       |                                |   |   |   |
| Withstand voltage     | 300 V AC for 1 minute          |   |   |   |
| Current capacity      | 2 A                            |   |   |   |
| Insulation resistance | 1000 MΩ or greater at 100 V DC |   |   |   |
| Contact resistance    | 20 mΩ or less at 1A DC         |   |   |   |
| Solder pot diameter   | 0.9 mm dia.                    |   |   |   |

### NOTES:

- The diagram shows the view from the engagement side (i.e., plug wiring side) of the receptacle. Also note that the ▼ symbol indicates the guide position.
- The withstand voltage value indicates the test voltage.  
The connector should normally be used at less than 50 V AC or 70 V DC.