


Model PC and PCS

AC Current Sensors

Current Sensors

Description

The PC/PCS Series current sensors accurately measure sinusoidal AC current and provide a 4-20 mA DC output proportional to the RMS value. They are loop powered requiring only a two wire connection. The PCS-50 and PCS-200 clamp over existing wiring for easy installation.

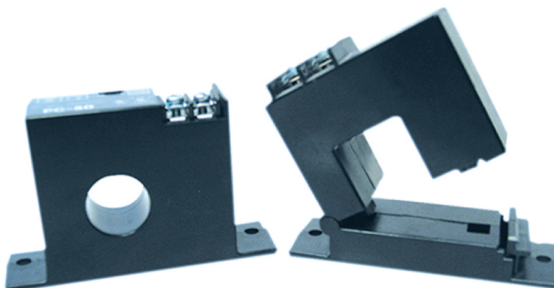

Features

- UL Listed • Loop Powered • Range Selected on Sensor
- Only Requires Two Wire Connection • Features Split Core for Easy Installation

Electrical Specifications

	Units	PC-50	PC-200	PCS-50	PCS-200
Current Range (1)	A AC rms	50	200	50	200
Output (2)	mA DC		4 to 20		
Frequency Range	Hz		20 to 100		
Supply Voltage (3)	VDC		5 to 40		
Accuracy	±% Full Scale (FS)		0.5		
Repeatability	±% FS		0.1		
Linearity	±% FS	0.1	0.1	0.3	0.3
Response time (Max.)	ms		300		
Ripple and Noise (Max.)	mV Peak to Peak		8		
Output Current Limit (4)	mA		40 Max.		
Internal Protection		Reverse voltage protection, High over-current capability			
Dielectric test (6)	kV		5		

General Information

Operating Temperature (5)	°C	-20 to +50			
Aperture Opening	inches(mm)	0.73 (18.5)	0.73 (18.5)	0.85 (21.6)	0.85 (21.6)
Weight	grams	92	92	121	121
Mounting		Panel mount via two #6 screws			
Package		ABS plastic case meets UL flammability rating 94V-0			

Notes:

1. Refer to Table 1 for choice of current ranges.
2. Refer to Table 2
3. Minimum voltage is 5 volts (for the sensor) plus voltage dropped across total load resistance when sensor is at 20 mA. Example: 20 mA will drop 16 volts across 800 ohm total load resistance. 16 volts plus 5 volts equals 21 volts minimum requirement.
4. Sensor self-limits output current to 40 mA maximum.
5. The UL approval is for an operating temperature range of -10°C to +40°C.
6. The dielectric test consists of 5.0 kV ac 60 Hz for one minute between a bare 0.8 inch diameter conductor (located concentrically through the aperture) and the output of the sensor.
7. Due to continuous process improvement, all specifications are subject to change without notice.



Mechanical Dimensions

All dimensions are in inches (millimeters)

Models PC and PCS

PC


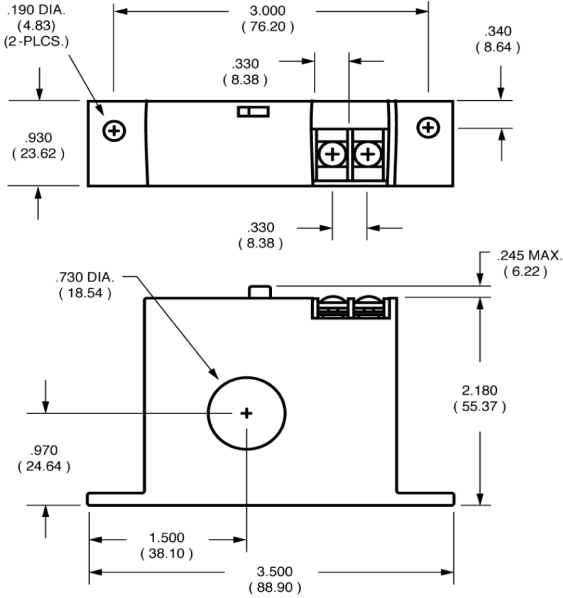



Table 1

Model	Range	Jumper	Maximum Continuous Currents
PC-50	0 to 10 Amps	None	80 Amps
PCS-50	0 to 20 Amps	Mid	110 Amps
	0 to 50 Amps	High	175 Amps
PC-200	0 to 100 Amps	None	200 Amps
PCS-200	0 to 150 Amps	Mid	300 Amps
	0 to 200 Amps	High	400 Amps


Table 2

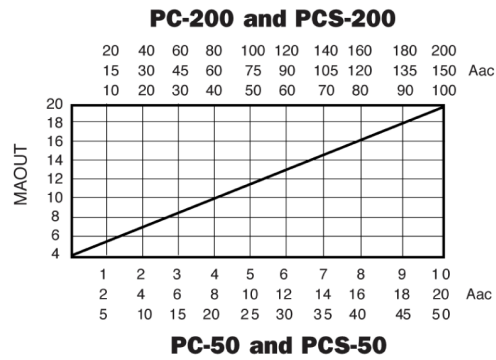

PCS

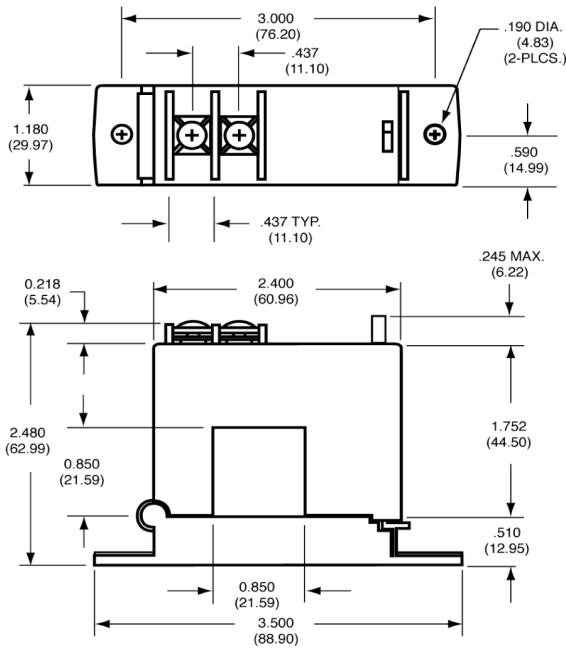

Connection Schematic

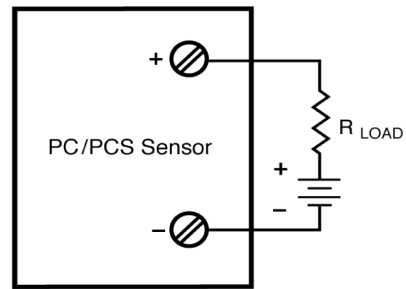

Connection to sensor is made via two 6-32 screw terminals

Note: Due to continuous process improvement, all specifications are subject to change without notice.



Pacific Scientific-OECO
4607 SE International Way
Milwaukie, OR 97222
(503) 659-5999
www.oeco.com



Rev. date 04/2003

Current Sensors