

Number of contacts

10-50



Pcb transition connector, 4 rows


Identification No. of contacts Part No. Drawing Dimensions in mm

Pcb transition connector²⁾


4 rows

10	09 19 010 9643*
16	09 19 016 9643*
20	09 19 020 9643*
26	09 19 026 9643*
34	09 19 034 9643*
40	09 19 040 9643*
50	09 19 050 9643*

No. of contacts	A	B
10	17.78	$1.27 \times 9 = 11.43$
16	25.40	$1.27 \times 15 = 19.05$
20	30.48	$1.27 \times 19 = 24.13$
26	38.10	$1.27 \times 25 = 31.75$
34	48.26	$1.27 \times 33 = 41.91$
40	55.88	$1.27 \times 39 = 49.53$
50	68.58	$1.27 \times 49 = 62.23$

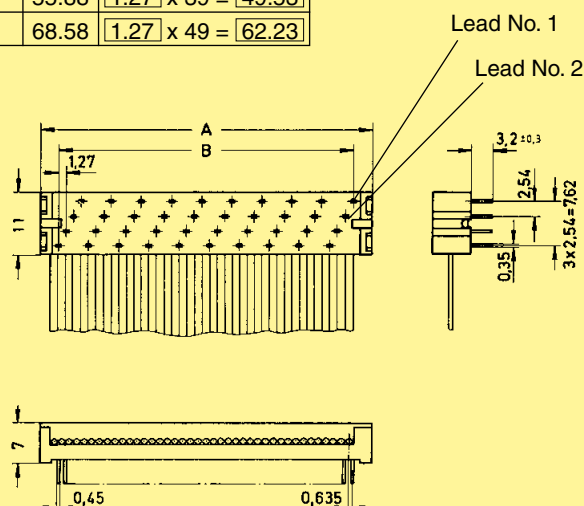

Board drillings

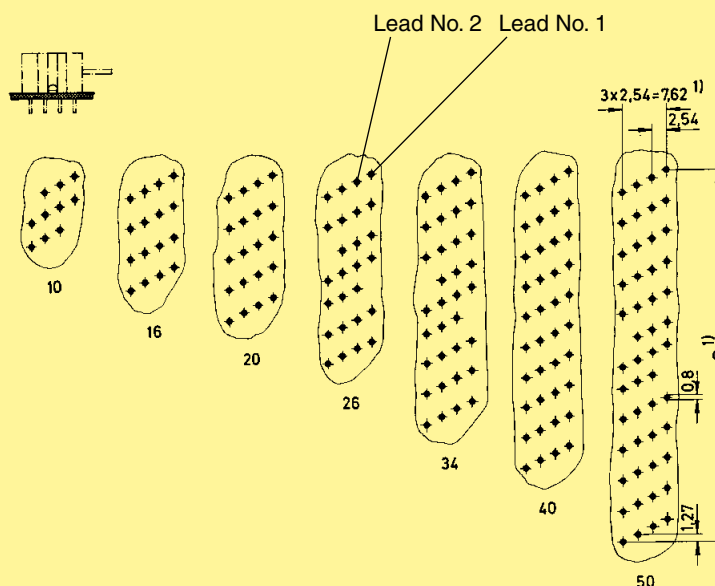

* Not normally kept in stock.

¹⁾ Pitch tolerance: ± 0.1

²⁾ Not released for halogen free flat cables