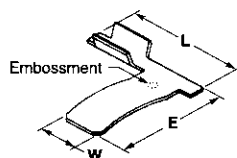
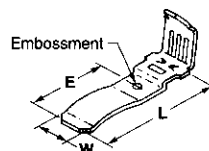
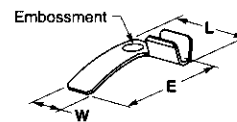
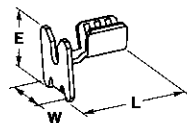
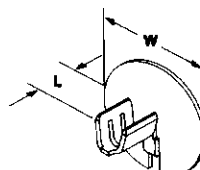
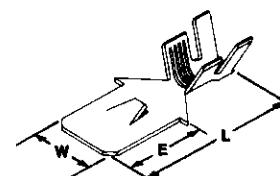


Contact and Welding Tab Terminals (Continued)
Brush Contacts

A (Right Hand)

B

C (Left Hand)

D

E

F

Type	Wire Range		Insul. Dia.	Stock Thickness	Dimensions			Tab Direction	Material	Part Number
	AWG	mm ²			W	L	E			
A	22-17 Magnet Wire	0.3-1.0 Magnet Wire	—	.020 0.51	.215 5.46	.425 10.80	.425 10.80	L.H.	Phosphor Bronze	62214-1
								R.H.	Phosphor Bronze	62214-2
	18-14	0.8-2.0	—	.020 0.51	.187 4.75	.435 11.05	.640 16.25	R.H.	Phosphor Bronze	60812-1
								L.H.	Phosphor Bronze	60812-2
					.125 3.18			R.H.	Phosphor Bronze	350010-1
								R.H.	Phosphor Bronze	62008-1 ¹
B	20-14	0.5-2.0	—	.018 0.46	.187 4.75	.620 15.75	.425 10.80	R.H.	Silver Plated Ph Bz	62008-2 ¹
								L.H.	Phosphor Bronze	62009-1 ¹
									Silver Plated Ph Bz	62009-2 ¹
						.495 12.57	.300 7.62	R.H.	Phosphor Bronze	63182-1 ¹
								L.H.	Phosphor Bronze	63183-1 ¹
C	20-18	0.5-0.8	—	.012 0.30	.125 3.18	.330 8.38	.305 7.75	L.H.	Phosphor Bronze	1217698-1
								R.H.	Phosphor Bronze	1217698-2
D	20-16	0.5-1.4	—	.018 0.46	.240 6.10	.275 6.98	.240 6.10	—	Brass	61524-2 ²
E	24-20	0.2-0.6	—	.018 0.46	.285 7.24	.210 5.33	—	—	Brass	61933-1 ²
				.016 0.41	.312 7.29	.185 4.70	—	—	Brass	63020-1 ²
				.018 0.46	.285 7.24	.210 5.33	—	—	Brass	1217507-1 ²
	20-16	0.5-1.4	—	.016 0.41	.360 9.14	.185 4.70	—	—	Brass	63930-1 ²
F	18-14	0.8-2.0	.110-.160 2.79-4.06	.016 0.41	.255 6.48	.775 19.69	.355 9.02	—	Brass	61390-1

¹ Tab lock crimp.

² Carbon brush application equipment available.