
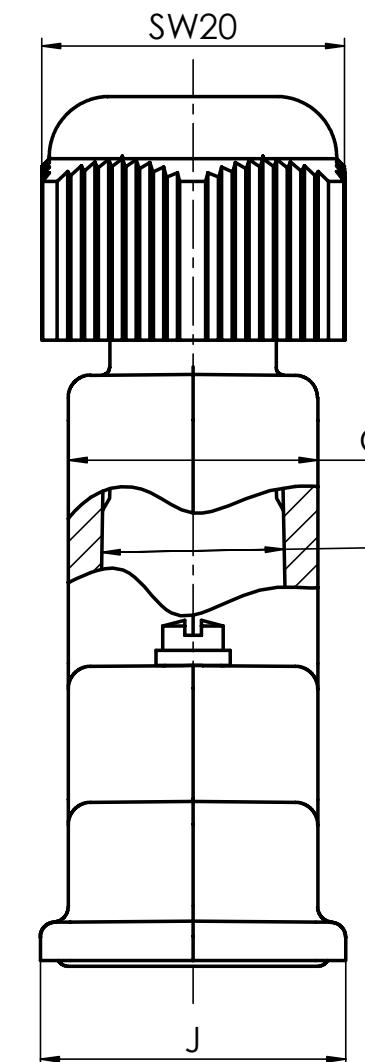


1 2 3 4 5 6 7 8


Typ	A	B	C	D	E	\varnothing F	\varnothing F	G	H	J	K	L	M	N	O
FWAF1G	± 0.3	± 0.1	± 0.3	± 3.0	± 0.3	min. max.	± 0.3	± 0.3	± 0.3	± 0.3	± 0.3	± 0.3	± 0.3	± 0.3	± 0.3
FWAF2G	39.8	25.0	16.5	57.0	17.0	6.0	8.0	20.0	13.0	20.2	27.5	3.0-3.5	5.0	38.75	28.75

FOR FRONT MOUNTED CONNECTORS

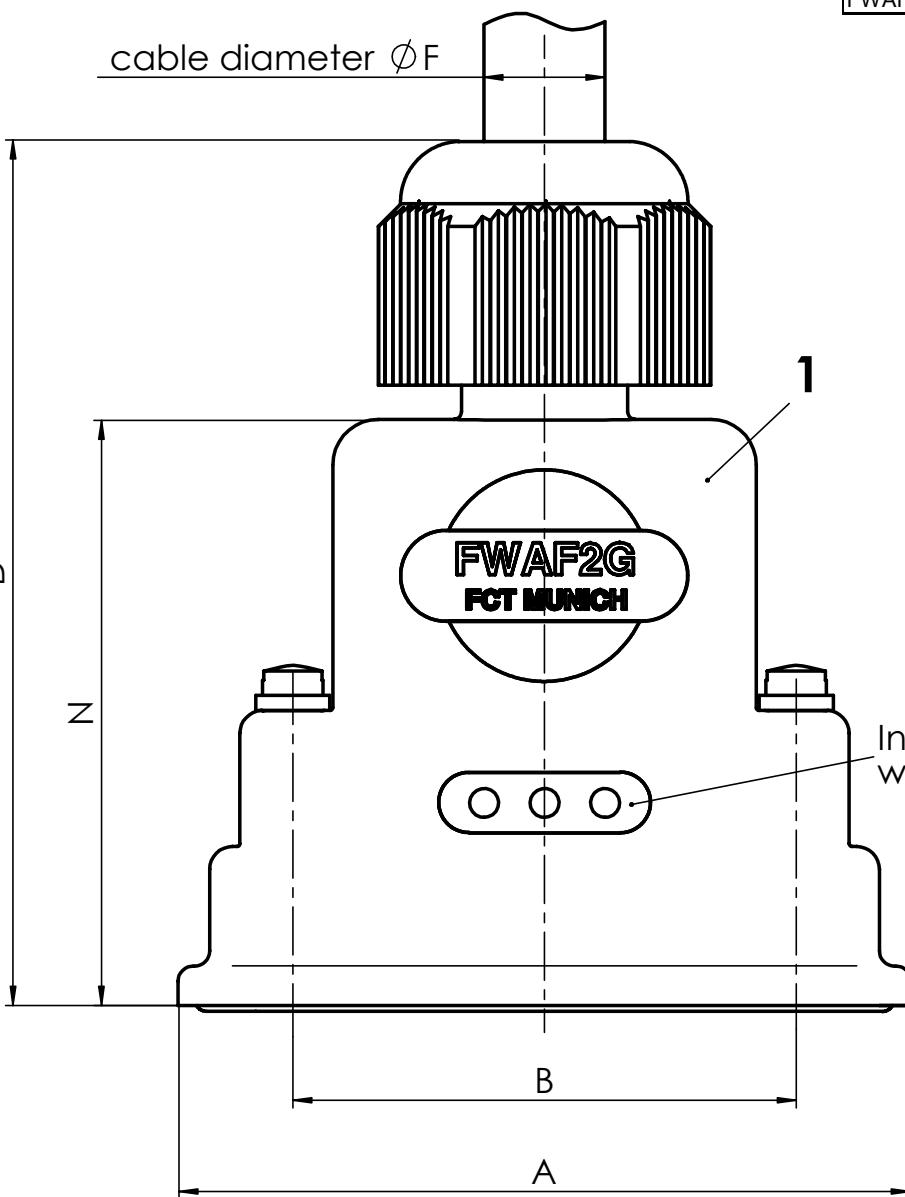


Mounting instructions

Insert cable into hood before stripping, cable clamp assembling and connector mounting. The peeled back cable braiding must not extend over the cable clamp, in order not to damage the gasket or to impair its performance.

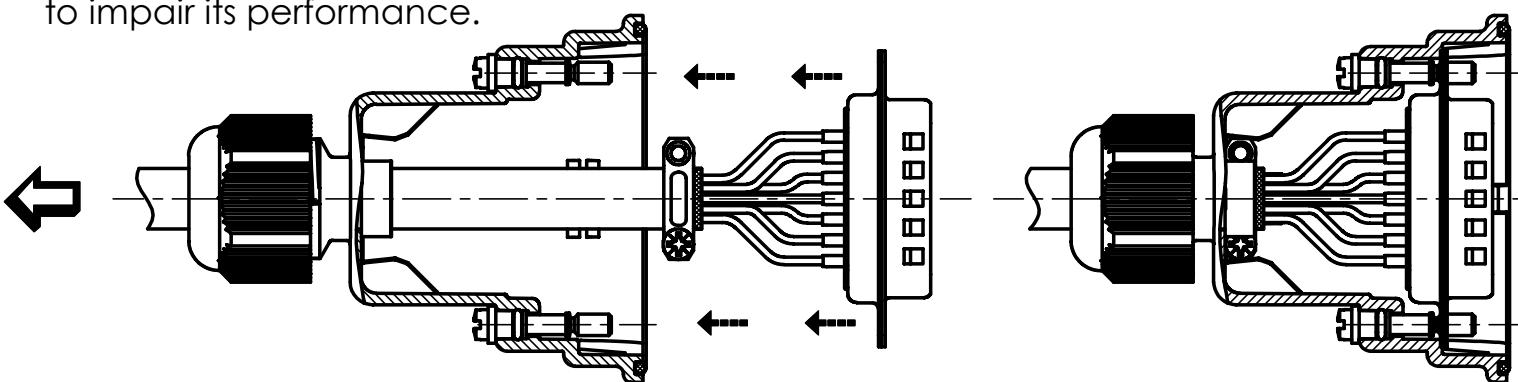

Pull back cable until cable clamp snaps into shielding plate. Snap connector into hood.

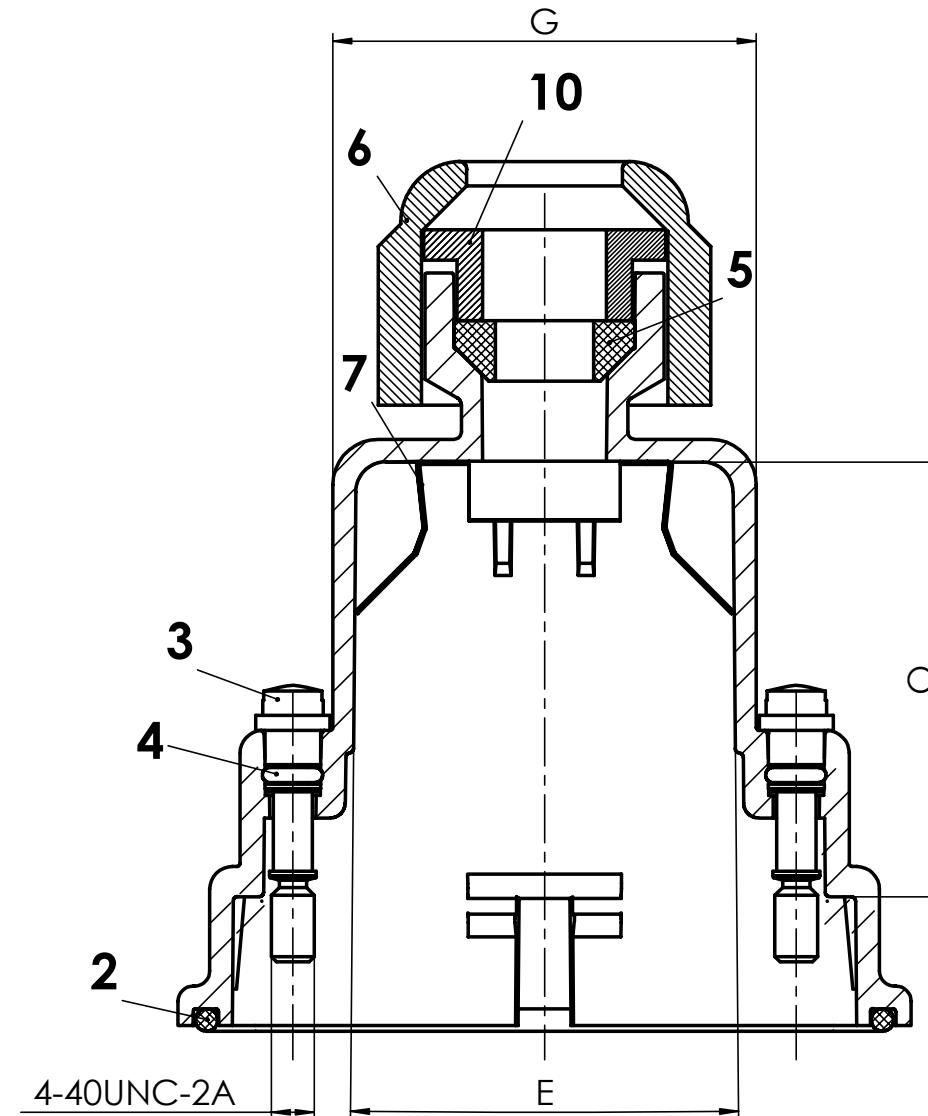

No.	St.	Part	Type Description/Material	Surface plating/Colour/Class
10	1	Washer	Aluminium	nickel plated
9	2	Cable clamp screw	Steel	zinc plated
8	2	Cable clamp	Steel	zinc plated
7	1	Shielding plate	Bz4	tin plated
6	1	Nut	ABS	black
5	1	Rubber gasket	Nitril	black
4	2	O-Ring seal	Silicone	red
3	2	Slotted head screw	Brass	nickel plated
2	1	O-Ring seal	Silicone	red
1	1	Hood	ABS	black
No. St. Part				

Measurement without tolerance acc. to ISO 2768-m	SCALE 2:1	FCT electronic gmbh München
	DATE	
	NAME	
DRAWN 10-09-2003	cpasch	
CHECKED 16-09-2003	okappla	
TITLE		
Plastic hood waterproof		

FCT electronic gmbh München

DWG.NO. FWAF1G-2G

REV. 1