
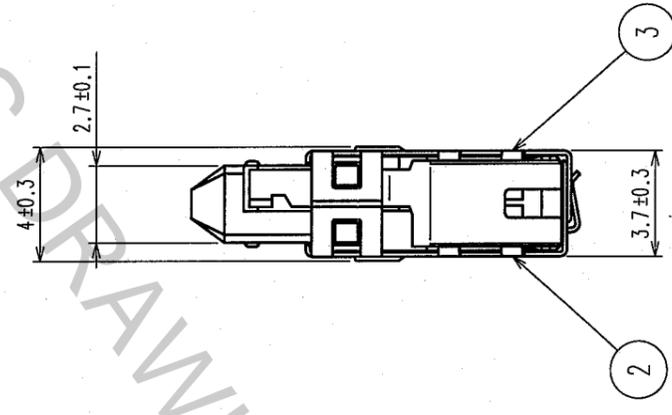
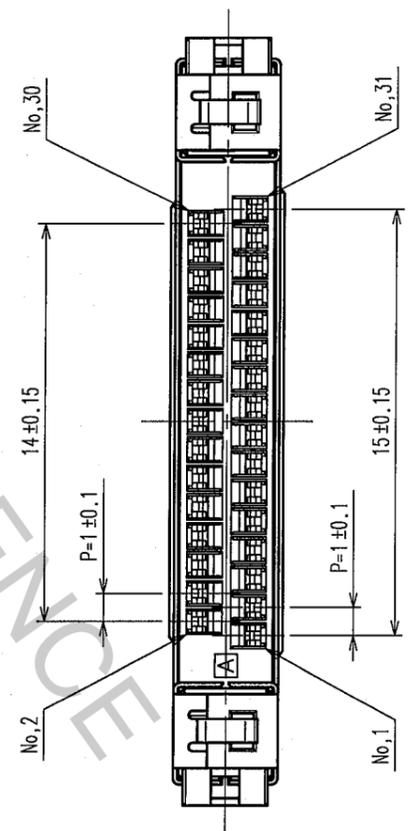
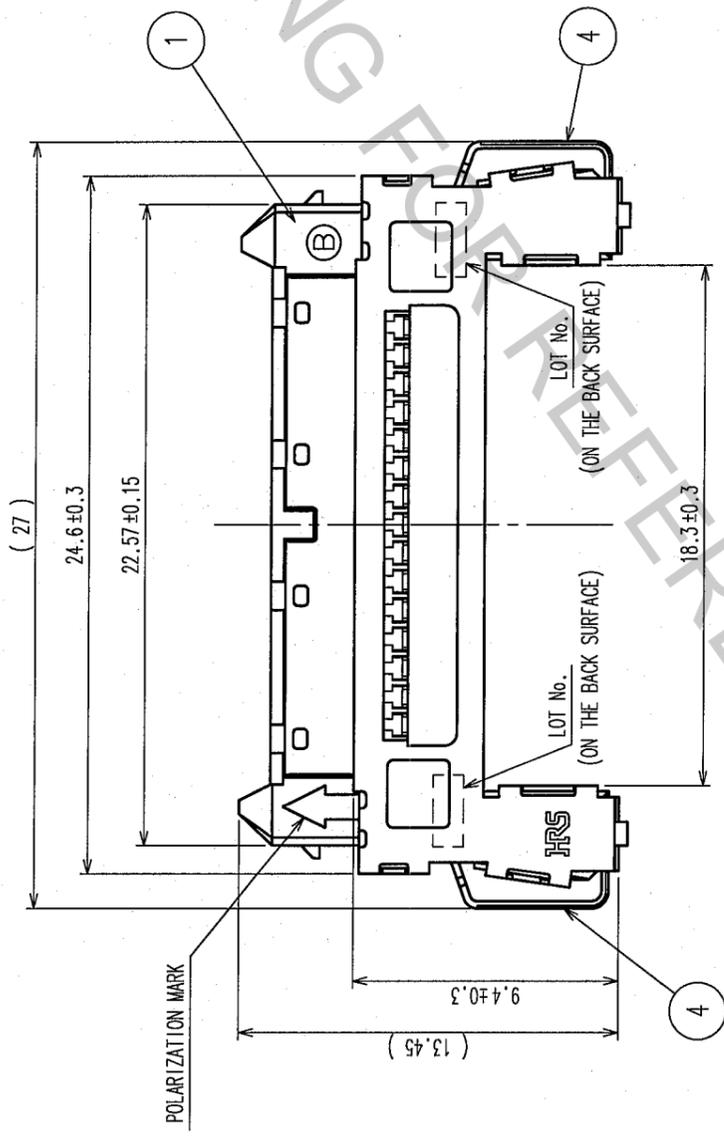


COUNT	DESCRIPTION OF REVISIONS	BY	CHKD	DATE	COUNT	DESCRIPTION OF REVISIONS	BY	CHKD	DATE
△					△				
△					△				
△					△				

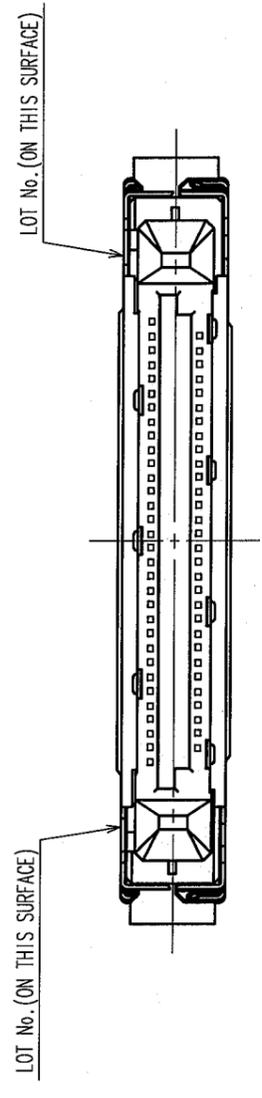

NOTE 1. The lot no. is marked on right and left areas of the indicated surface.  
 2. ( ) indicates a reference dimension.  
 3. The connectors are delivered in tray packaging.  
 Refer to the package specification drawing on Sheet 2 for details.

2	NICKEL SIRVER		4	STAINLESS
1	PA	BLACK	3	NICKEL SIRVER
NO.	MATERIAL	FINISH, REMARKS	NO.	MATERIAL
CODE NO. (OLD) CL				
DRAWN K.SHIBUYA		DESIGNED <i>K. Shibuya</i>		CHECKED <i>H. Yamaguchi</i>
05.08.31		05.08.31		APPROVED <i>H. Okawa</i>
		05.08.31		RELEASED
		05.08.31		05.09.01
DRAWING NO. EDC3-155936		PART NO. FX15S-31P-C		
SCALE 4 : 1		CODE NO. CL575-2106-6		
UNITS ITTT		HIROSE ELECTRIC CO., LTD		

TO




This connector requires careful handling. Please operate the connector with understanding of the following operation instructions.

**Cautions for cable assembly**


- ◆ Cable assembly conditions  
It is recommended that prior to starting of the cable termination the following information be obtained from Hirose. All documents may be requested from the nearest Hirose sales office or agency.
  1. Crimping operation basic instruction (Basic information about cable assembly)
  2. Instruction Manual-Contact crimp termination (Description of the press)
  3. Installation Table-Applicator parts (Installation instruction-Applicator)
  4. Table of crimp conditions (Crimp height, Tensile strength)
  5. Manual of Crimp Quality Standards (Bell-mouth dimensions, Bend up/down, Rolling, others)

Follow the instructions in the documents for proper cable assembly.

- ◆ Crimped contact insertion  
Insert the crimped contacts straight, aligning the faces of the housing lance and the metal latch as shown in the figure. Insertion will not be completed without the alignment. It may also cause the deformation of the crimped contacts or the damage to the housing.

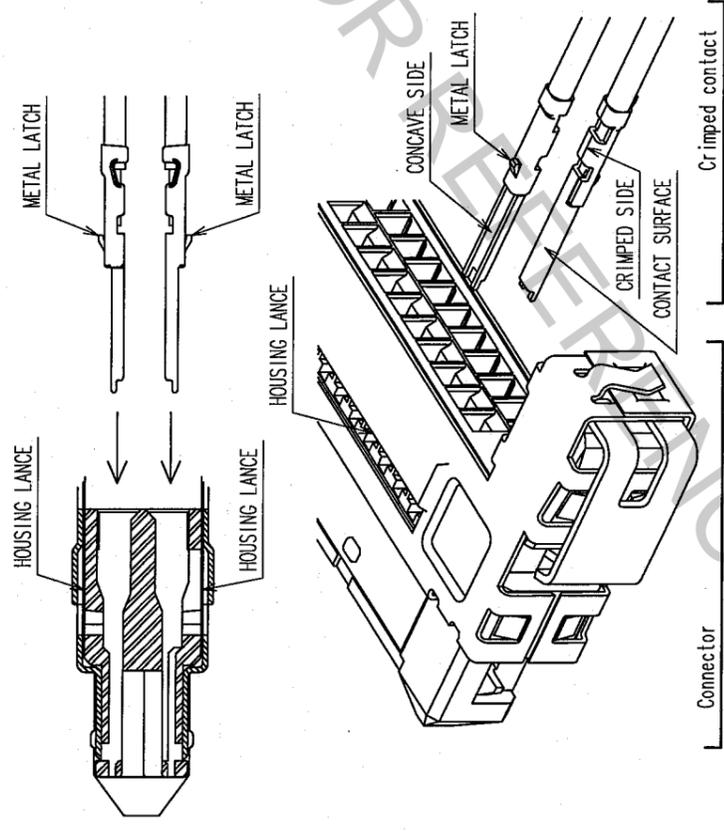


- ◆ Insertion confirmation of crimped contact  
To confirm the proper contact insertion, check the position of the metal latch through the housing lance opening. With the contact properly inserted, the metal latch is positioned where it has completely passed through the housing lance.

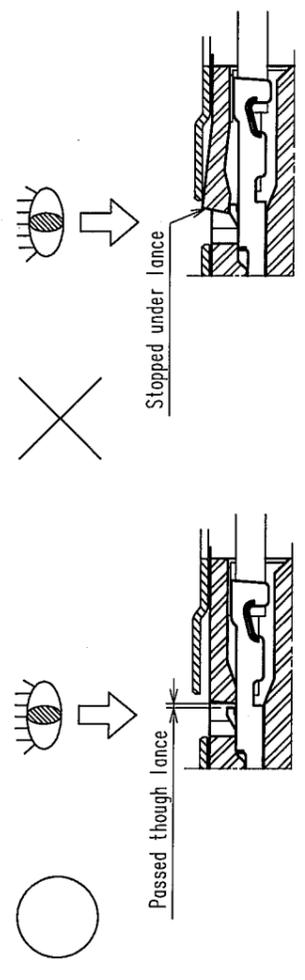


When the cable needs to be pulled for the check, make sure that the applied force is 3 N or lower. Excessive pulling of the cable may damage the housing lance, resulting in the deterioration of the lance retention force.

- ◆ Repair of crimped contacts  
To extract the crimped contact after insertion, pull the cable, with lifting the housing lance with a pointy tool such as a needle. The repair work may have reduced the lance retention force. Therefore, do not reuse the repaired connector. Prepare a new connector.

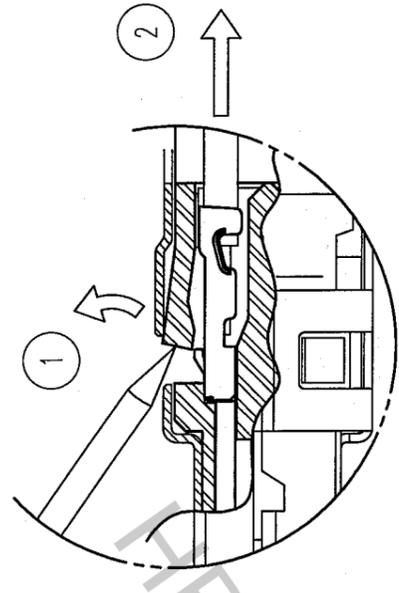

**Cautions for mating with on-board connector**

- ◆ Insertion to on-board connector  
The connector mating is keyed. Align the marks as shown in the figure for mating. Insert the connector completely until they are locked at both ends. The connectors have a reverse-insertion prevention structure, however, the connectors may be damaged when inserted reversely with the force of 25 N or more. Avoid a forceful insertion, and make sure to confirm that the connectors are aligned with the marks before the mating operation.

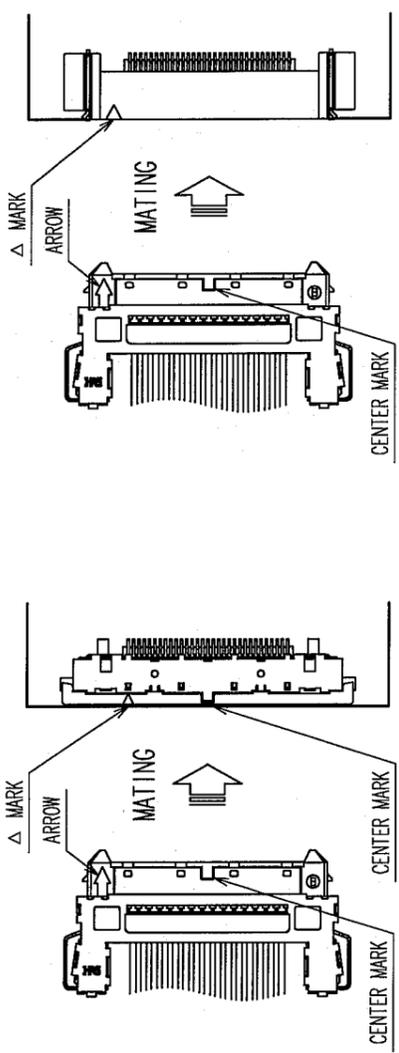

[EXAMPLE] RECEPTACLE: FX15S-\*\*-S-0.5SH

[EXAMPLE] RECEPTACLE: FX15M-\*\*-S-0.5SH

Note: The connectors shown in this "INSTRUCTION MANUAL" are drawn for the instruction purpose, therefore, the appearance differs from the actual connectors. Please confirm the connector configuration on the connector drawing (SHEET 1).

NO.	MATERIAL	FINISH, REMARKS	NO.	MATERIAL	FINISH, REMARKS
CL					
INSTRUCTION MANUAL					
DESIGNED	K. SHIBUYA		CHECKED	K. Shibuya / Yamaguchi / Akawa	
DRAWN	05.08.31		APPROVED	05.08.31 / 05.09.01	
DRAWING NO. EDC3-155936			PART NO. FX15S-31P-C		
SCALE 4 : 1			CODE NO. CL575-2106-6		
UNITS mm			HIROSE ELECTRIC CO., LTD		

