


## Series Datasheet – MK22 Reed Sensors

# www.standexmeder.com

# MK22 Series Reed Sensors

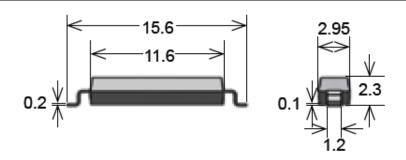

- Features: Supplied in Tape & Reel, J-Lead, Excellent for Low Power Operations
- > Applications: On/Off Control Switch, Position Detection, Switching Element & Others
- Markets: Appliance, Telecommunication, Security, Medical & Others



Magnetic Sensitivity	Lead Design		
B, C, D, E, F	1, 2, 3		

<b>Customer Options</b>	Switch Model	I I mit	
Contact Data	35	Unit	
Rated Power (max.) Any DC combination of V&A not to exceed their individual max.'s	20	W	
Switching Voltage (max.) DC or peak AC	200	V	
Switching Current (max.) DC or peak AC	1.0	А	
Carry Current (max.) DC or peak AC	1.25	А	
Contact Resistance (max.) @ 0.5V & 50mA	150	mOhm	
Breakdown Voltage (min.) According to EN60255-5	0.22	kVDC	
Operating Time (max.) Incl. Bounce; Measured with w/ Nominal Voltage	0.5	ms	
Release Time (max.) Measured with no Coil Excitation	0.1	ms	
Insulation Resistance (typ.) Rh<45%, 100V Test Voltage	1012	Ohm	
Capacitance (typ.) @ 10kHz across open Switch	0.3	pF	



## Series Datasheet – MK22 Reed Sensors

# www.standexmeder.com

Housing and Lead Specifications		
Housing Material Mineral Filled Epoxy		
Case Color	Black	
Lead design 1	Flat, straight leads for PCB slot mounting	
Lead design 2	Flat, bent SMD leads (15.6 mm length)	
Lead design 3	Flat, bent SMD leads (19.5 mm length)	

<b>Environmental Data</b>	Unit		
Shock Resistance (max.) 1/2 sine wave duration 11ms	50	g	
Vibration Resistance (max.)	20	g	
Operating Temperature	-40 to 130	°C	
Storage Temperature	-50 to 130	°C	
Soldering Temperature (max.) 5 sec. max.	260	°C	


Glossary Contact Form			
Form A	NO = Normally Open Contacts SPST = Single Pole Single Throw		
Form B	NC = Normally Closed Contacts SPST = Single Pole Single Throw		
Form C	Changeover SPDT = Single Pole Double Throw		

Glossary Magnetic Sensitivity							
Sens.	Α	В	С	D	Е	F	G
AT	05-10	10-15	15-20	20-25	25-30	30-35	35-40







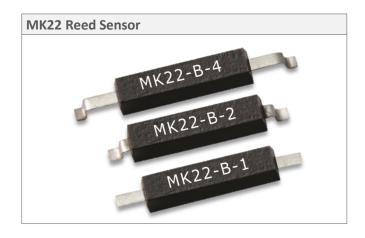

## **Handling & Assembly Instructions**

- Use proper lead clamping or heat sinking techniques to prevent mechanical and/or heat stress during, soldering, and welding
- Mechanical shock as the result of dropping the reed sensor typically from a distance of greater than 12" may change it's magnetic sensitivity and/or destroy the sensor
- Reflow Soldering Conditions according to JEDEC norm J-STD-020D.1

