



Power Supply Connectors For Industrial Equipment

PX Series

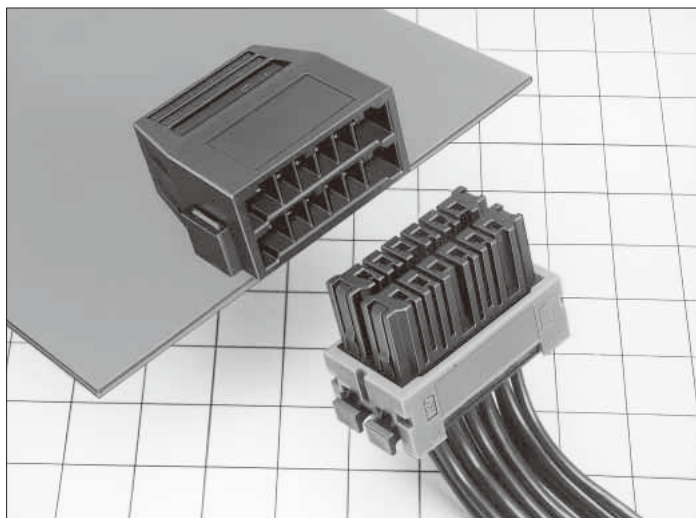

Structure prevents mis-insertion

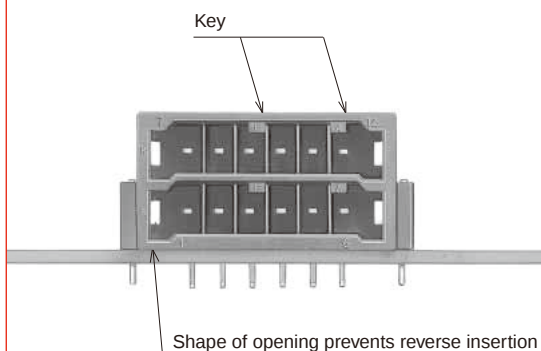

■Features

1. Power supply connector for high-current

Withstands voltage of 2200V AC max. and 10A/contact (60A/6 pos.) of rating current.

2. Housing design prevents incorrect insertion

Opening section is designed to prevent reverse insertion and mating direction is easily checked. Additionally, the opening section is keyed to prevent misalignment of plugs in parallel applications.

3. Reduced Size

When compared to conventional products, Hirose's plug is smaller in size by 65% and the receptacle is smaller by 55%.



4. Reliable contact structure

- ① Three point contact
- ② Gold plated contact point (standard) with high-level environmental resistance
- ③ Contact spring guard structure
- ④ Structure prevents retainer deformation

5. Easy Cable Assembly

- ① Use of dedicated crimping tools will make harness work easier. One tool crimps both AWG#16 and AWG#18 wire.
- ② Positive lock can be felt on contact insertion.
- ③ Release of contact lock can easily be performed with dedicated jig, which facilitates the wiring modification after assembly.

Reliable contact structure

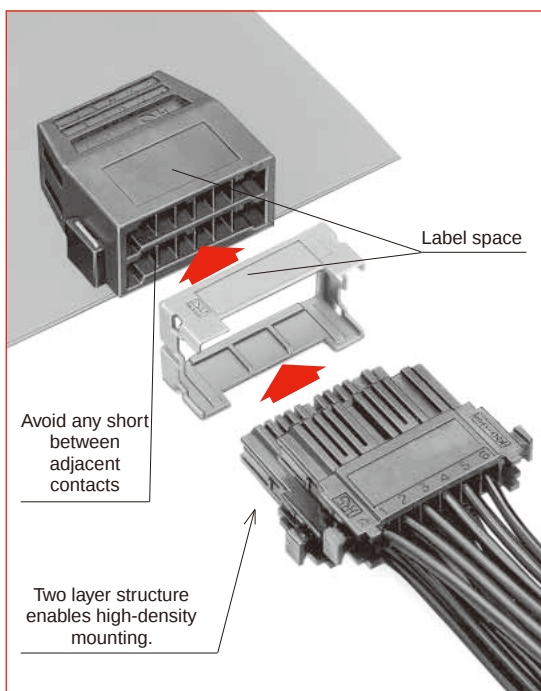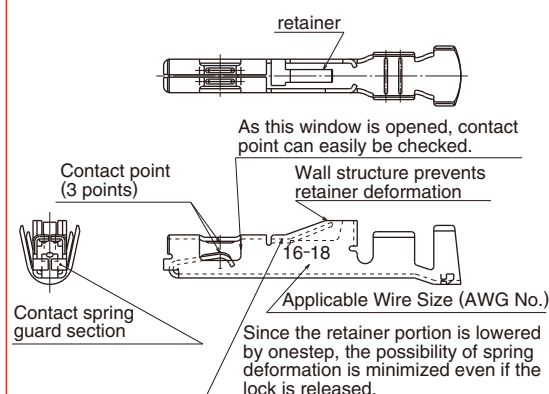

■Product Specifications

Ratings	Operating temperature range	-55℃～+105℃
	Voltage rating	600V AC
	Current rating	10A

Description	Specifications	Requirements
1.Contact resistance	10mΩ max.	100mA
2.Insulation resistance	1000MΩ min.	500V DC
3.Withstanding voltage	No flashover or insulation breakdown.	2200V AC / 1 minute.
4.Durability	①Contact resistance : 20mΩ max. ②No damage, cracks or looseness of parts	1000 cycles
5.Vibration	①No electrical discontinuity of 10μs or more.	Frequency:10 to 55Hz,single amplitude of 0.75mm, 2 hours,3axis
6.Shock	②Contact resistance : 20mΩ max. ③No damage, cracks or looseness of parts	Acceleration: 490m/s ² Duration: 11ms Test at sine half-wave, 3 axes, bi-directional three times, respectively.
7.Temperature cycle	①Contact resistance : 20mΩ max. ②Insulation resistance : 1000MΩ min. ③No damage, cracks or looseness of parts	Temperature : -55→+5～+35→+85→+5～+35℃ Time : 30→10～15→30→10～15Minutes 5 cycles
8.Humidity	①Contact resistance : 20mΩ max. ②Insulation resistance : 1000MΩ min. ③No damage, cracks or looseness of parts	96 hours at 40±2℃ and humidity of 90～95%
9.Salt spray	①No corrossions	5% salt water for 48 hours


■Materials

Parts	Material	Finish
Contacts	Copper alloy	Gold plating
Insulator	PBT (UL94V-0)	
Metal fixture	Copper alloy	Tin reflow plating

◆Comparison In Size With Conventional Equivalent

		(mm)	
		PX	A company-made
Plug	Width	34.2	44.94
	Height	7.0	7.15
	Depth	23.0	22.80
Receptacle	Width	28.0	39.40
	Height	14.8	18.47
	Depth	27.4	27.18



For volume ratio, plug is downsized to : nearly 65%; and
receptacle : nearly 55%.

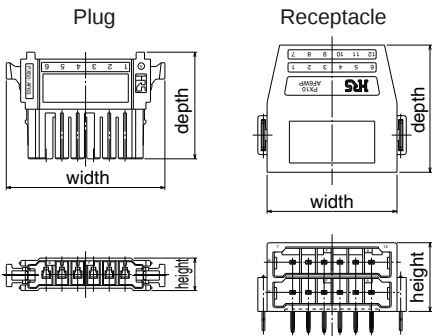



●6 pos.x2 row Type



The diagram shows the front panel of the PXR10 AF6WP printer. It features a top section with a numeric keypad (1-12) and a small display area showing 'MS' and 'PXR10 AF6WP'. Below this is a large rectangular label space. A dimension line on the right indicates the overall height of the front panel is 27.4. An arrow points to the label space with the text 'Label space size 18.4X10.2'.

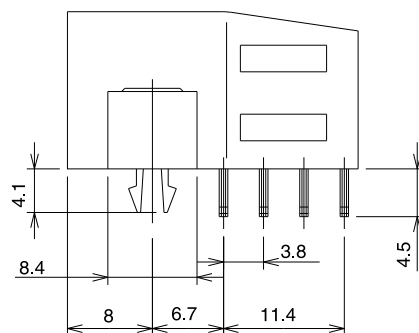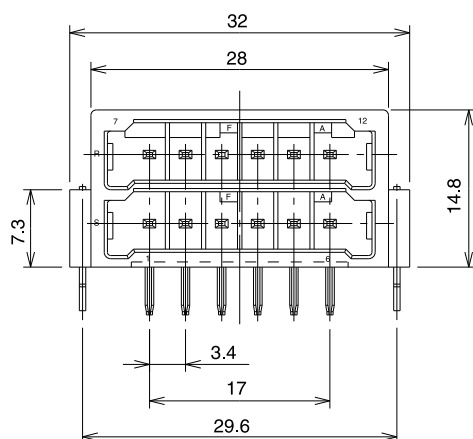

PCB mounting pattern

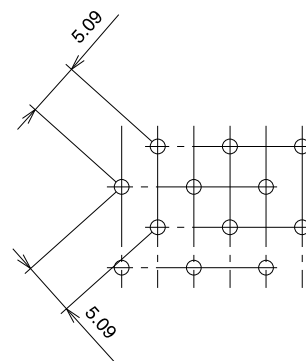
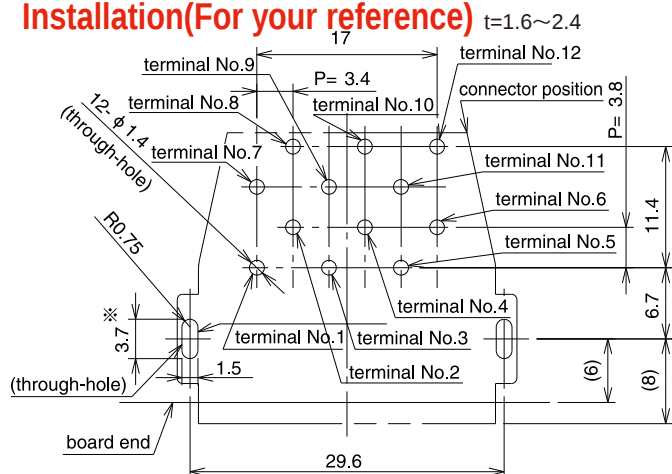


HRS 3


●4 pos.x2 row Type




Part No.	CL No.	RoHS
PX10-AD4WP(50)	236-0005-0-50	YES

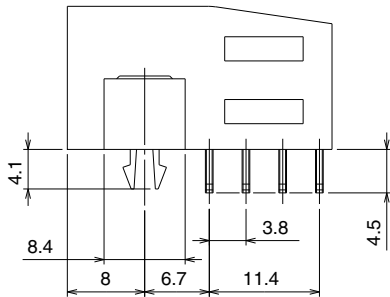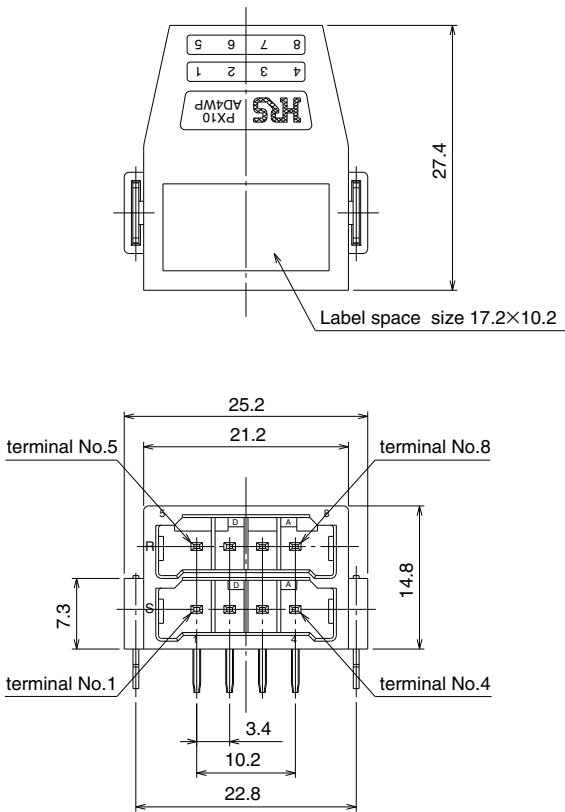

◆Dimensions For Circuit Board Installation(For your reference) t=1.6~2.4

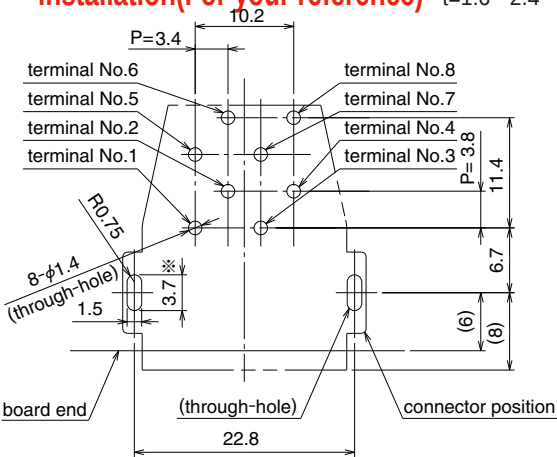

◆PCB mounting pattern

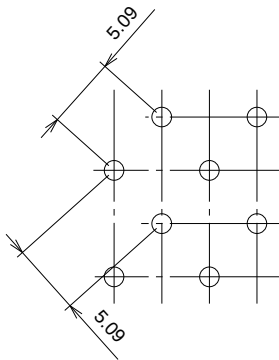


* Where t=1.6 (Setting value depends on thickness of boards.)

■Plug


●6-Position Type




Part No.	CL No.	RoHS
PX50-AF6S	236-0002-2	YES

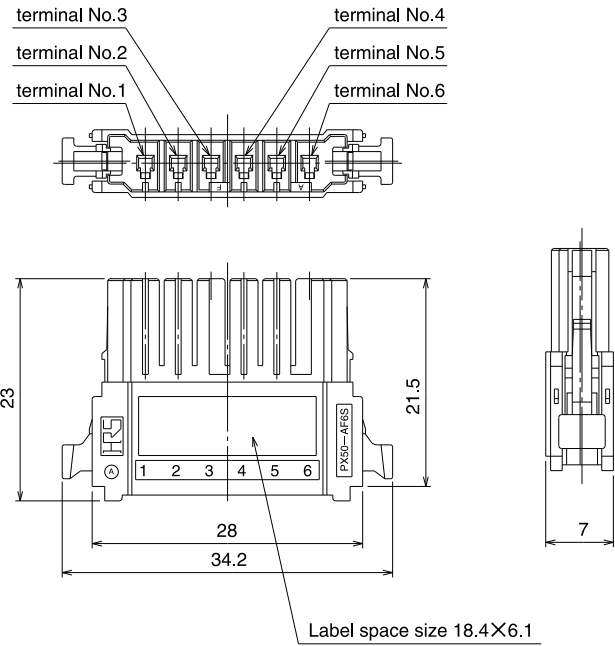

●4-Position Type

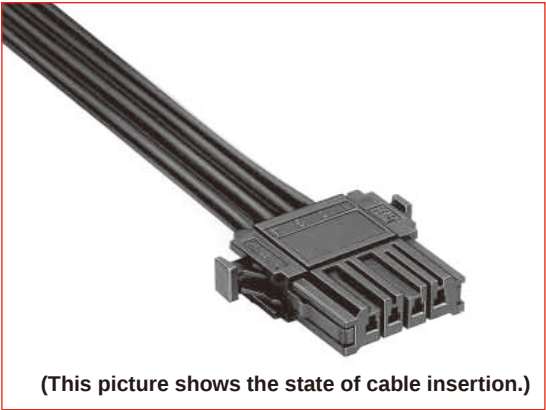


Part No.	CL No.	RoHS
PX50-AD4S	236-0006-3	YES

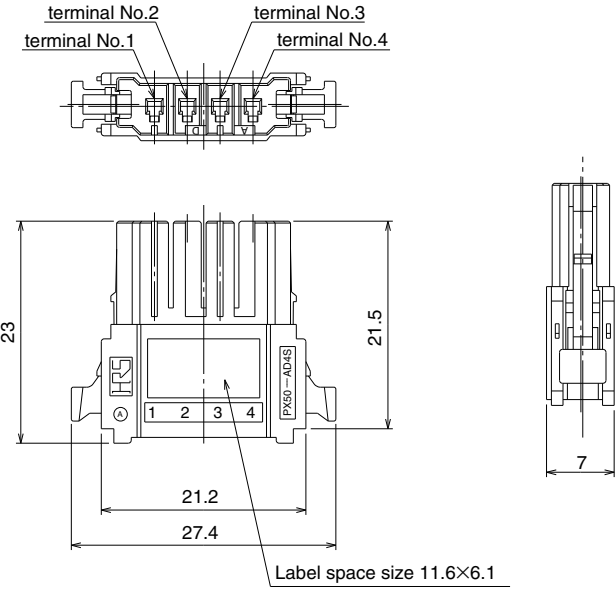


■Simple-Type Plug Holder Cover
●For 6-Position Type




Part No.	CL No.	RoHS
PX-6WS-CV	236-0004-8	YES

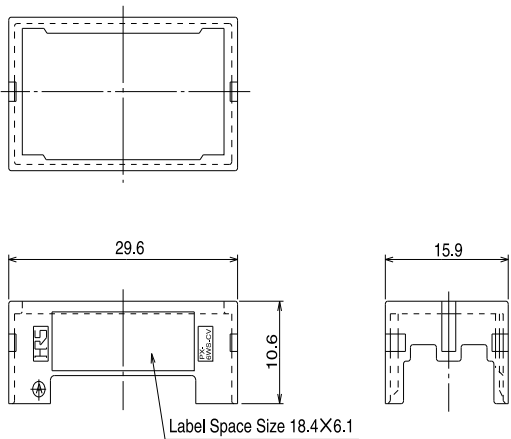

◆Installation status

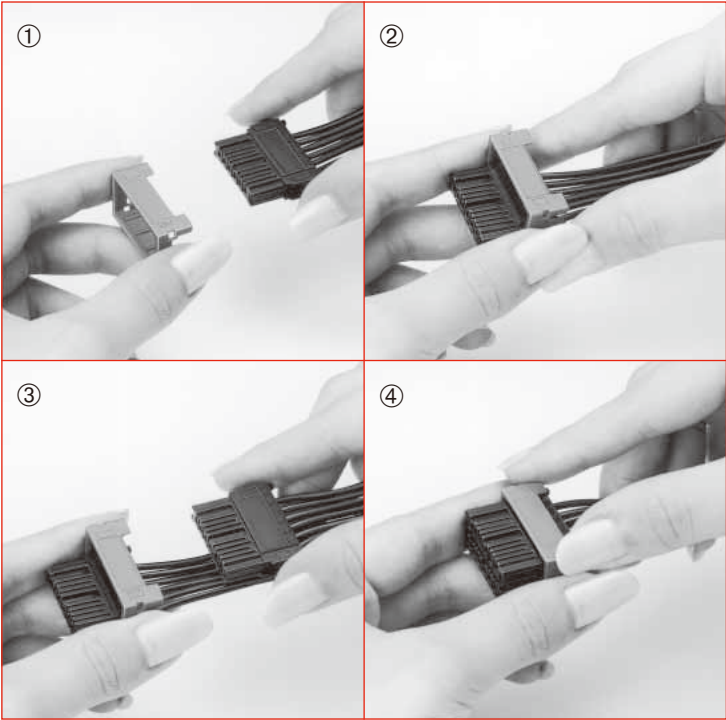

◆Installation method
●6-Position Type

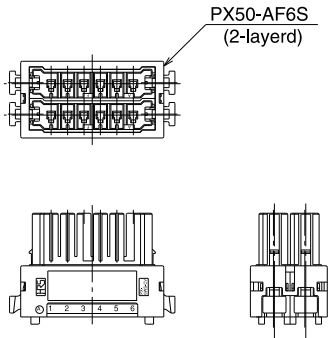

<Caution>The holder cover is not a rugged support fixture but only meant for alignment of the plugs. When external force is imposed by pulling of cables, etc. before mating, please bundle all cables together around the connector with union bands, etc.

■Crimp contact


Applicable wire size	Packaging	Part No.	CL No.	Quantity	RoHS
16, 18	Reel	PX50-SC-231	236-0003-5	5,000	YES
	Bag	PX50-SC-131	236-0008-9	200	

Please order by integral multiple of the packing volume.

■Tools

Type	Description	Part No.	CL No.	Applicable contacts
Automatic	Press unit	CM-105	901-0005-4	PX50-SC-231
	Applicator	AP105-PX50-3	901-2573-8	
Manual	Hand tool (*)	HT104/PX50-3	250-0229-4	PX50-SC-131
Contact extraction tool		PX50-SC-TC	250-0233-1	PX50-SC-*31

*For our manual crimping tools, we employ the rotate-replace procedure to use the crimper depending on wire size.

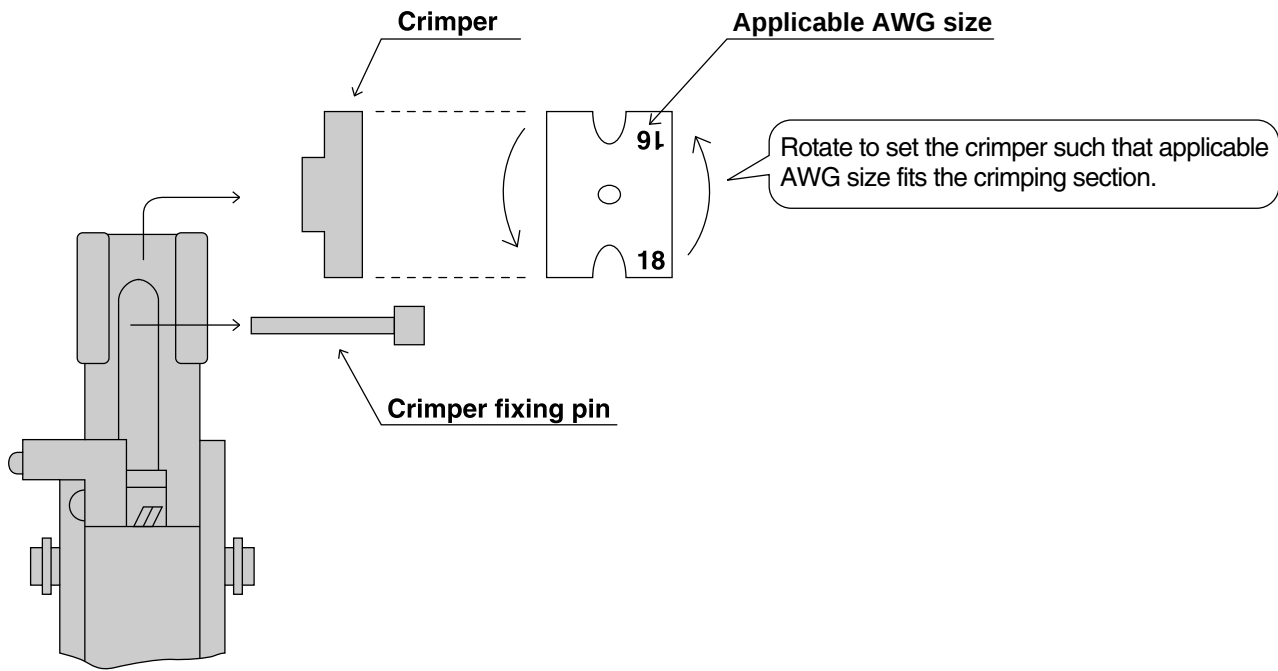

[Manual crimping tool : crimped section]

Note : Since manual crimping tool cannot provide fine adjustment of crimp height, please use the proper crimp height of auto crimper in crimping of the wires other than specified ones

■Crimp Terminal Remoral Jig





Part No.	CL No.	RoHS
PX-50-SC-TC	250-0233-1	YES

<WARNING>

When the crimp terminal remoral jig is inserted and pushed from the mating face of a connector as shown below, retainer lock of the terminal will be released. Then please extract the cable. If the retainer is too lowered after extracting terminal, put it in a former position and reinsert. Position and direction of the jig top to be inserted are as shown in the Figures below. Be careful that any mistake will lead to the damage of terminal.

●How To Extract Crimp Terminal

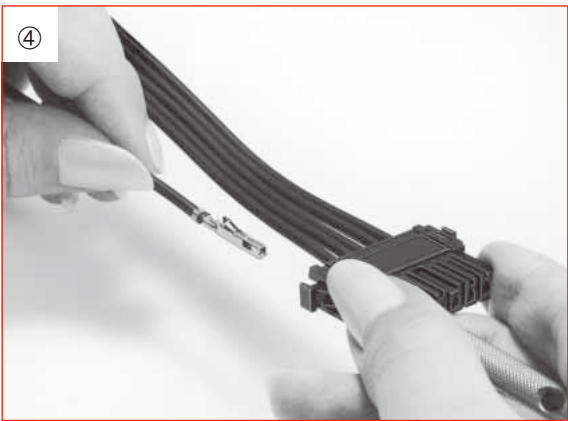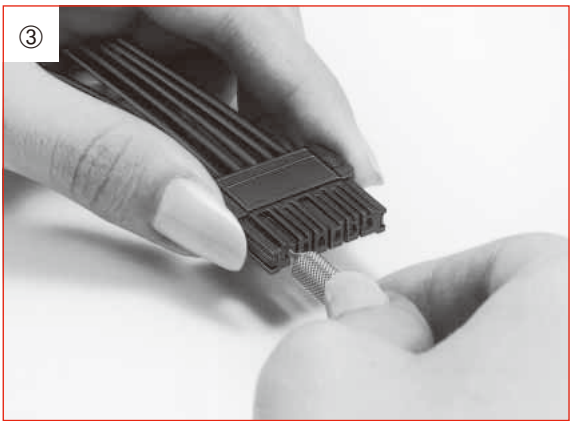

* Insert the jig top into the peak of convex section on terminal hole.



HIROSE ELECTRIC CO.,LTD.

6-3,Nakagawa Chuoh-2-Chome,Tsuzuki-Ku,Yokohama-Shi 224-8540,JAPAN
TEL: +81-45-620-3526 Fax: +81-45-591-3726
<http://www.hirose.com>
<http://www.hirose-connectors.com>

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Hirose Electric:

[PX10-AD4WP\(50\)](#) [PX10-AF6WP\(50\)](#) [PX50-SC-131\(50\)](#) [PX-4WS-CV](#) [PX11-AD4P\(50\)](#) [PX11-BD3P\(50\)](#) [PX11-BF4P\(50\)](#) [HT104/PX50-3](#) [PX50-SC-231\(50\)](#) [PX11-AC3P\(50\)](#) [PX50-SC-TC](#) [PX50-SC-231\(30\)](#)