


## Series Datasheet - MK24 Reed Sensors

# www.standexmeder.com

# MK24 Series Reed Sensors

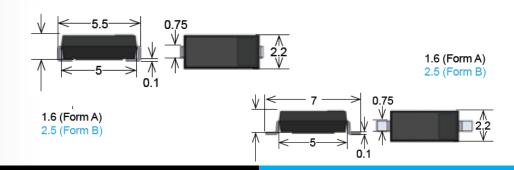

- Features: Supplied in Tape & Reel, J-Lead, Excellent for Low Power Operations
- Applications: On/Off Control Switch, Position Detection, Switching Element & Others
- Markets: Appliance, Telecommunication, Security, Medical & Others



Magnetic Sensitivity	Lead Design		
A, B, C, D, E	1, 2 , 3		

<b>Customer Options</b>	Switch Model	Unit
Contact Data	04	Offic
Rated Power (max.) Any DC combination of V&A not to exceed their individual max.'s	3 / 1*	W
Switching Voltage (max.) DC or peak AC	30	V
Switching Current (max.) DC or peak AC	0.3 / 0.1*	А
Carry Current (max.) DC or peak AC	0.5 / 0.3*	А
Contact Resistance (max.) @ 0.5V & 50mA	200 / 250*	mOhm
Breakdown Voltage (min.) According to EN60255-5	0.1 / 0.06*	kVDC
Operating Time (max.) Incl. Bounce; Measured with w/ Nominal Voltage	0.25	ms
Release Time (max.) Measured with no Coil Excitation	0.15	ms
Insulation Resistance (typ.) Rh<45%, 100V Test Voltage	10 <sup>10</sup>	Ohm
Capacitance (typ.) @ 10kHz across open Switch	0.1	pF
* Valid for Magnetic Sensitivity Range A		



USA: +1.866.782.6339 Europe: +49.7731.8399.0 Asia: +86.21.37820625 | salesusa@standexmeder.com | info@standexmeder.com | salesasia@standexmeder.com



## Series Datasheet – MK24 Reed Sensors

# www.standexmeder.com

Housing and Lead Specifications			
Housing Material Mineral Filled Epoxy			
Case Color Black			
Lead design 1 Flat, straight leads for PCB slot mounti			
Lead design 2	Flat, bent SMD leads		
Lead design 3	J-Lead		

<b>Environmental Data</b>	Unit		
Shock Resistance (max.) 1/2 sine wave duration 11ms	30	g	
Vibration Resistance (max.)	20	g	
Operating Temperature	-40 to 130	°C	
Storage Temperature	-50 to 130	°C	
Soldering Temperature (max.) 5 sec. max.	260	°C	

Glossary Contact Form				
Form A	NO = Normally Open Contacts SPST = Single Pole Single Throw			
Form B	Form B NC = Normally Closed Contacts SPST = Single Pole Single Throw			
Form C Changeover SPDT = Single Pole Double Throw				

Glossary Magnetic Sensitivity							
Sens.	Α	В	С	D	Е	F	G
AT	05-10	10-15	15-20	20-25	25-30	30-35	35-40









# **Handling & Assembly Instructions**

- Use proper lead clamping or heat sinking techniques to prevent mechanical and/or heat stress during, soldering, and welding
- Mechanical shock as the result of dropping the reed sensor may cause immediate or post-installation failure
- Reflow Soldering Conditions according to JEDEC norm J-STD-020D.1

