
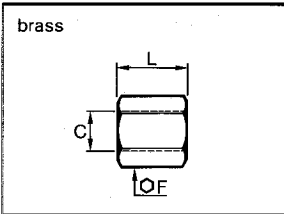




adaptors

0155 double female sleeve, BSP parallel thread

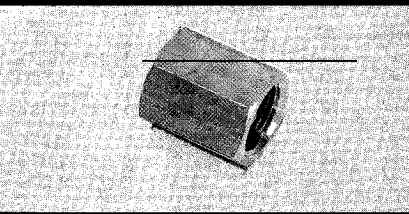



C		F	L	Δ kg
1/8	0155 10 10	14	17	0,015
1/4	0155 13 13	17	24	0,025
3/8	0155 17 17	22	25	0,045
1/2	0155 21 21	27	32	0,084
3/4	0155 27 27	32	35	0,109

0164 male NPT to female BSP parallel adaptor

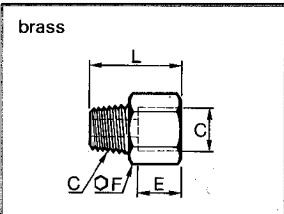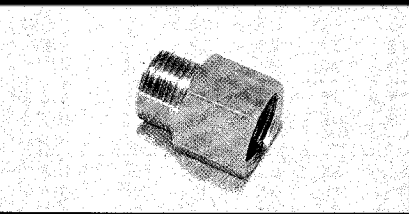



C		E	F	L	Δ kg
1/8	0164 11 10	7,5	14	20	0,015
1/4	0164 14 13	11	17	27,5	0,028
3/8	0164 18 17	11,5	22	28,5	0,044
1/2	0164 22 21	15	27	36,5	0,081
3/4	0164 28 27	16,5	32	38,5	0,112

0167 male BSP taper to female NPT adaptor

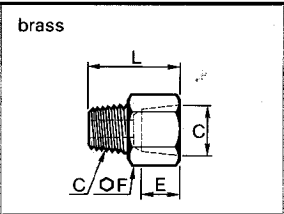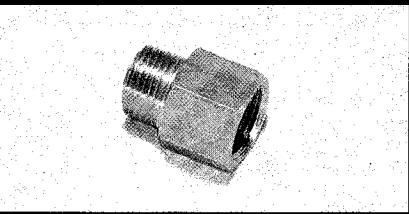



C		E	F	L	Δ kg
1/8	0167 10 11	8	14	21	0,016
1/4	0167 13 14	11,5	17	28,5	0,029
3/8	0167 17 18	12	22	29,5	0,047
1/2	0167 21 22	15,5	27	37,5	0,087
3/4	0167 27 28	17	32	39,5	0,121

0168 reducer male to female BSP parallel

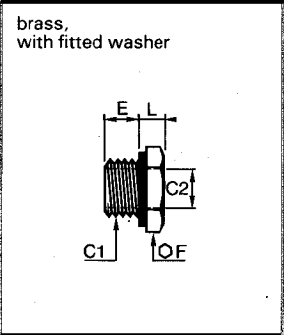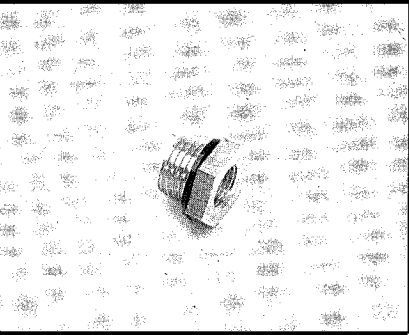



C1	C2		E	F	L	Δ kg
1/8	M5	0168 10 19	7	14	6	0,008
1/4	M5	0168 13 19	7	17	7	0,010
1/4	1/8	0168 13 10	7	17	7	0,010
3/8	1/8	0168 17 10	9	19	6	0,020
3/8	1/4	0168 17 13	9	19	6	0,013
1/2	1/8	0168 21 10	11	24	10	0,046
1/2	1/4	0168 21 13	11	24	10	0,038
1/2	3/8	0168 21 17	11	24	10	0,026
3/4	1/4	0168 27 13	11	32	12	0,090
3/4	3/8	0168 27 17	11	32	12	0,078
3/4	1/2	0168 27 21	11	32	12	0,058

0163 reducer male BSP taper to female BSP parallel

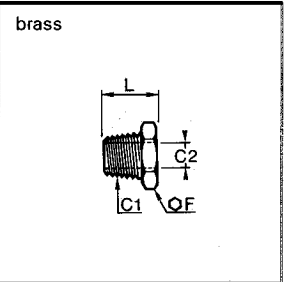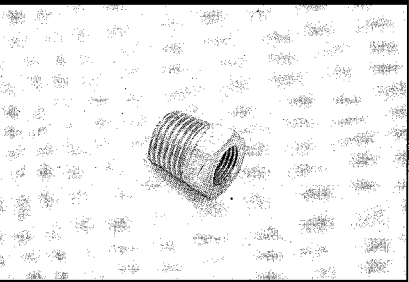

C1	C2		F	L	Δ kg
1/4	1/8	0163 13 10	14	16	0,009
3/8	1/8	0163 17 10	17	16,5	0,020
3/8	1/4	0163 17 13	17	16,5	0,012
1/2	1/8	0163 21 10	22	21	0,047
1/2	1/4	0163 21 13	22	21	0,038
1/2	3/8	0163 21 17	22	21	0,025
3/4	1/4	0163 27 13	27	24	0,086
3/4	3/8	0163 27 17	27	24	0,069
3/4	1/2	0163 27 21	27	24	0,048

0169 increaser male to female, BSP parallel

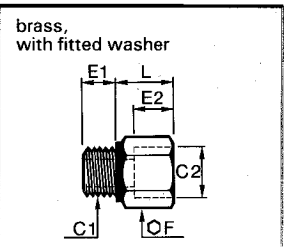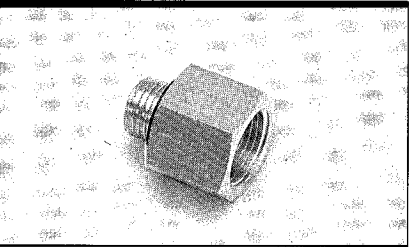

C1	C2		E1	E2	F	L	Δ kg
1/8	1/4	0169 10 13	5	11	17	16	0,020
1/8	3/8	0169 10 17	5	14	22	19,5	0,038
1/4	3/8	0169 13 17	7	14	22	19,5	0,042
1/4	1/2	0169 13 21	7	14,5	27	20,5	0,061
3/8	1/2	0169 17 21	8	14,5	27	20,5	0,062
3/8	3/4	0169 17 27	8	15,5	32	22	0,082
1/2	3/4	0169 21 27	9,5	15,5	32	22,5	0,088