



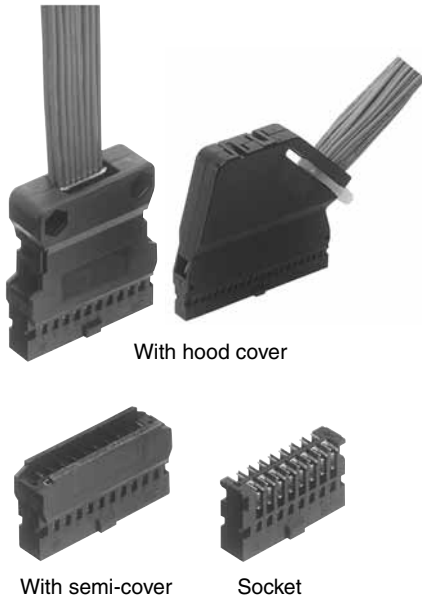
Discontinued as of September 30, 2010

AXW

Panasonic
ideas for life

FOR PC BOARD TO WIRE

WIRE-PRESS
SOCKETS (AXW)




Compliance with RoHS Directive

FEATURES

1. Pressure welding method for superior wiring and no need to strip wires.


Applicable wires: AWG #22, #24, #26, #28.

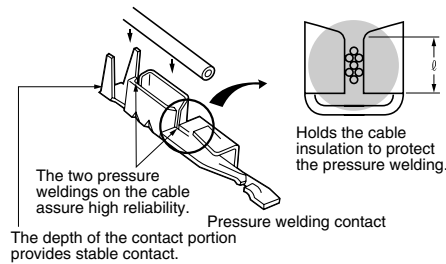2. Two pressure weldings assure high contact reliability.




3. Labor saving one-touch attachment of the cover and socket body.

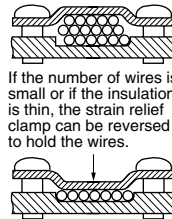
4. Even if the number of wires is small, the stable pressure welding is acquired.



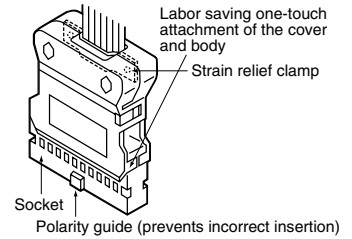5. Angled hood cover type can save space and makes adjacent mounting possible.



Vertical hood cover type

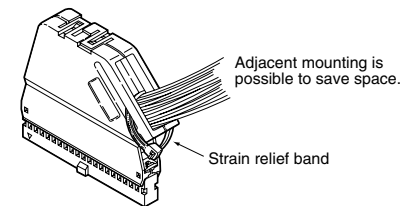

Angled hood cover type

6. Fits MIL headers and low profile headers (box and open types).

7. Useful pressure welding tools are available.

APPLICATIONS

NC machine, automated equipment, office automation equipment, ME equipment, measurement equipment, communications equipment, amusement and game equipment.

ORDERING INFORMATION

1. Socket

AXW 1 1 1 1 1 A

1: Wire-press sockets (Socket)

<No. of contacts (2 digits)>

<Configuration and polarity guide position>

4: No polarity guide for 10 contact type, types with other number of contacts have 1 polarity guide in middle.

9: Polarity guide in middle for 10 contact type.

<Applicable cable>

Nil: Without contact

2: Pressure welding AWG#22 to #24

3: Pressure welding AWG#26 to #28

<Surface treatment (Pressure welding portion/Terminal portion)>

Nil: Without contact

1: Au plating/Sn plating

<Package form>

A: Individual package



2. Socket (Set)

AXW **3** **1** **A**

3: Wire-press sockets (Set)

<No. of contacts (2 digits)>

<Cover shape>

1: Semi-covers

2: Vertical type hood cover

3: Angle type hood cover

<Configuration and polarity guide position>

4: No polarity guide for 10 contact type,
types with other number of contacts have 1 polarity guide in middle.

9: Polarity guide in middle for 10 contact type.

<Applicable cable>

Nil: Without contact

2: Pressure welding AWG#22 to #24

3: Pressure welding AWG#26 to #28

<Surface treatment (Pressure welding portion/Terminal portion)>

Nil: Without contact

1: Au plating/Sn plating

<Package form>

A: Individual package

3. Cover

AXW **6** **0** **A**

6: Wire-press sockets (Cover)

<No. of contacts (2 digits)>

<Connecting wires>

0: Pressure welding method

<Cover shape>

1: Semi-covers

2: Vertical type hood cover

3: Angle type hood cover

<Package form>

A: Individual package

4. Contact

AXW **7** **2** **1**

7: Wire-press sockets (Contact)

<Sales form>

2: 5 in line

<Applicable cable>

2: Pressure welding AWG#22 to #24








3: Pressure welding AWG#26 to #28

<Surface treatment (Pressure welding portion/Terminal portion)>

1: Au plating/Sn plating







**WIRING AND ASSEMBLY**

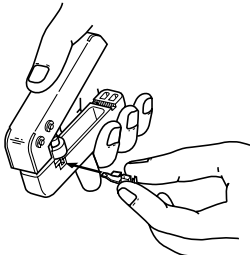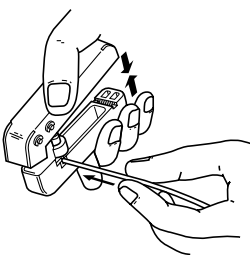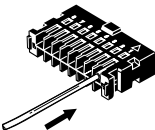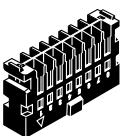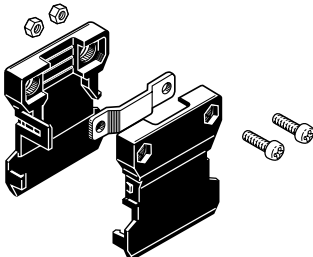1. When using small amounts (about 150 pins can be pressure welding per hour)

Process	1. Bend the contact back from the carrier, and set it in the pressure welding tool.	2. Insert the wire without removing its insulation unit it stops, and lightly grip the tool.	3. After press-fitting the wire, insert it into housing.	4. Attach the cover to complete the operation. (Note)
				
Necessary parts	 Stapler type AXY52000	 Contacts (5 in line)	 Separate wires	 Housing without contacts
				 Vertical type hood cover block






(Note) There are 3 types of cover: semi-covers, vertical type hood cover blocks, and angle type hood cover blocks.

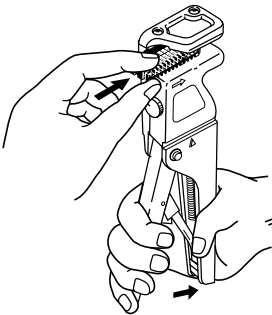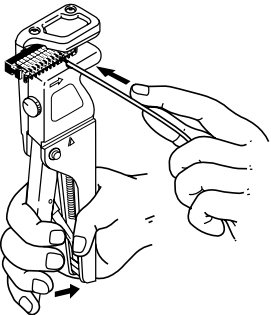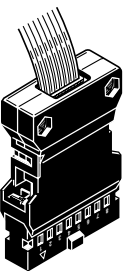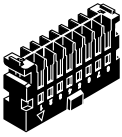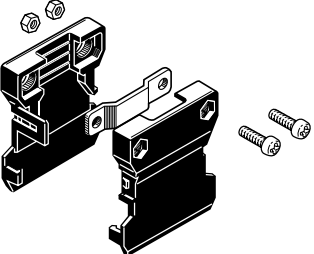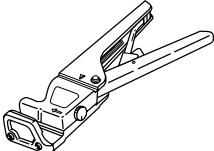2. When using medium to large amounts (when using pliers-type pressure welding tool, about 450 pins per hour)

Process	1. Set the housing with contact in the pressure welding tool.	2. Insert the wires with insulation attached, until they touch the back, then use the tool's pressure welding operation.	3. Attach the cover to complete the operation. (Note)
			
Necessary parts	 Housing with contacts	 Separate wires	 Vertical type hood cover block
	 Pliers-type AXY51000		

(Note) There are 3 types of cover: semi-covers, vertical type hood cover blocks, and angle type hood cover blocks.

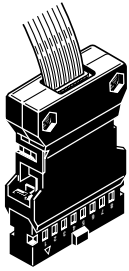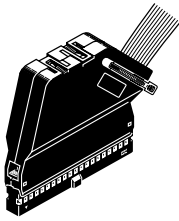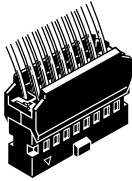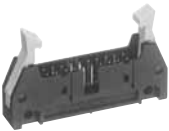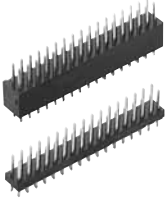APPLICABLE HEADERS AND COMBINATIONS

Pressure socket for separate wires			
	Vertical type hood cover block	Angled type hood cover block	Semi-cover Note) With cover installed on socket
+			
Applicable headers			
	Long lever type MIL header	Box type low profile header	7.4mm high type 2.54mm high type Open type low profile header
↓			
Combinations			
			
Note) Loose wires omitted from photos			



Discontinued as of September 30, 2010

AXW

PRODUCT TYPES

1. Individual parts (Standard)

Type			No. of contacts	Part No.		Packing			
				Applicable cable		Inner carton	Outer carton		
				AWG #22, 24	AWG #26, 28				
Housing	Housing with contacts Note) Suitable for use of pliers type or desktop type pressure welding tool.	10	AXW110421A (Without polarity guide)	AXW110431A (Without polarity guide)	100 pcs.	400 pcs.			
		10	AXW110921A (With polarity guide)	AXW110931A (With polarity guide)					
		14	AXW114421A	AXW114431A					
		16	AXW116421A	AXW116431A					
		20	AXW120421A	AXW120431A					
		26	AXW126421A	AXW126431A					
		30	AXW130421A	AXW130431A					
		34	AXW134421A	AXW134431A					
		40	AXW140421A	AXW140431A					
		50	AXW150421A	AXW150431A					
		60	AXW160421A	AXW160431A					
		64	AXW164421A	AXW164431A					
	Housing without contacts Note) Suitable for use of stapler-type pressure welding tool.	10	AXW1104A (Without polarity guide)		100 pcs.	400 pcs.			
		10	AXW1109A (With polarity guide)						
		14	AXW1144A						
		16	AXW1164A						
		20	AXW1204A						
		26	AXW1264A						
		30	AXW1304A						
		34	AXW1344A						
		40	AXW1404A						
		50	AXW1504A						
		60	AXW1604A						
		64	AXW1644A						
Cover	Hood cover block	Vertical type	16	AXW61602A		100 pcs.	400 pcs.		
			20	AXW62002A					
			26	AXW62602A					
			30	AXW63002A					
			Angled type	34	AXW63402A		50 pcs.	200 pcs.	
				40	AXW64002A				
				50	AXW65002A				
				60	AXW66002A				
		64		AXW66402A					
		26		AXW62603A		50 pcs.			200 pcs.
		30		AXW63003A					
		34		AXW63403A					
		40	AXW64003A						
		50	AXW65003A						
		60	AXW66003A						
		64	AXW66403A						
	Semi-cover	10	AXW61001A		100 pcs.		400 pcs.		
		14	AXW61401A						
		16	AXW61601A						
		20	AXW62001A						
		26	AXW62601A						
		30	AXW63001A						
		34	AXW63401A						
		40	AXW64001A						
50		AXW65001A							
60		AXW66001A							
64	AXW66401A								
Contacts (5 in line) (Notes 5 and 6)			5	AXW7221 (for AWG #22, 24)	AXW7231 (for AWG #26, 28)	40 rows (200pcs.)	400 rows (2,000 pcs.)		

Notes) 1. The parts above are packaged individually. (Contact is tray packing)

2. The vertical type hood cover block is packaged with two covers (one with nuts), one wire bunding metal.

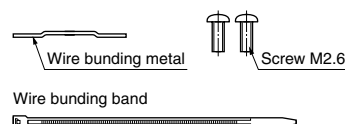
3. The angled type hood cover block is packaged with two covers and one wire bunding band.

4. The angled type hood cover for less than 20 contacts and the vertical type hood cover for less than 14 contacts are not available. Please use the semi-cover.

5. There is a mark "22" on contacts for AWG #22 and #24, and mark "26" for AWG #26 and #28.

6. Remarks for contacts

1) Reel packaging is available.





2. Set products (produced after order)

Set products are produced after an order is received, so if you have a tight deadline, please order the products on the above as stand-alone products.

Type	Set product		No. of contacts	Part No.		Packing	
	Socket	Cover		Applicable cable		Inner carton	Outer carton
				AWG #22, 24	AWG #26, 28		
Full set (Note 1)	Housing with contacts	Vertical type hood cover block	16	AXW3162421A	AXW3162431A	50 pcs.	200 pcs.
			20	AXW3202421A	AXW3202431A		
			26	AXW3262421A	AXW3262431A		
			30	AXW3302421A	AXW3302431A		
			34	AXW3342421A	AXW3342431A		
			40	AXW3402421A	AXW3402431A		
			50	AXW3502421A	AXW3502431A		
			60	AXW3602421A	AXW3602431A		
		64	AXW3642421A	AXW3642431A			
		Angled type hood cover block	26	AXW3263421A	AXW3263431A		
			30	AXW3303421A	AXW3303431A		
			34	AXW3343421A	AXW3343431A		
			40	AXW3403421A	AXW3403431A		
			50	AXW3503421A	AXW3503431A		
			60	AXW3603421A	AXW3603431A		
		Semi-cover	64	AXW3643421A	AXW3643431A		
			10	AXW3101421A (Without polarity guide)	AXW3101431A (Without polarity guide)		
			10	AXW3101921A (With polarity guide)	AXW3101931A (With polarity guide)		
			14	AXW3141421A	AXW3141431A		
			16	AXW3161421A	AXW3161431A		
			20	AXW3201421A	AXW3201431A		
			26	AXW3261421A	AXW3261431A		
			30	AXW3301421A	AXW3301431A		
			34	AXW3341421A	AXW3341431A		
			40	AXW3401421A	AXW3401431A		
			50	AXW3501421A	AXW3501431A		
			60	AXW3601421A	AXW3601431A		
			64	AXW3641421A	AXW3641431A		
Half-set (Note 2)	Housing without contacts		Vertical type hood cover block	16	AXW31624A		50 pcs.
		20		AXW32024A			
		26		AXW32624A			
		30		AXW33024A			
		34		AXW33424A			
		40		AXW34024A			
		50		AXW35024A			
		60		AXW36024A			
		64	AXW36424A				
		Angled type hood cover block	26	AXW32634A			
			30	AXW33034A			
			34	AXW33434A			
			40	AXW34034A			
			50	AXW35034A			
			60	AXW36034A			
		Semi-cover	64	AXW36434A			
			10	AXW31014A (Without polarity guide)			
			10	AXW31019A (With polarity guide)			
			14	AXW31414A			
			16	AXW31614A			
			20	AXW32014A			
			26	AXW32614A			
			30	AXW33014A			
			34	AXW33414A			
			40	AXW34014A			
			50	AXW35014A			
			60	AXW36014A			
			64	AXW36414A			

Notes) 1. Full-set products (Housing with contact and cover included)

(1) Suitable for use with pliers type.

(2) Produced after an order is received. If you are in a hurry, please order a housing with contact and cover separately from the list above.

2. Half-set products (Housing without contact and cover included)

(1) Suitable for use with stapler-type pressure welding tool

(2) As half-sets do not include a contact, order the appropriate stand-alone contact from the list above.

(3) Produced after an order is received. If you are in a hurry, please order a housing without contact, contacts and cover separately from the list on page 235.



Discontinued as of September 30, 2010

AXW

SPECIFICATIONS

1. Characteristics

	Item	Specifications	Conditions
Electrical characteristics	Rated current	AWG#22, 24: 3A, AWG#26: 2A, AWG#28: 1A	
	Rated voltage	250V AC	
	Breakdown voltage	1,000V AC for 1 min.	Detection current: 1mA
	Insulation resistance	Min. 1,000MΩ	Using 500V DC megger
	Contact resistance	Max. 20mΩ	Measured based on the HP4338B measurement method of JIS C 5402
Mechanical characteristics	Unit removal force	Min. 0.343N {35gf}	Measured by steel-pin-gauge with 0.64±0.01mm square (surface roughness 0.1μm)
	Composite insertion force	Max. 2.94N {300gf} × No. of contacts	
Life time characteristics	Insertion and removal life	500 times	Repeat insertion and removal speed of max. 600 times/hour
Environmental characteristics	Ambient temperature	-50°C to 105°C	No freezing at low temperatures Ambient temperature of cables should be considered
	Vibration resistance	Double amplitude: 1.52mm Frequency: 10 to 55Hz (for 3 axes)	No interruption of current longer than 1μs (Max. carrying current 100mA should be impressed during the test)
	Shock resistance	490m/s ² {50G} (for 3 axes)	No interruption of current longer than 1μs (Max. carrying current 100mA should be impressed during the test)

2. Materials and surface treatment

	Part name	Materials	Surface treatment
Housing		Glass fiber reinforced PBT (UL94V-0)	—
Cover	Semi-cover	Glass fiber reinforced PBT (UL94V-0)	—
	Hood cover	Glass fiber polycarbonate resin (UL94V-0) Vertical type hood cover (16, 20 contact)	—
Contact		Copper alloy	Contact portion: Ni plating on base, Au plating on surface Contact pressure portion: Ni plating on base, Sn plating on surface
Lead wire bundling metal (enclosed with vertical type hood cover)		Steel plate	—
Lead wire bundling band (enclosed with angled type hood cover)		Polyimide resin	—

3. Applicable cable

No.	Cross section area	External figure	Rated current	Remarks
AWG#22	0.3 mm ²	1.5 to 1.1 dia.	3A	12 wires/0.18 should used
AWG#24	0.2 mm ²		3A	
AWG#26	0.14mm ²	1.3 to 1.1 dia.	2A	
AWG#28	0.08mm ²		1A	


DIMENSIONS (Unit: mm) The CAD data of the products with a **CAD Data** mark can be downloaded from: <http://panasonic-electric-works.net/ac>

• Housing with contacts

CAD Data

Dimension table (mm)

No. of contacts	Polarity guide	A	B
10	0	17.3	10.16
10	1	17.3	10.16
14	1	22.4	15.24
16	1	24.9	17.78
20	1	30.0	22.86
26	1	37.6	30.48
30	1	42.7	35.56
34	1	47.8	40.64
40	1	55.4	48.26
50	1	68.1	60.96
60	1	80.8	73.66
64	1	85.9	78.74

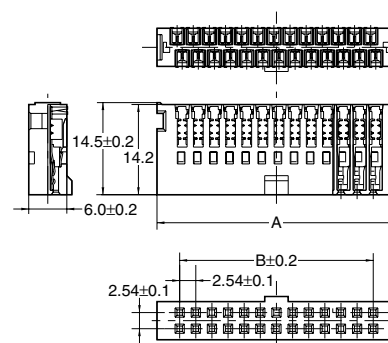

General tolerance: ±0.3

Note) Dimensions of the housing without contact is the same as the right figure.



• Socket

1) When vertical type hood covers are mated (16, 20, 26, 30, 34, 40, 50, 60 and 64 contacts)

CAD Data


16 and 20 contacts

26 to 64 contacts



Dimension table (mm)

No. of contacts	A	B	C	D
16	24.0	24.92	17.78	33.5
20	27.8	30.0	22.86	33.5
26	28.5	37.6	30.48	33.5
30	33.5	42.7	35.56	33.5
34	38.6	47.8	40.64	33.5
40	43.6	55.4	48.26	41.5
50	56.0	68.1	60.96	41.5
60	68.7	80.8	73.66	41.5
64	73.8	85.9	78.74	41.5

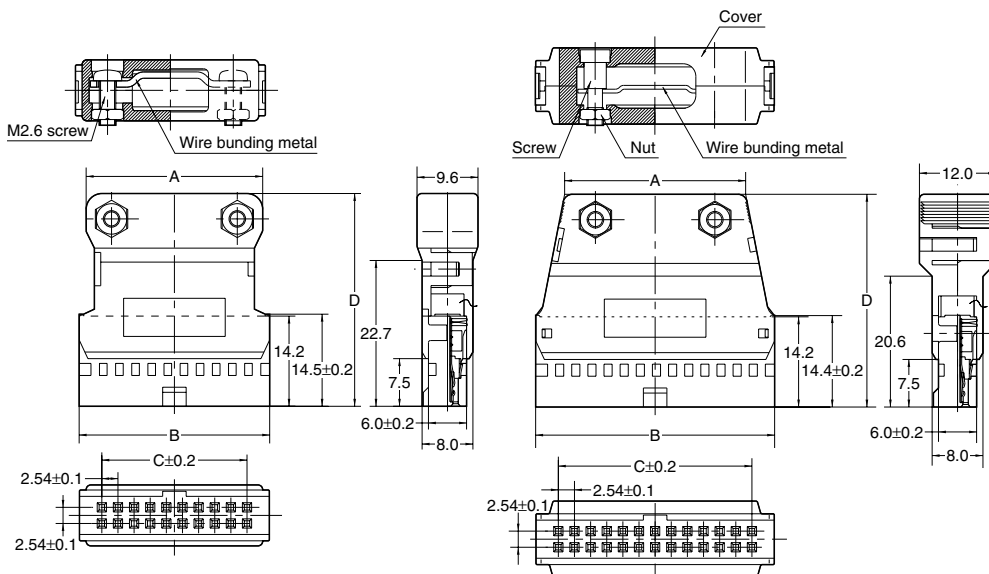

General tolerance: ± 0.3


2) When angle type hood covers are mated (26, 30, 34, 40, 50, 60 and 64 contacts)

CAD Data



Dimension table (mm)

No. of contacts	A	B	C	D
26	40.5	37.5	30.48	41.5
30	45.6	42.6	35.56	41.5
34	50.7	47.7	40.64	41.5
40	62.5	55.3	48.26	52.5
50	75.2	68.0	60.96	52.5
60	87.9	80.7	73.66	52.5
64	93.0	85.8	78.74	52.5

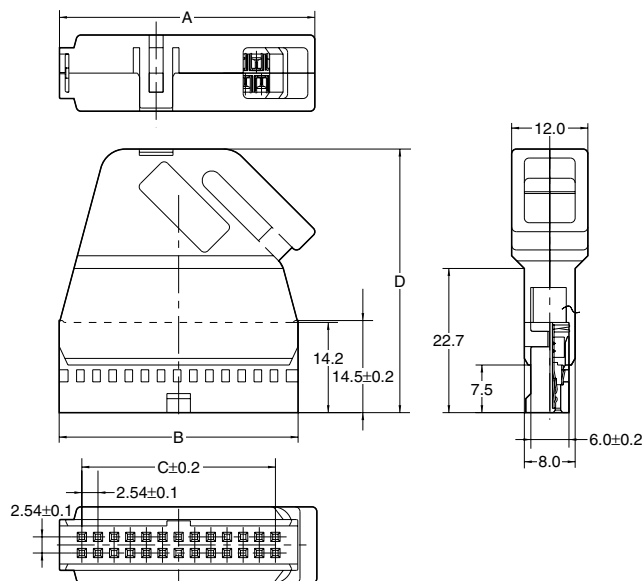

General tolerance: ± 0.3


3) When semi-covers are mated

CAD Data



Dimension table (mm)



No. of contacts	A	B
10	17.3	10.16
14	22.38	15.24
16	24.92	17.78
20	30.0	22.86
26	37.62	30.48
30	42.7	35.56
34	47.78	40.64
40	55.4	48.26
50	68.1	60.96
60	80.8	73.66
64	85.88	78.74

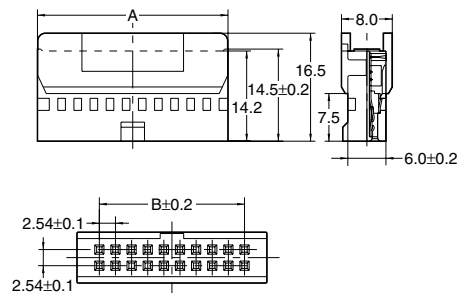

General tolerance: ± 0.3



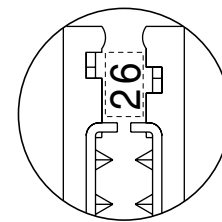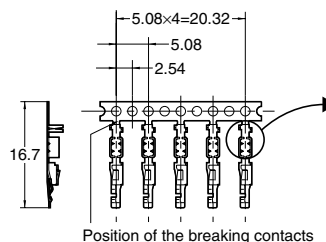4) Contacts (5 in line)

CAD Data

Note) On the contacts there are stamps "22" for AWG #22 and #24 types, and "26" for AWG #26 and #28 types.

General tolerance: ± 0.3

NOTES**1. Use wires and contact types that match.**

The contact's clamp is stamped with 22 or 26.

Use AWG#22 or #24 wire with the type 22 contact and AWG #26 or #28 wire with the type 26 contact.

An incorrect combination will cause faulty connections.

2. Use wires having a correct outer insulation diameter.

The use of a wire with an outer insulation diameter larger than the allowable value or a wire with a hard material for the insulation will cause faulty connections.

Furthermore, the use of a wire with an outer insulation diameter less than the allowable value will cause a drop in the clamp strength. Use wires with a suitable outer diameter and insulation material. Suitable wire diameters are shown in the table below.

Suitable wire diameters

Size	Insulation outer diameter	Remark
AWG#22	1.5 dia. to 1.1 dia.	AWG #22 is Stranded wire of 12 strands/0.18
AWG#24		Stranded wire
AWG#26	1.3 dia. to 1.1 dia.	Stranded wire
AWG#28		

* AWG#22 and #24 use different contacts from AWG#26 and #28. Refer to the part number chart for the part number.

3. Inserted wire length during wire pressure welding

Insert the wire to a proper length and perform the pressure welding.

If the inserted length is too short, the wire will be pressure welded only at one location.

If the inserted length is too long, the wire will end up on the lance portion and a proper pressure welding will not be obtained.

4. Cut the end of the wire so that it is straight and flat. Be sure no uneven strands remain.**5. When pressure welding a wire, fully insert it to the proper position. Be sure to squeeze the lever unit it reaches the end position of the stroke.****6. After connecting the wire, check that the wire clamp firmly clamps the wire.****7. It may not be possible to cut a contact from the carrier by folding the contact only once.****8. The contact holder should be replaced as needed.**

For other details, please verify with the product specification sheets.




PRESSURE WELDING TOOLS FOR SEPARATE WIRES

PRODUCT TYPES

Product name		Part No.	Packaging	
			Inner carton	Outer carton
Pressure welding tool	Pliers type pressure welding tool for separate wires (with feed mechanism)	AXY51000	—	1 pc.
	Stapler type pressure welding tool for separate wires	AXY52000	—	
Accessory	Contact holder	AXY5801	—	200 pcs.

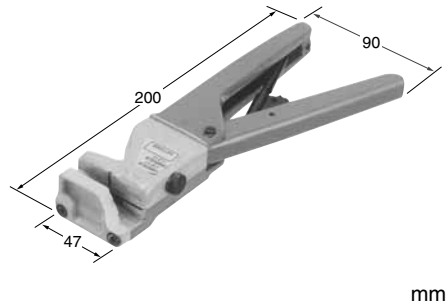• Pliers-type (with feed mechanism)



Pliers-type pressure welding tool for separate wires (with feed mechanism)
AXY51000

Compliance with RoHS Directive

FEATURES

1. Weight balanced design for lightweight handling.

2. Lever Lock Mechanism Allows Reliable Pressure Welding

The lever lock mechanism prevents the lever from returning until the predetermined stroke is reached. This allows for reliable pressure welding, preventing variation due to differences between individual workers.

3. Automatic feed mechanism indicates the pressure welding terminal number after a pressure welding.

After each pressure welding, the automatic feed is performed one pitch at a time (2.54mm). At the same time, the number of the connector terminal being pressure-welded is indicated. If the terminal number is set initially, the connector can be moved to any position with the correct terminal number always displayed since the tool is directly linked with the connector.

4. Stroke adjustment feature.

The pressure welding stroke can be adjusted to match the diameter of the cable wire for reliable connections.

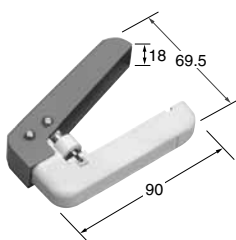
5. Enables pressure welding of both the socket with contacts and individual contacts.

A cable can be connected with the contacts positioned in the socket housing (socket housing with contacts) or with the individual contacts separated from the socket housing.

6. Contact puller feature.

The contact puller permits incorrectly connected or unnecessary contacts to be pulled out.

• Stapler type



Stapler type pressure welding tool for separate wires
AXY52000

Compliance with RoHS Directive

FEATURES

1. Compact and lightweight, it fits in a pocket.

2. Pressure-weld individual contacts.

3. Convenient for on-site maintenance work since connection is possible in small spaces.

4. Includes a contact puller.

NOTES

1. Never disassemble the tool. Also, do not subject it to shock or drop it from a high place.

For other details, please verify with the product specification sheets.