




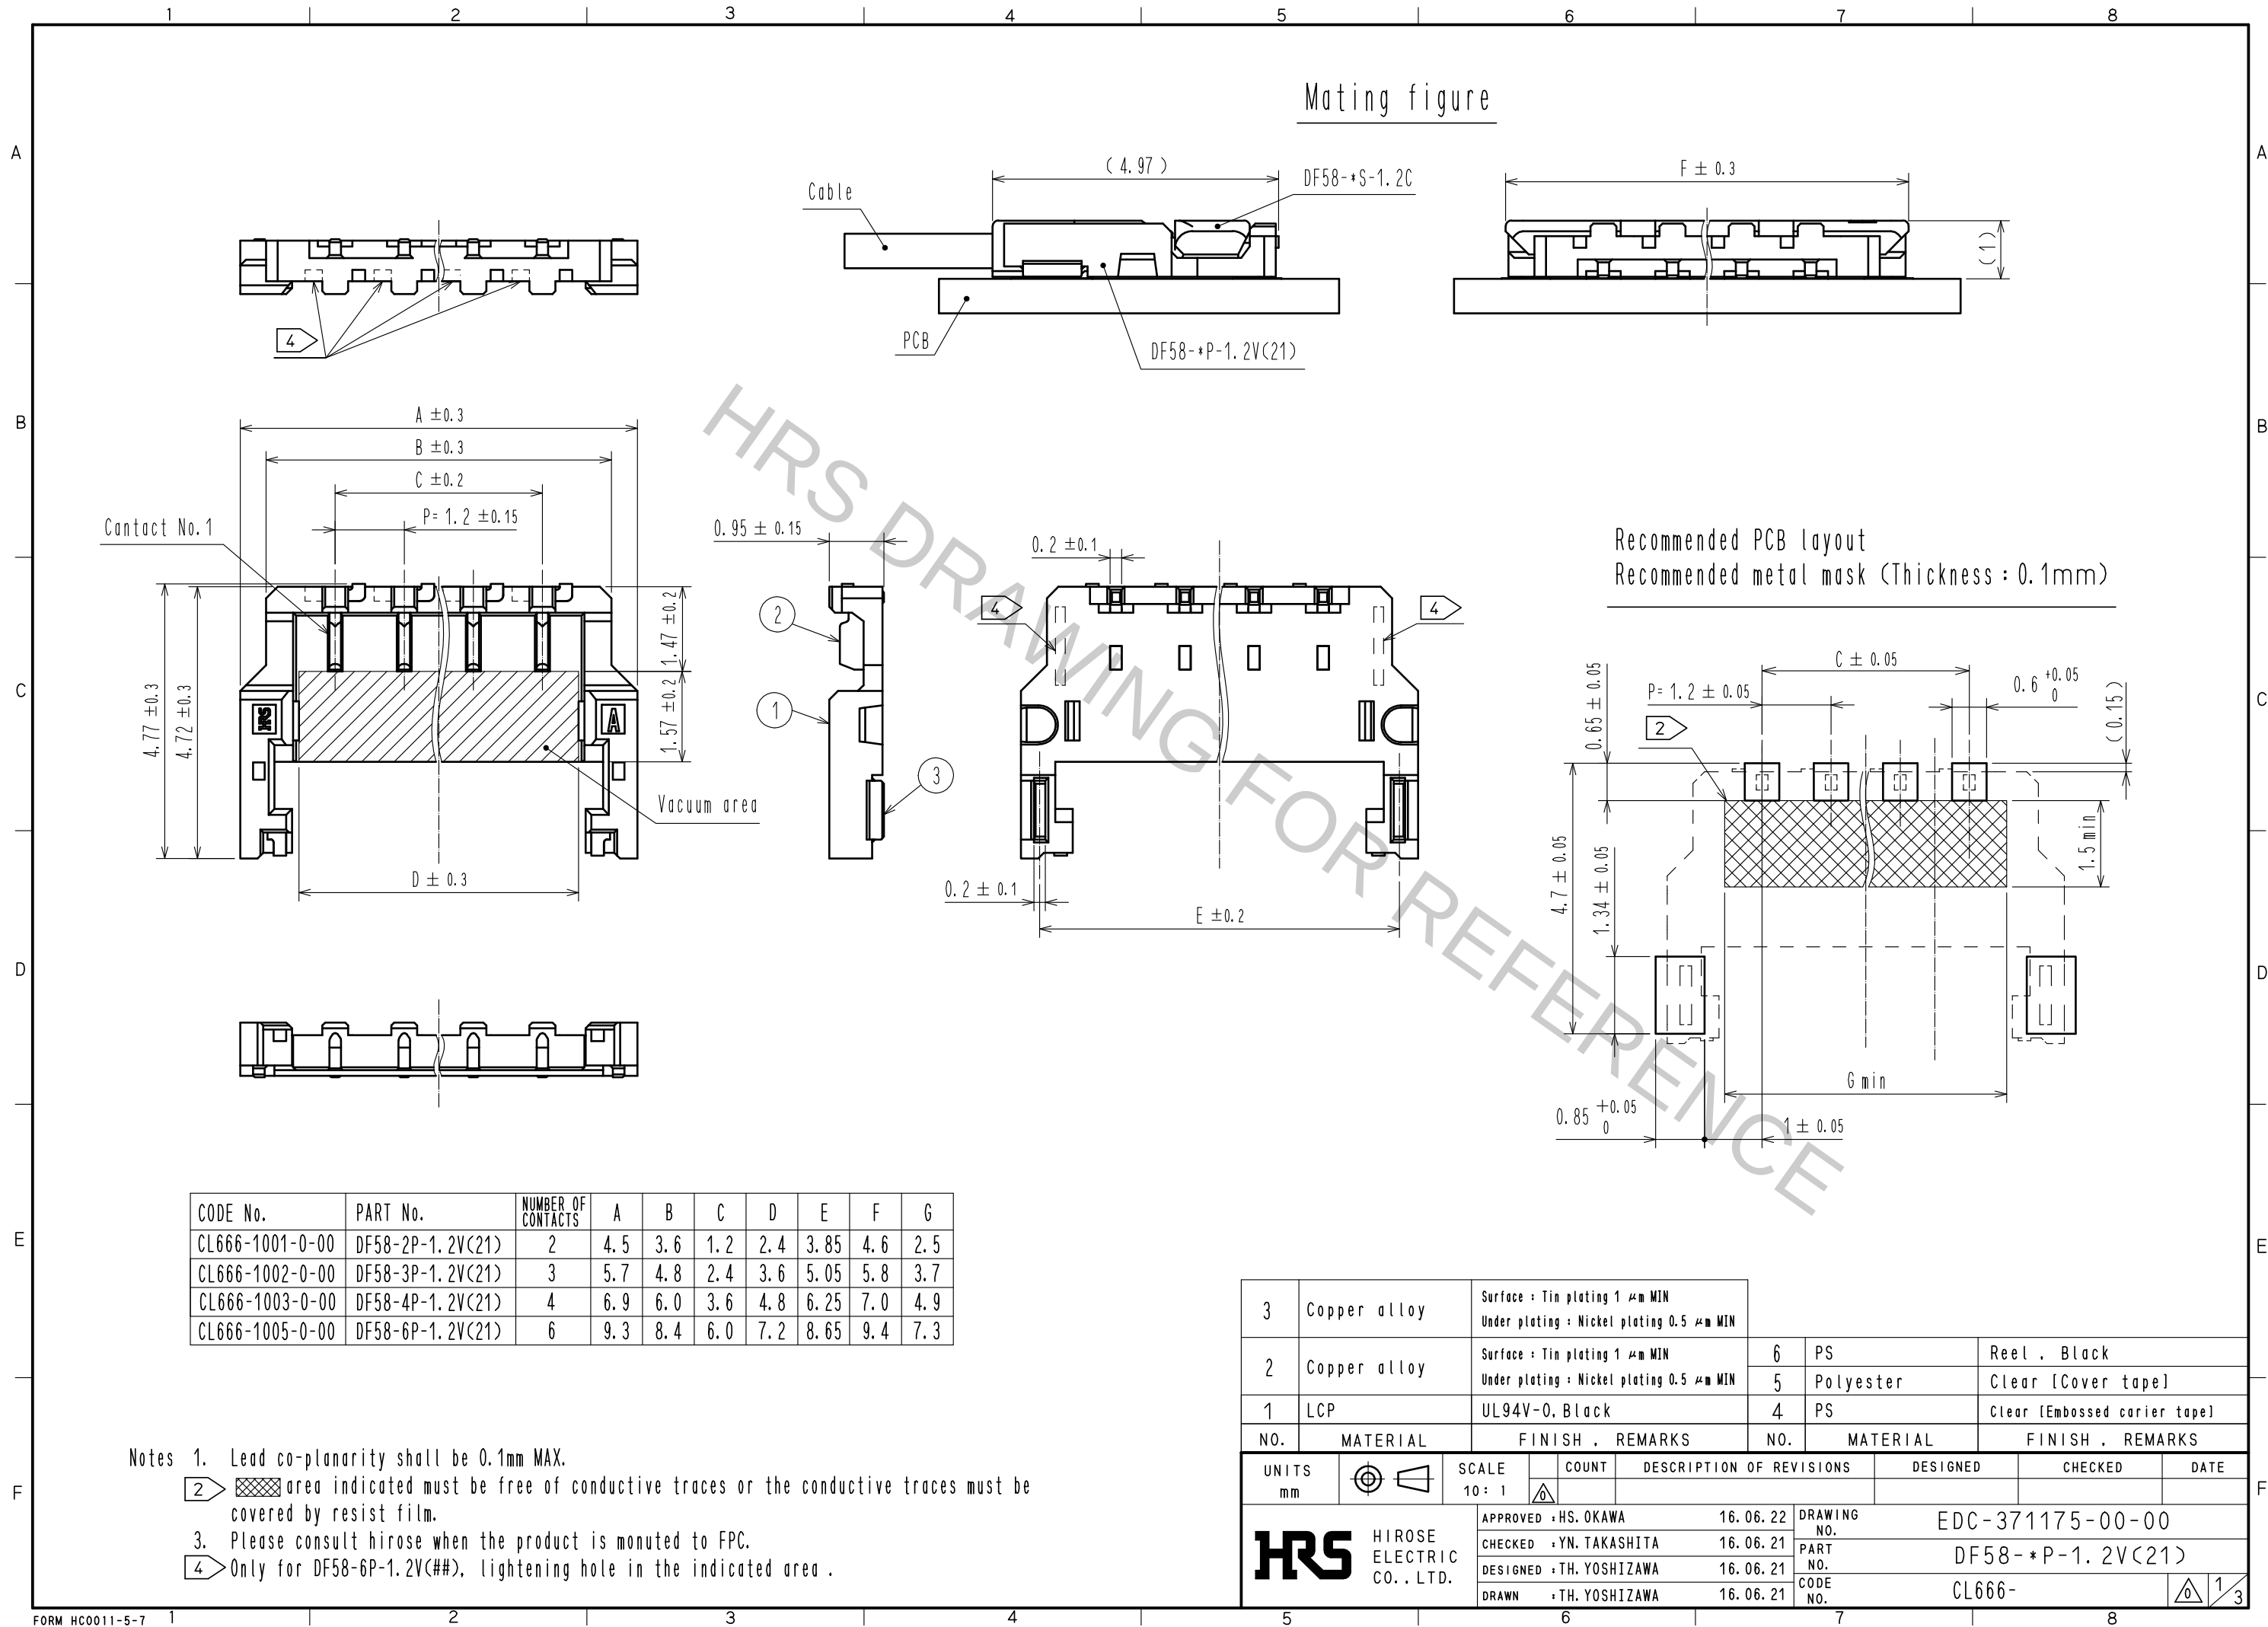

Drawing for packing (FREE)

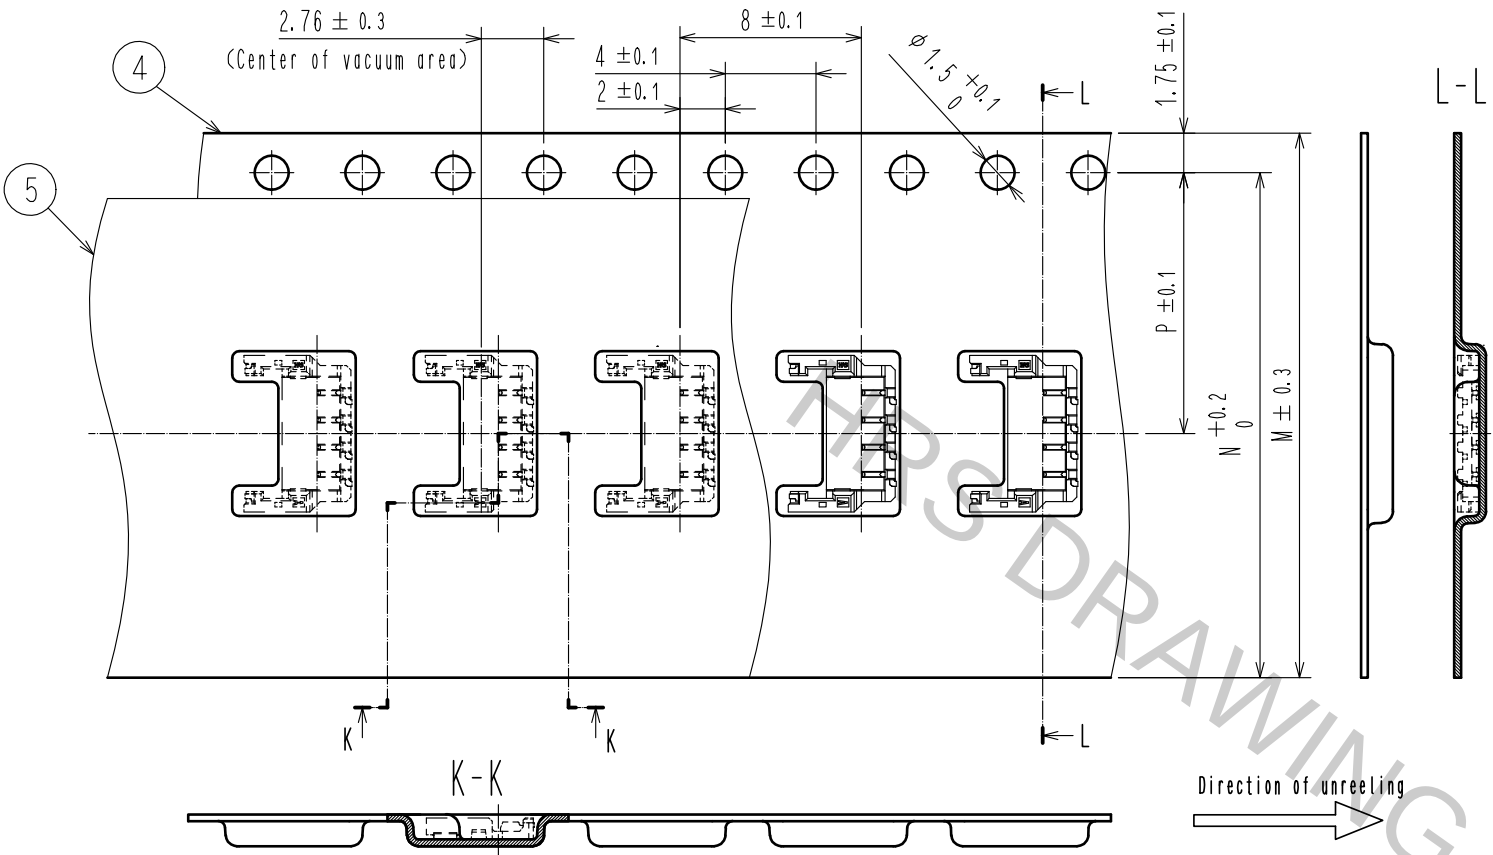


Reflow temperature profile using lead-free solder paste (Reference)

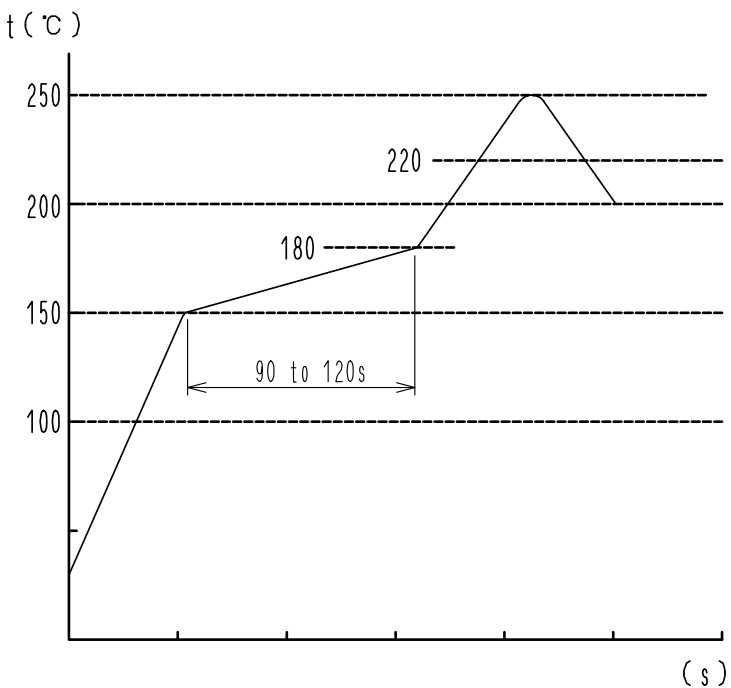

Number of reflow cycles 2 cycles max.
The temperature is measured in the terminal lead part.

Additional factors, such as solder paste type,
PCB size and other mounted components could affect
the profile, therefore, a thorough evaluation of
mounting condition is required prior to production.
Temperature is measured at contact lead.


6 TAPING (FREE)

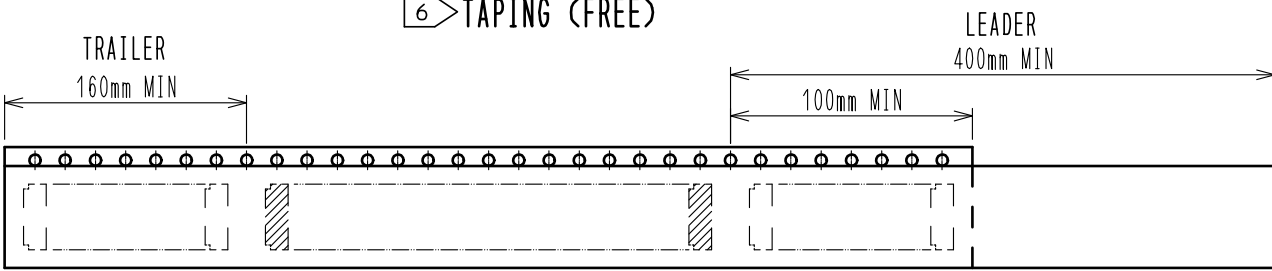

EMPTY COMPONENTS PORTION EQUIPPED WITH CONNECTORS EMPTY COMPONENTS

CODE No.	PART No.	NUMBER OF CONTACTS	M	N	P	Q	R
CL666-1001-0-00	DF58-2P-1.2V(21)	2	16.0	14.25	7.5	22.4	16.4
CL666-1002-0-00	DF58-3P-1.2V(21)	3	16.0	14.25	7.5	22.4	16.4
CL666-1003-0-00	DF58-4P-1.2V(21)	4	24.0	22.25	11.5	30.4	24.4
CL666-1005-0-00	DF58-6P-1.2V(21)	6	24.0	22.25	11.5	30.4	24.4

Style and dimension of reel (Free)

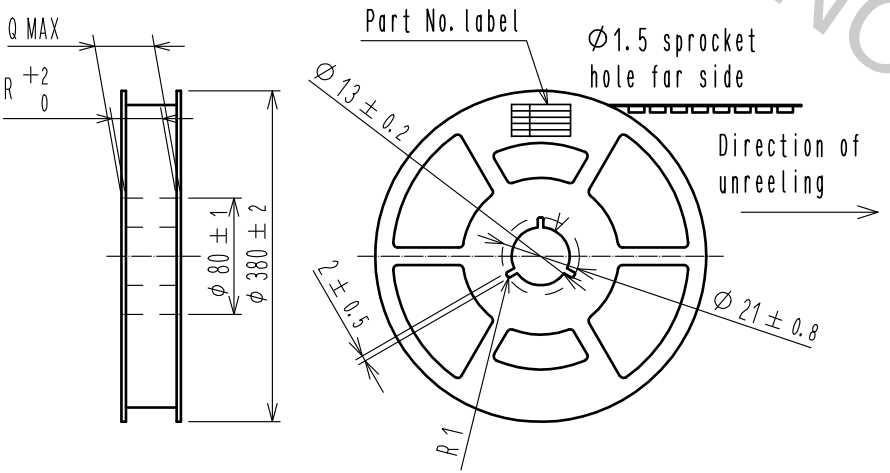

Detail of part No. label

生産月日	年 月 日
図 番	CL666-****-21
品 名	DF58-*P-1.2V(21)
納入数量	6000 KO
納入者	ヒロセ電機(株)

Supplier
Quantity
Part No.
Code No.
Date of manufactured

NOTES 5 . 1 reel : 6000 connectors
6 Reel to JIS C 0806. (Packaging of components for automatic handling)
7 . The dimensions in parentheses are for reference.


HRS	DRAWING NO.	EDC-371175-00-00
	PART NO.	DF58-*P-1.2V(21)
	CODE NO.	CL666-

Feb.1.2018 Copyright 2018 HIROSE ELECTRIC CO., LTD. All Rights Reserved.


DF58 Series Mating / Unmating Operation Instruction

Mating


① By positioning the convexity of the socket sides to the header concavity, align the centers of the socket and the header in pitch direction.

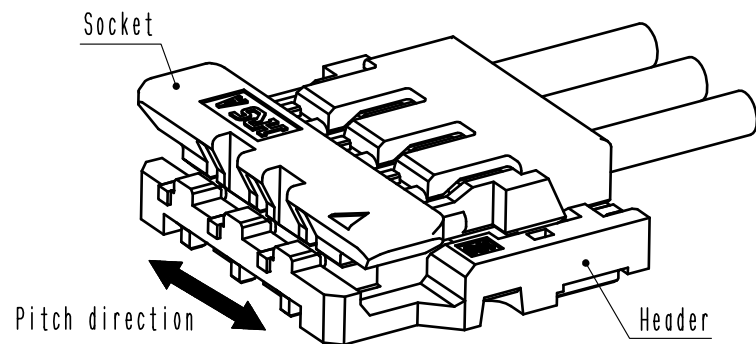

② Slightly press the socket down at the center of the socket.

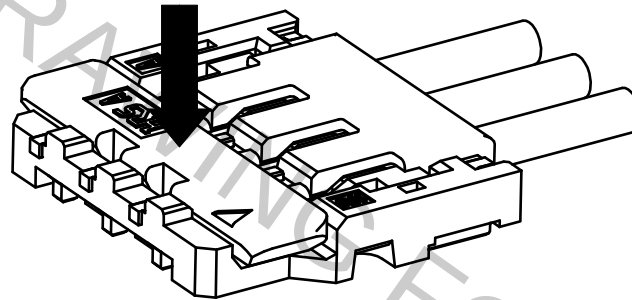


③ Press down at the lever side with stabilizing the cable side to insert. Mating completes.

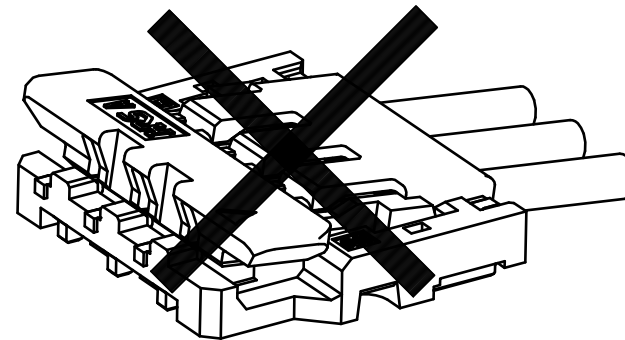


Unmating

① Hook the lever with finger nail. (Possible with one side)

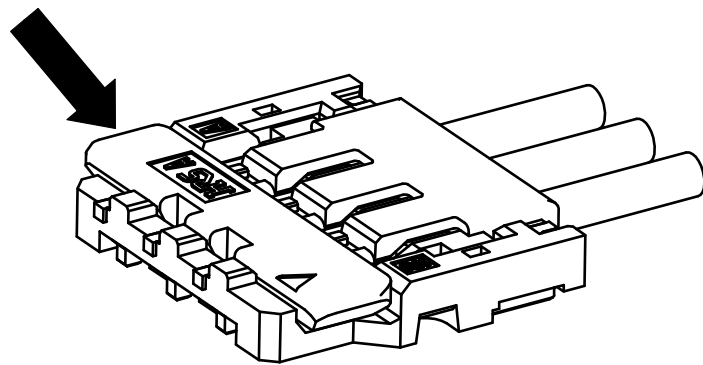

② Lift up to the upper direction and friction lock is released.

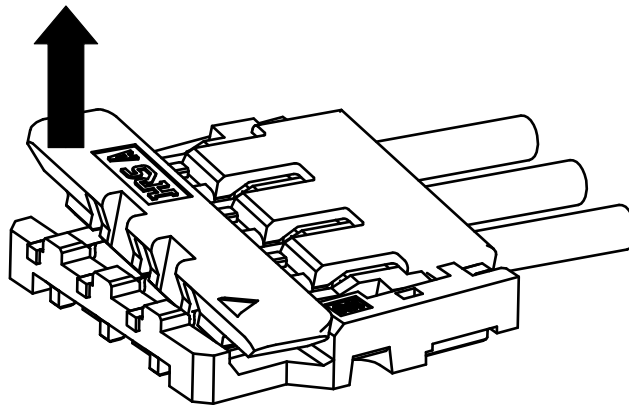

③ Lift it up to the upper direction more, and removal completes.

