

This 2.71" \times 1.45" \times 1.45" gearmotor is a powerful 12V brushed DC motor with a **131.25:1** metal gearbox and an integrated quadrature encoder that provides a resolution of 64 counts per revolution of the motor shaft, which corresponds to **8400 counts per revolution** of the gearbox's output shaft. These units have a 0.61"-long, 6 mm-diameter D-shaped output shaft. This gearmotor is also available [without an encoder](#).

Key specs at **12 V**: 80 RPM and 300 mA free-run, 250 oz-in (18 kg-cm) and 5 A stall.

Gearmotor Dimensions

The face plate has six mounting holes evenly spaced around the outer edge threaded for M3 screws. These mounting holes form a regular hexagon and the centers of neighboring holes are 15.5 mm apart. You can use our custom [37D mm metal gearmotor bracket](#) (shown in the left picture below) to mount the gearmotor to your project via these mounting holes and the screws that come with the bracket.




Gearmotor with bracket and hub.

37D mm metal gearmotor with 64 CPR encoder and Pololu 90x10mm wheel.


Please note that unlike our smaller metal gearmotors, these 37D mm gearmotors have output shafts with a diameter of 6 mm. The [Pololu universal aluminum mounting hub for 6mm shafts](#) can be used to mount our larger [Pololu wheels](#) (80mm- and 90mm-diameter) or custom wheels and mechanisms to the gearmotor's output shaft (see the right picture above).

The diagram below shows the dimensions (in mm) of the 37D mm line of gearmotors. The value of x is **22 mm** for the [19:1 37Dx52L mm](#) and [29:1 37Dx52L mm](#) versions, **24 mm** for the [50:1 37Dx54L mm](#) and [67:1 37Dx54L mm](#) versions, and **26.5 mm** for the [100:1 37Dx57L mm](#) and [131:1 37Dx57L mm](#) versions. Note that the encoder PCB and magnetic disc are not shown in this dimension diagram. The encoder assembly extends an additional 12.5 mm beyond the rear of the motor.

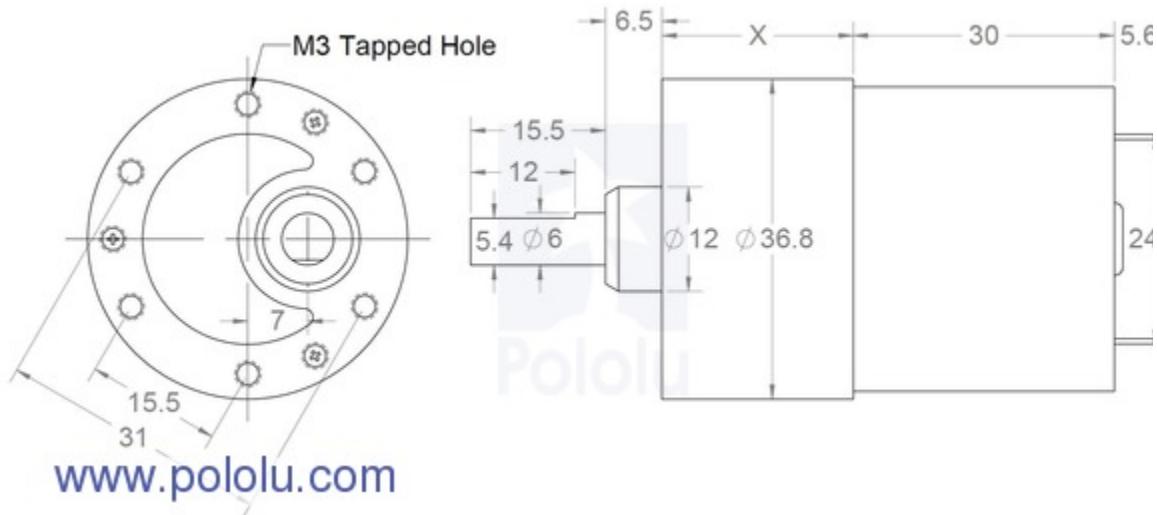

37D mm metal gearmotor dimensions (units in mm).

Warning: Do not screw too far into the mounting holes as the screws can hit the gears. We recommend screwing no further than 3mm (1/8") into the screw hole.

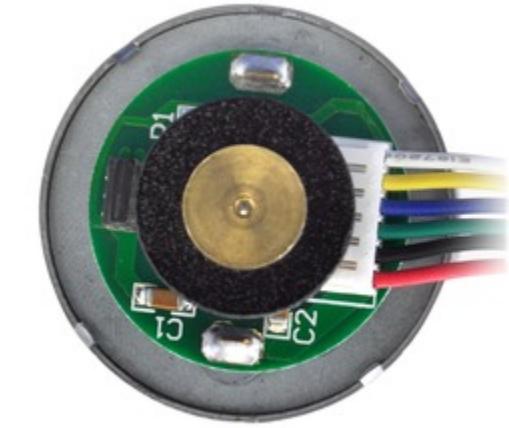

**37D mm metal gearmotor with
64 CPR encoder.**

Using the Encoder

A two-channel Hall effect encoder is used to sense the rotation of a magnetic disk on a rear protrusion of the motor shaft. The quadrature encoder provides a resolution of 64 counts per revolution of the motor shaft. To compute the counts per revolution of the gearbox output, multiply the gear ratio by 64. The motor/encoder has six color-coded, 11" (28 cm) leads:

Color	Function
Black	motor power
Red	motor power
Blue	Hall sensor Vcc (3.5 – 20 V)
Green	Hall sensor GND
Yellow	Hall sensor A output
White	Hall sensor B output

The Hall sensor requires an input voltage, Vcc, between 3.5 and 20 V and draws a maximum of 10 mA. The A and B outputs are square waves from 0 V to Vcc approximately 90° out of phase. The frequency of the transitions tells you the speed of the motor, and the order of the transitions tells you the direction. The following oscilloscope capture shows the A and B (yellow and white) encoder outputs using a motor voltage of 12 V and a Hall sensor Vcc of 5 V:



Encoder A and B outputs for 37D mm metal gearmotor with 64 CPR encoder
(motor running at 12 V).

By counting both the rising and falling edges of both the A and B outputs, it is possible to get 64 counts per revolution of the motor shaft. Using just a single edge of one channel

results in 16 counts per revolution of the motor shaft, so the frequency of the A output in the above oscilloscope capture is 16 times the motor rotation frequency.

As of July, 2012, we are shipping these gearmotors with leads terminated by a 1×6 0.1" female header, as shown in the main product picture. If this header is not convenient for your application, you can pull the crimped wires out of the header or cut the header off. Previously, these gearmotors shipped with