


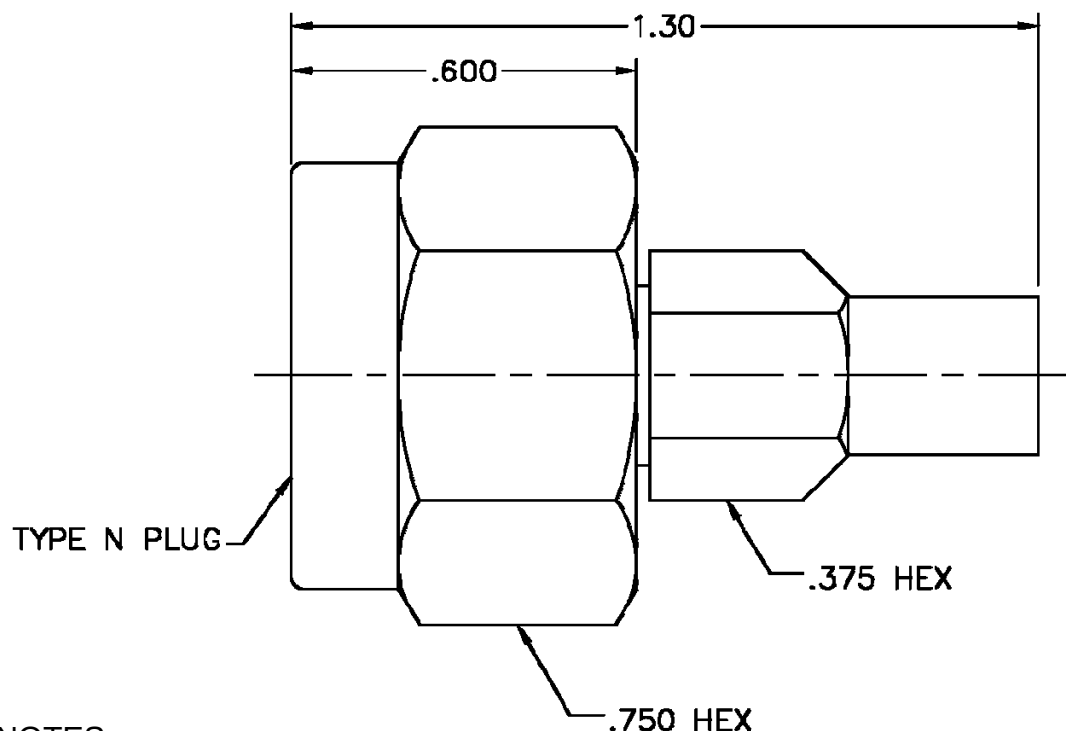

NOTES:

1.0 Materials

1.1 Body, Coupling, and Clamp Nuts: Steel. Corrosion Resistant per ASTM-A582.
UNS No. S30300.

1.2 Center Conductor: Beryllium Copper per ASTM-B196. UNS C17300.

1.3 Solder Ferrule: Brass per ASTM-B16. UNS C36000.

1.4 Lock Ring: Beryllium Copper per ASTM-B197. UNS C17200.

1.5 Gasket: Silicone Rubber per A-A-59588.

1.6 Insulator: PTFE Fluorocarbon per ASTM-D1710.

1.7 Cable Stop: Teflon.

2.0 Finishes

2.1 Center Contact and Solder Ferrule: Gold Plate per ASTM-B488 50 Microinches Min. thickness
over Electrolytic Nickel Plate per ASTM-B689 50 Microinches Min. thickness.

2.2 Body, Coupling, and Clamp Nuts: Passivated per SAE-AMS-2700.


2.3 Gasket, Lock Ring, and Dielectrics: None.

3.0 Interface: Type N plug per Crystek interface specification CC-PNP-TL.






Type N Plug to LL-142 Cable

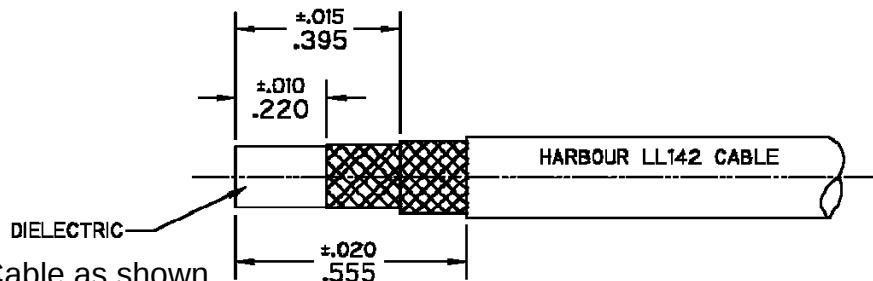


Step 1

1.1 Trim Cable as shown.

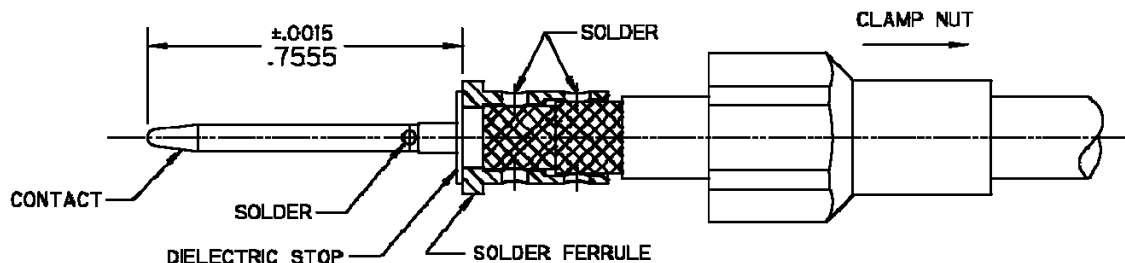

Step 2

- 2.1 Slide clamp nut over cable as shown.
- 2.2 Insert cable into solder ferrule as shown then solder braids to ferrule where indicated.
- 2.3 Trim exposed cable dielectric flush with solder ferrule face.
- 2.4 Slide dielectric stop over cable center conductor and solder contact flush against stop to dimension shown.

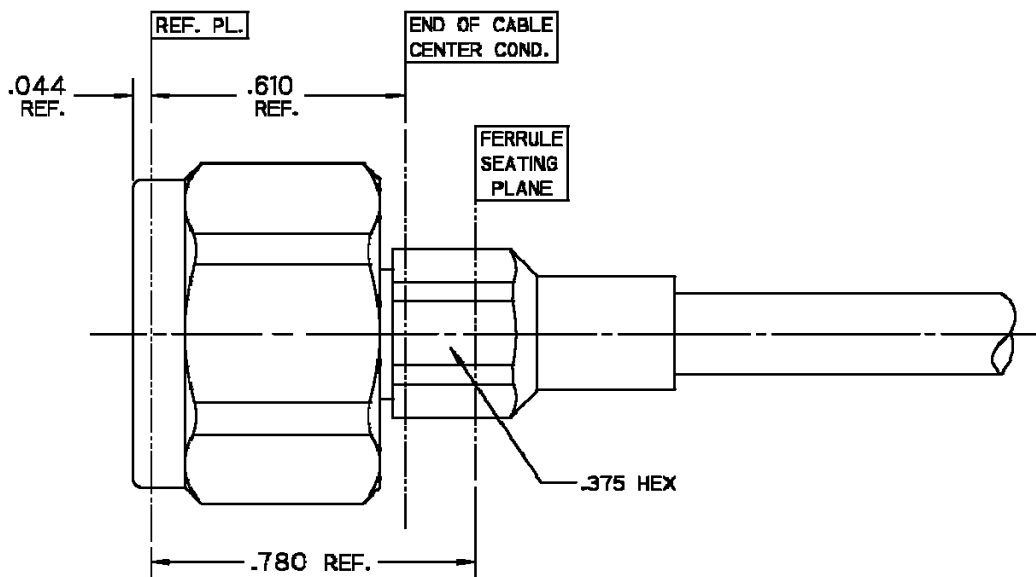

Step 3

- 3.1 Insert cable/contact sub-assembly into connector until seated
- 3.2 Tighten connector coupling nut to mating type N jack.
- 3.3 Tighten rear clamp nut to 30-40 in-lbs and disengage main interface from jack.

Product Control:

Crystek Part Number:	CS-NM-MHA	Release Date:	04-Jan-11
Revision Level:	A	Responsible:	K. Piotrowicz

Page 2 of 2

