LASER SENSORS

MICRO PHOTOELECTRIC SENSORS

AREA SENSORS

SAFETY LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS INDUCTIVE PROXIMITY

SENSORS PARTICULAR USE SENSORS

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASUREMENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES

FNFRGY MANAGEMENT SOLUTIONS

FA COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Selection Guide Amplifier Built-in Power Supply Built-in Amplifierseparated

EX-Z CX-400 CY-100 EX-10 EX-20 EX-30

EX-40 CX-440 **EQ-30** EQ-500

MQ-W **RX-LS200**


RT-610

Robust Photoelectric Sensor Amplifier Built-in

■ General terms and conditions...... F-3 Related Information

■ Glossary of terms......P.1549~

■ Selection guideP.231~ ■ General precautions......P.1552~

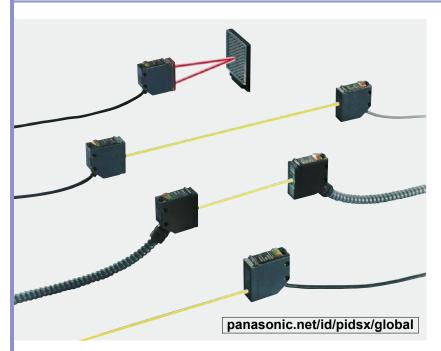









Sturdy photoelectric sensor made of die-cast zinc alloy

Robust


The enclosure is robust as it is made of die-cast zinc alloy.

VARIETIES

Standard type



Wide variety Thru-beam type

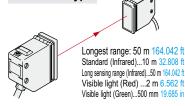

Diffuse reflective type Sensing object Longest range: 700 mm 27.559 in Long sensing range (Infrared)...700 mm 27.559 in Visible light (Red)...200 mm 7.874 in

Retroreflective type Longest range: 5 m 16.404 ft For specular object sensing (with polarizing filters, red) ... 0.1 to 3 m 0.328 to 9.843 ft For transparent object sensing (with polarizing filters, red) ... 500 mm 19.685 ir Long sensing range(Infrared) ... 0.1 to 5 m 0.328 to 16.404 ft

DC 2-wire type

Heavy duty type

Wiring reduced by 1/3

Wiring can be completed by using only two, instead of three wires.

Power supply cost: reduced to 1/30 or less

Current consumption: 1 mA or less

An additional power supply for the sensors is not required.

MAINTENANCE

Test input (emission halt input)

Convenient for operation check before start-up. (Excluding RX2 types)

Durable against oil

This sensor can be used in a harsh environment.




FUNCTIONS

Automatic interference prevention function Retroreflective / diffuse reflective types

function. (Excluding RX2 types)


is incident.


Two sensors can be mounted side by side because of the automatic There is no problem interference prevention even if the beam of the

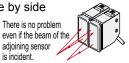

APPLICATIONS

Detecting passage of engines RX-PRVM3

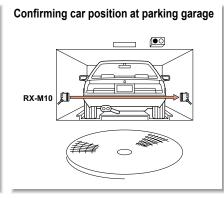


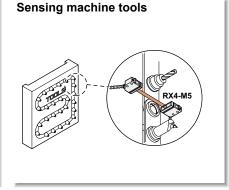

ORDER GUIDE

		Туре	Appearance	Sensing range	Model No. (Note 2)	Output
		Infrared		10 m 32.808 ft	RX-M10	
	Thru-beam	Long sensing range		50 m 164.042 ft	RX-M50	
		Sensing Green		2 m 6.562 ft		
type)		Green		500 mm 19.685 in	RX-500G	
RX (Standard type)	Retroreflective	Red (with polarizing filters)		0.1 to 3 m 0.328 to 9.843 ft (Note 1)	RX-PRVM3	NPN open-collector transistor
RX (8		Infrared (long sensing range)		0.1 to 5 m 0.328 to 16.404 ft (Note 1)	RX-RVM5	
	Diffuse reflective	Infrared	0 0	700 mm 27.559 in	RX-D700	
	Diffuse r	Red		200 mm 7.874 in RX-D20		
e)	Thru-beam	Infrared		5 m 16.404 ft	RX2-M5	
RX2 (DC 2-wire type)	Retroreflective	Red (with polarizing filters)		0.1 to 2 m 0.328 to 6.562 ft (Note 1)	RX2-PRVM2	Non contact DC 2-wire type
RX	Diffuse reflective	Infrared	0	300 mm 11.811 in	RX2-D300	
(type)		2 m 6.562 ft cable length			RX4-M5	NPN
RX4 (Heavy duty type)		3 m 9.843 ft cable length	3 m 9.843 ft cable length	5 m 16.404 ft	RX4-M5-C3	open-collector transistor
Неах	를 5 m 16.404 cable lengt		*		RX4-M5-C5	

Notes: 1) The sensing range of the retroreflective type sensor is specified for the **RF-230** reflector. Further, the sensing range of **RX-PRVM3**, **RX-RVM5** and **RX2-PRVM2** is the possible setting range for the reflector. The sensor can detect an object less than 0.1 m 0.328 ft away.

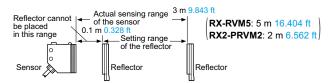

2) The model No. with "P" shown on the label affixed to the thru-beam type sensor is the emitter, "D" shown on the label is the receiver.

FIBER

LASER SENSORS

PHOTO-ELECTRIC SENSORS MICRO PHOTO-ELECTRIC

AREA SENSORS

SAFETY LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

IMPLE

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES ENERGY

FA COMPONENTS

MACHINE VISION SYSTEMS

> / JRING /STEMS

Selection Guide Amplifier Built-in

ower Supply built-in Amplifiereparated

EX-Z CX-400 CY-100

CY-100 EX-10 EX-20

EX-40

CX-440

EQ-30

EQ-500 MQ-W

RX-LS200

LASER SENSORS

ELECTR SENSOR MICF PHOT ELECTR SENSOR

AREA SENSORS

SAFETY LIGHT
CURTAINS /
SAFETY
COMPONENTS

PRESSURE /
FLOW
SENSORS

INDUCTIVE
PROXIMITY
SENSORS

PARTICULAR USE SENSORS SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

MEASURE-MENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES

SOLUTIONS

FA
COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Selection Guide Amplifier Built-in Power Supply Built-in Amplifierseparated

EX-Z CX-400 CY-100 EX-10 EX-20 EX-30 EX-40 CX-440

MQ-W RX-LS200

EQ-30

RT-610

ORDER GUIDE

5 m 16.404 ft cable length type

5m 16.404 ft cable length type (standard: 2m 6.562 ft) is also available for **RX** and **RX2** types. (excluding **RX-500G**) When ordering this type, suffix "-C5" to the model No. (e.g.) 5 m 16.404 ft cable length type of **RX-M10** is "**RX-M10-C5**".

Accessories

- MS-RX-1 (Sensor mounting bracket)
- MS-RX-2 (Sensor mounting bracket)
- PT-RX4-1 (Oil resistant protective tube 1 m 3.281 ft long)
- PT-RX4-2 (Oil resistant protective tube 2 m 6.562 ft long)
- PT-RX4-4 (Oil resistant protective tube 4 m 13.123 ft long)
- RF-230 (Reflector)

• MS-RX-1



Two M4 (length 16 mm 0.630 in) hexagon-socket-head bolts are attached

• MS-RX-2



Two M4 (length 16 mm 0.630 in) hexagon-socket-head bolts are attached

• PT-RX4-□



• RF-230



OPTIONS

Designation	Model No.	Description				
	OS-RX-05×5 (Slit size 0.5 × 5 mm 0.020 × 0.197 in) OS-RX-5×05 (Slit size 5 × 0.5 mm 0.197 × 0.020 in)	• Sensing range: 2.7 m 8.858 ft [RX-M10] Slit on emitter • Sensing range: 2.7 m 8.858 ft [RX-M10] 1.4 m 4.593 ft [RX2-M5] • Min. sensing object: ø8 mm ø0.315 in				
		• Sensing range: 1.9 m 6.234 ft [RX-M10] 1 m 3.281 ft [RX2-M5] • Min. sensing object: ø6 mm ø0.236 in				
		• Sensing range: 0.4 m 1.312 ft [RX-M10] 0.2 m 0.656 ft [RX2-M5] • Min. sensing object: 0.5 × 5 mm 0.020 × 0.197 in				
Slit mask	OS-RX-1×5 (Slit size 1 × 5 mm 0.039 × 0.197 in) OS-RX-5×1 (Slit size 5 × 1 mm 0.197 × 0.039 in)	• Sensing range: 3.8 m 12.467 ft [RX-M10] Slit on emitter 1.9 m 6.234 ft [RX2-M5] • Min. sensing object: ø8 mm ø0.315 in				
For RX-M10 and RX2-M5 only		• Sensing range: 2.8 m 9.186 ft [RX-M10] Slit on receiver 1.4 m 4.593 ft [RX2-M5] • Min. sensing object: ø6 mm ø0.236 in				
		• Sensing range: 0.8 m 2.625 ft [RX-M10] 0.4 m 1.312 ft [RX2-M5] • Min. sensing object: 1 × 5 mm 0.039 × 0.197 in				
	OS-RX-3×5 (Slit size 3 × 5 mm 0.118 × 0.197 in) OS-RX-5×3 (Slit size 5 × 3 mm 0.197 × 0.118 in)	• Sensing range: 7 m 22.966 ft [RX-M10] Slit on emitter 3.5 m 11.483 ft [RX2-M5] • Min. sensing object: ø8 mm ø0.315 in				
		• Sensing range: 4.9 m 16.076 ft [RX-M10] 2.5 m 8.202 ft [RX2-M5] • Min. sensing object: ø6 mm ø0.236 in				
		• Sensing range: 2.6 m 8.530 ft [RX-M10] 1.3 m 4.265 ft [RX2-M5] • Min. sensing object: 3 × 5 mm 0.118 × 0.197 in				
Reflector / For	RF-210	Sensing range: 0.2 to 1.5 m 0.656 to 4.921 ft [RX-RVM5] 0.4 to 1 m 1.312 to 3.281 ft [RX-PRVM3] Min. sensing object: ø30 mm ø1.181 in				
retroreflective type sensor only (Note 1)	RF-220	Sensing range: 0.1 to 3.8 m 0.328 to 12.467 ft [RX-RVM5] 0.1 to 2 m 0.328 to 6.562 ft [RX-PRVM3] 0.1 to 1.3 m 0.328 to 4.265 ft [RX2-PRVM2] Min. sensing object: ø35 mm ø1.378 in				
Reflector mounting	MS-RF21-1	Protective mounting bracket for RF-210 It protects the reflector from damage and maintains alignment.				
bracket	MS-RF22	For RF-220				
(Note 1)	MS-RF23	For RF-230				
Reflective tape (For RX-RVM5) only	RF-T110	This tape can be used in place of the reflector by cutting it to a suitable size. • Size: 100 × 100 mm 3.937 × 3.937 in • Sensing range: 3 m 9.843 ft (at 50 × 50 mm 1.969 × 1.969 in) (There may be a slight variation depending on the product.)				
Protective tube	PT-RX500	500 mm 19.685 in It does not rust as it is made of stainless steel.				
1 TOLECTIVE TUDE	PT-RX1000	1,000 mm 39.370 in stainless steel.				
Sensor checker (Note 2)	CHX-SC2	It is useful for beam alignment of thru-beam type sensors. The optimum receiver position is given by indicators, as well as an audio signal.				

Notes: 1) Refer to **CX-400** series pages (p.269 and p.272) for dimensions of the reflector or the reflector mounting bracket.

2) Refer to p.959~ for the sensor checker.

Slit mask

OS-RX-□
Fitted on the front face of the sensor with one-touch.
*Slit size
OS-RX-1×5
ã Ď Slit mask

Reflector



Reflector mounting bracket

• MS-RF21-1



• MS-RF22




Two M3 (length 8 mm 0.315 in) screws with washers are attached.

• MS-RF23

Two M4 (length 10 mm 0.394 in) screws with washers are attached.


Protective tube

• PT-RX500 • PT-RX1000

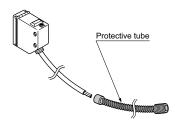

Sensor checker

• CHX-SC2

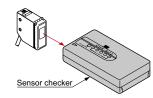

FIBER SENSORS

LASER SENSORS

> ELECTRIC SENSORS MICRO PHOTO-ELECTRIC

AREA SENSORS

SAFETY LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS SIMPLE

UNITS UNITS

SYSTEMS

MEASURE-MENT SENSORS STATIC CONTROL DEVICES

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES ENERGY MANAGEMENT SOLUTIONS

FA COMPONENTS

MACHINE VISION SYSTEMS

V URING YSTEMS

Selection Guide Amplifier Built-in Power Supply Built-in

separated EX-Z

CX-400 CY-100 EX-10

EX-20 EX-30

EX-40

CX-440 EQ-30

EQ-500 MQ-W

RX-LS200 RX

LASER SENSORS

AREA SENSORS

COMPONENTS PRESSURE / FLOW SENSORS INDUCTIVE PROXIMITY SENSORS

SENSOR OPTIONS SIMPLE WIRE-SAVING UNITS

PARTICULAR USE SENSORS

MEASURE-MENT SENSORS STATIC CONTROL DEVICES

LASER MARKERS PLC

HUMAN MACHINE INTERFACES

FA COMPONENTS

MACHINE VISION SYSTEMS

CURING SYSTEMS

Power Supply Built-in

EX-Z CX-400 CY-100 EX-10 FX-20 EX-30 EX-40 CX-440 EQ-30

> RX-LS200 RT-610

EQ-500

MQ-W


SPECIFICATIONS

Standard type

1		Thru-beam			Retroreflective		Diffuse reflective		
/	Туре	Infrared		Red	Green	Red / with polar-\	Infrared	Infrared	Red
			Long sensing range			(izing filters)	(Long sensing range)		
Iten	n Model No.	RX-M10	RX-M50	RX-M2R	RX-500G	RX-PRVM3	RX-RVM5	RX-D700	RX-D200F
CE r	marking directive compliance		1		EMC Directive,	RoHS Directive	1	1	ı
Sen	sing range	10 m 32.808 ft	50 m 164.042 ft	2 m 6.562 ft	500 mm 19.685 in	0.1 to 3 m 0.328 to 9.843 ft (Note 2)	0.1 to 5 m 0.328 to 16.404 ft (Note 2)	700 mm 27.559 in (Note 3)	200 mm 7.874 in (Note 3
Sen	sing object	ø10 mm 0.394 in or more opaque object (Note 4)			ø50 mm ø1.969 in or more opaque, translucent or specular object (Note 2, 5)	ø50 mm ø1.969 in or more opaque, or translucent object (Note 2, 5)	Opaque, tran transparent o	slucent or bject (Note 5)	
Hyst	teresis							15 % or less of opera	tion distance (Note 3
	eatability pendicular to sensing axis)	0.5 mm 0.020 in or less			1 mm 0.039 in or less 0.5 mm 0.020 in or less				
Sup	ply voltage			12 to 2	24 V DC ±10 %	Ripple P-P 10 % or less			
Curr	rent consumption	Emitter: 20 mA o	r less (RX-M50 : 25	mA or less), Rece	eiver: 25 mA or less		40 mA	or less	
Sen	sing output	NPN open-collector transistor							
	Utilization category				DC-12 (or DC-13			
	Output operation	Switchable either Light-ON or Dark-ON							
	Short-circuit protection	Incorporated							
Self-diagnosis output		NPN open-collector transistor							
	Output operation	ON under unstable sensing condition							
	Short-circuit protection								
	ponse time	1 ms or less							
	input (emission halt) function eration indicator	Incorporated Pod LED (lights up when the consists outsut is ON)							
	pility indicator	Red LED (lights up when the sensing output is ON) Green LED (lights up under stable light received condition or stable dark condition)							
	tting indicator	Red LED (lights up during beam emission)							
	sitivity adjuster					⊥ ⁄ariable adjuster			
Auton	matic interference prevention function	Incorporated (Two units of sensors can be mounted close together							
d)	Pollution degree	3 (Industrial environment)							
stance	Protection	IP67 (IEC)							
	Ambient temperature	-25 to +60 °C −13 to +140 °F (No dew condensation or icing allowed), Storage: -30 to +70 °C −22 to +158 °F							
<u>e</u>	Ambient humidity	35 to 85 % RH, Storage: 35 to 85 % RH							
Environmental res	Ambient illuminance	Incandescent light: 3,500 tx or less at the light-receiving face							
E	Voltage withstandability	1,000 V AC for one min. between all supply terminals connected together and enclosure							
viro	Insulation resistance	20 MΩ, or more, with 250 V DC megger between all supply terminals connected together and enclosure							
ш	Vibration resistance Shock resistance	10 to 500 Hz frequency, 1.5 mm 0.059 in double amplitude (10 G max.) in X, Y and Z directions for two hours each 500 m/s² acceleration (50 G approx.) in X, Y and Z directions three times each							
Fmit	tting element (modulated)	Infrare	ed LED	Red LED	Green LED	Red LED	1	ed LED	Red LED
Peak emission wavelength		†	0.035 mil	660 nm 0.026 mil	570 nm 0.022 mil	680 nm 0.027 mil		0.035 mil	680 nm 0.027 mi
Material Material					cover: Polyethers				
Cable		Emitter: 0.15 mm² 3-core oil, heat and cold resistant cabtyre cable, 2 m 6.562 ft long Receiver: 0.15 mm² 4-core oil, heat and cold resistant cabtyre cable, 2 m 6.562 ft long 2 m 6.562 ft long							
	le extension	Extension up	to total 100 m	328.084 ft is pos	ssible with 0.3 mr	m², or more, cab	le (thru-beam typ	e: both emitter	and receiver).
Cab	weight	Emitter: 70 g approx. (RX-M50 : 75 g approx.) Receiver: 70 g approx. (RX-M50 : 75 g approx.)			75 g approx.				
	weight	Keceiv	er: 70 g approx.	(RX-M50 : 75 g	approx.)				

Notes: 1) Where measurement conditions have not been specified precisely, the conditions used were an ambient temperature of +23 °C +73.4 °F.

2) The sensing range and the sensing object for the retroreflective type sensor are specified for the RF-230 reflector. Further, the sensing range of RX-PRVM3 and RX-RVM5 is the possible setting range for the reflector. The sensor can detect an object less than 0.1 m 0.328 ft away.

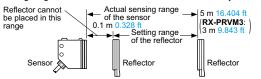

- 3) The sensing range and the hysteresis of the diffuse reflective type sensor are specified for white non-glossy paper (200 × 200 mm 7.874 × 7.874 in) as the object.
- 4) If slit masks (optional) are fitted on **RX-M10**, an object of 0.5 × 5 mm 0.020 × 0.197 in can be detected.
- 5) Make sure to confirm detection with an actual sensor before use.


SPECIFICATIONS

DC 2-wire type

		Туре	Thru-beam	Retroreflective (with polarizing filters)	Diffuse reflective			
Item	1	Model No.	RX2-M5	RX2-PRVM2	RX2-D300			
Sens	sing range		5 m 16.404 ft	0.1 to 2 m 0.328 to 6.562 ft (Note 2)	300 mm 11.811 in (Note 3)			
Sensing object			ø10 mm ø0.394 in or more opaque object (Note 4)	ø50 mm ø1.969 in or more opaque, translucent or specular object (Note 2, 5)	Opaque, translucent or transparent object (Note 5)			
Hyst	eresis				15 % or less of operation distance (Note 3)			
	eatability pendicular to	sensing axis)	0.5 mm 0.020 in or less	1 mm 0.039 in or less	0.5 mm 0.020 in or less			
Supp	oly voltage		12 to 24 V DC ±10 % Ripple P-P 10 % or less					
Curr	ent consum	otion	Emitter: 8 mA or less, Receiver: 0.8 mA or less (Note 6)	1 mA or le	ss (Note 6)			
Sens	sing output		Non contact DC 2-wire type • Load current: 5 to 100 mA • Residual voltage: 4 V or less (Note 7)					
	Output ope	ration		Switchable either Light-ON or Dark-ON				
	Short-circu	it protection		Incorporated				
Resp	oonse time			3 ms or less				
Ope	ration indica	tor	Red LED (lights up when the output is ON)					
Stab	ility indicato	r	Green LED (Light-ON mode: lights up under stable light received condition) Oark-ON mode: lights up under stable dark condition					
Emit	ting indicato	r	Red LED (lights up during beam emission) ————					
Sens	Sensitivity adjuster		Continuously variable adjuster					
	Protection		IP67 (IEC)					
nce	Ambient te	mperature	-20 to +60 °C -4 to +140 °F (No dew condensation or icing allowed), Storage: -30 to +70 °C -22 to +158 °F					
sista	Ambient hu	ımidity	35 to 85 % RH, Storage: 35 to 85 % RH					
talre	Ambient illu	uminance	Incandescent light: 3,500 & or less at the light-receiving face					
men	Voltage wit	hstandability	1,000 V AC for one min. between all supply terminals connected together and enclosure					
Ambient temperature —20 to +60 °C · Ambient humidity Ambient illuminance Voltage withstandability 1,000 insulation resistance 20 MΩ, or m Vibration resistance 10 to 500 Hz frequ		20 MΩ, or more, with 250 V D	$\mbox{M}\Omega,$ or more, with 250 V DC megger between all supply terminals connected together and enclosure					
E	Vibration re	esistance	10 to 500 Hz frequency, 1.5 mm 0.0	059 in double amplitude (10 G max.) in X, Y	and Z directions for two hours each			
	Shock resis	stance	500 m/s² acceleration (50 G approx.) in X, Y and Z directions three times each					
Emit	ting elemen	t	Infrared LED (modulated)	Red LED (modulated)	Infrared LED (modulated)			
	Peak emiss	ion wavelength	880 nm 0.035 mil	680 nm 0.027 mil	890 nm 0.035 mil			
Material			Enclosure: Die-cast zinc alloy, Indicator cover: Polyethersulphone, Lens: Polycarbonate (RX2-PRVM2: Acrylic)					
Cable			0.15 mm² 2-core oil, heat and cold resistant cabtyre cable, 2 m 6.562 ft long					
Cabl	e extension			——— (Note 7)				
Net	weight		Emitter: 70 g approx., Receiver: 70 g approx.	75 g approx.	70 g approx.			
Accessories			MS-RX-1 (Sensor mounting bracket): 1 set for emitter and receiver Adjusting screwdriver: 1 pc.	MS-RX-1 (Sensor mounting bracket): 1 set RF-230 (Reflector): 1 pc. Adjusting screwdriver: 1 pc.	MS-RX-1 (Sensor mounting bracket): 1 set Adjusting screwdriver: 1 pc.			

Notes: 1) Where measurement conditions have not been specified precisely, the conditions used were an ambient temperature of +23 °C +73.4 °F.

2) The sensing range and the sensing object for **RX2-PRVM2** are specified for the **RF-230** reflector. Further, the sensing range is the possible setting range for the reflector. The sensor can detect an object less than 0.1 m 0.328 ft away.

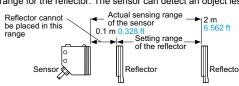

- 3) The sensing range and the hysteresis of RX2-D300 are specified for white non-glossy paper (200 × 200 mm 7.874 × 7.874 in) as the object.
- 4) If slit masks (optional) are fitted, an object of 0.5 × 5 mm 0.020 × 0.197 in can be detected.
- 5) Make sure to confirm detection with an actual sensor before use.
- 6) It is the leakage current when the output is in the OFF state.
- 7) When extending the cable, the residual voltage will be increased depending on the type of cable used. Verify the residual voltage when extending the

FIBER SENSORS

LASER SENSORS

SAFETY LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR USE SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS STATIC CONTROL DEVICES

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES

FA COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

EX-Z CX-400

CY-100 EX-10 EX-20

EX-30 EX-40

CX-440 **EQ-30**

EQ-500

MQ-W RX-LS200

LASER SENSORS

AREA SENSORS

SAFETY LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS

PARTICULAR USE SENSORS SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

MEASURE-MENT SENSORS STATIC CONTROL DEVICES

LASER MARKERS

PLC HUMAN MACHINE INTERFACES

FA COMPONENTS MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Amplifier Built-in Power Supply Built-in

EX-Z CX-400 CY-100 EX-10 EX-20 EX-30 EX-40 CX-440

EQ-30 EQ-500 MQ-W RX-LS200

RT-610

SPECIFICATIONS

Heavy duty type


Туре		Thru-beam					
		Cable length 2 m 6.562 ft Cable length 3 m 9.843 ft Cable length 5 m 16.404 ft					
ten	n Model No.	RX4-M5	RX4-M5-C3	RX4-M5-C5			
Sensing range		5 m 16.404 ft					
Sensing object			ø10 mm ø0.394 in or more opaque object				
	eatability pendicular to sensing axis)		0.5 mm 0.020 in or less				
Sup	ply voltage	12	2 to 24 V DC ±10 % Ripple P-P 10 % or les	s			
Curr	rent consumption	Emitter: 20 mA or less, Receiver: 25 mA or less					
Sen	sing output	NPN open-collector transistor • Maximum sink current: 100 mA • Applied voltage: 30 V DC or less (between sensing output and 0 V) • Residual voltage: 2 V or less (at 100 mA sink current) 1 V or less (at 16 mA sink current)					
	Output operation		Switchable either Light-ON or Dark-ON				
	Short-circuit protection		Incorporated				
Self-diagnosis output		NPN open-collector transistor					
	Output operation		ON under unstable sensing condition				
	Short-circuit protection						
Res	ponse time	1 ms or less					
est	input (emission halt) function	Incorporated					
ре	ration indicator	Red LED (lights up when the sensing output is ON)					
Stab	pility indicator	Green LED (lights up under stable light received condition or stable dark condition)					
mit	tting indicator	Red LED (lights up during beam emission)					
Sen	sitivity adjuster	Continuously variable adjuster					
	Protection	IP67 (IEC), IP67G					
nce	Ambient temperature	-25 to +60 °C −13 to +140 °F (No dew condensation or icing allowed), Storage: -30 to +70 °C −22 to +158 °F					
sista	Ambient humidity	35 to 85 % RH, Storage: 35 to 85 % RH					
e e	Ambient illuminance	Incandescent light: 3,500 &x or less at the light-receiving face					
onmental resistance	Voltage withstandability	1,000 V AC for one min. between all supply terminals connected together and enclosure					
iron	Insulation resistance	20 MΩ, or more, with 250 V DC megger between all supply terminals connected together and enclosure					
Envir	Vibration resistance	10 to 500 Hz frequency, 1.5 mm 0.059 in double amplitude (10 G max.) in X, Y and Z directions for two hours each					
Shock resistance		500 m/s² acceleration (50 G approx.) in X, Y and Z directions three times each					
Emitting element		Infrared LED (Peak emission wavelength: 880 nm 0.035 mil, modulated)					
Material		Enclosure: Die-cast zinc alloy (Fluorine resin coating), Indicator cover: Polyethersulphone, Lens: Polyalylate, Protective tube sheath: Oil resistant PVC					
Cable		0.15 mm ² 4-cor	e (emitter: 3-core) oil, heat and cold resistan	t cabtyre cable			
Protective tube length		1 m 3.281 ft	2 m 6.562 ft	4 m 13.123 ft			
Cab	le extension	Extension up to total 100 m 328.	.084 ft is possible for both emitter and receive	er with 0.3 mm ² , or more, cable.			
Net weight		Emitter: 175 g approx., Receiver: 175 g approx. Emitter: 265 g approx., Receiver: 265 g approx. Emitter: 495 g approx., Receiver: 495 g approx.					
Accessories		MS-RX-2 (Sensor mounting bracket): 1 set for emitter and receiver, Adjusting screwdriver: 1 pc.					

I/O CIRCUIT AND WIRING DIAGRAMS

RX-- RX4--

I/O circuit diagrams


Emitter of thru-beam type sensor

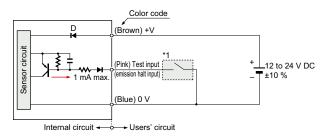

Symbol ... D: Reverse supply polarity protection diode

Wiring diagram Emitter of thru-be

Emitter of thru-beam type sensor

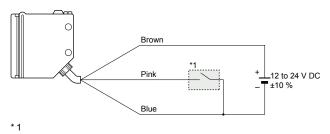


Non-voltage contact or NPN open-collector transistor

or

Test input (emission halt input)
[Supply voltage – 2.5 V] or more: Emission
[Supply voltage – 3.3 V] or less: Emission halt


Receiver of thru-beam type sensor

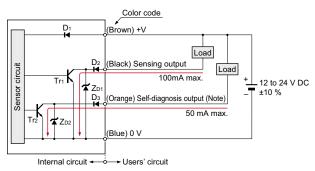


Note: The self-diagnosis output does not incorporate a short-circuit protection circuit. Do not connect it directly to a power supply or a capacitive load.

Symbols ... D1: Reverse supply polarity protection diode D2, D3: Reverse output polarity protection diode ZD1, ZD2: Surge absorption zener diode Tr1, Tr2: NPN output transistor

Receiver of thru-beam type sensor

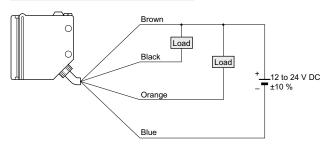


Retroreflective and diffuse reflective type sensors

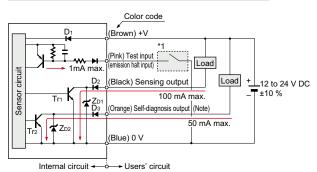


Note: The self-diagnosis output does not incorporate a short-circuit protection circuit. Do not connect it directly to a power supply or a capacitive load.

Symbols ... D1: Reverse supply polarity protection diode D2, D3: Reverse output polarity protection diode ZD1, ZD2: Surge absorption zener diode Tr1, Tr2: NPN output transistor

Retroreflective and diffuse reflective type sensors

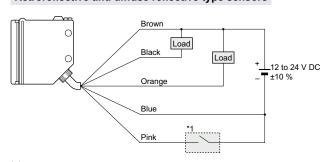

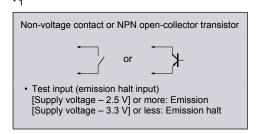

FIBER SENSORS

LASER SENSORS

> PHOTO-ELECTRIC SENSORS MICRO PHOTO-ELECTRIC

AREA SENSORS

CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

WIRE-SAVING UNITS

SYSTEMS

MEASURE-MENT SENSORS STATIC

CONTROL DEVICES LASER MARKERS

PLC

HUMAN MACHINE INTERFACES

ENERGY MANAGEMENT SOLUTIONS

FA COMPONENTS

> MACHINE VISION SYSTEMS

V URING YSTEMS

Selection Guide Amplifier Built-in

Built-in

Amplifierseparated

CX-400 CY-100

EX-10

EX-Z

EX-30

EX-40 CX-440

EQ-30 EQ-500

MQ-W RX-LS200

₹X

LASER SENSORS

MICRO PHOTO-ELECTRIC SENSORS

AREA SENSORS SAFETY LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR USE SENSORS SENSORS

SIMPLE WIRE-SAVING UNITS WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS STATIC CONTROL DEVICES

LASER MARKERS PLC

HUMAN MACHINE INTERFACES ENERGY MANAGEMENT

MACHINE VISION SYSTEMS

> CURING SYSTEMS

Selection Guide Amplifier Built-in Power Supply Built-in Amplifier-

EX-Z
CX-400
CY-100
EX-10
EX-20
EX-30
EX-40
CX-440


EQ-30 EQ-500 MQ-W RX-LS200

I/O CIRCUIT AND WIRING DIAGRAMS

RX2-□

I/O circuit diagrams


Emitter of thru-beam type sensor

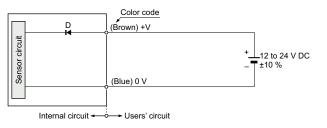


Symbol ... D: Reverse supply polarity protection diode

Wiring diagrams

Emitter of thru-beam type sensor

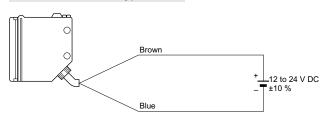


Receiver of thru-beam type sensor, retroreflective and diffuse reflective type sensors

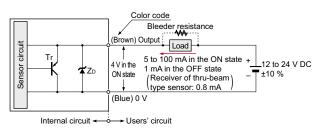

Symbols ... D : Reverse supply polarity protection diode ZD: Surge absorption zener diode Tr : PNP output transistor

Receiver of thru-beam type sensor, retroreflective and diffuse reflective type sensors

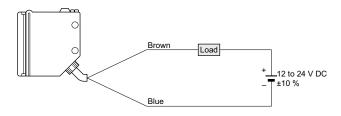

All models

Conditions for the load


- 1) The load should not be actuated by the leakage current (1 mA; 0.8 mA for receiver of thru-beam type sensor) in the OFF state.
- 2) The load should be actuated by (supply voltage 4 V) in the ON state.


 3) The current in the ON state should be between 5 to 100 mA DC.
- 3) The current in the ON state should be between 5 to 100 mA DC.


 In case the current is less than 5 mA, connect a bleeder resistance in parallel to the load (shown in dotted line above) so that a current of 5 mA, or more, flows.

SENSING CHARACTERISTICS (TYPICAL)

RX-□

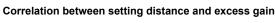

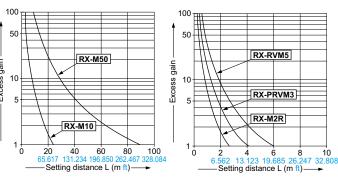

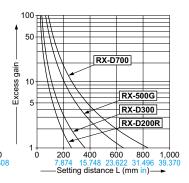

RX

SENSING CHARACTERISTICS (TYPICAL)

Left ◄

-Center

Operating point (mm in)

Left ◄

-Center

Operating point & (mm in)

Right

Left ◄

-Center

Operating point & (mm in)

Right

Thru-beam type RX-M10 Parallel deviation Parallel deviation with slit masks Parallel deviation with slit masks Parallel deviation with slit masks (1 × 5 mm 0.039 × 0.197 in) $(0.5 \times 5 \text{ mm } 0.020 \times 0.197 \text{ in})$ $(3 \times 5 \text{ mm } 0.118 \times 0.197 \text{ in})$ Slit on emitter Setting distance L (m ft) → Setting distance L (m ft) → Setting distance L (m ft) → Setting distance L (m ft)→ Slit on Slit on receiver Slit on Emitter Emitte emitter Emitte Emitte Slit on both side both sides Slit on receiver Slit on Receiver 0 400 15.74 0+ 400 200 7.87 0 200 7.874 400 15.74 200 100 100 3.937 , ➤ Right 3.937 ➤ Right 7.874 → Right 3.93 Left ◄ 3.937 Left ◄ 7.874 Left ◄ Right Left Center Center Center Center Operating point & (mm in) Operating point ℓ (mm in) Operating point & (mm in) Operating point & (mm in) RX-M50 Thru-beam type RX-M2R Thru-beam type **RX-500G** Thru-beam type RX4-M5_□ Thru-beam type Parallel deviation Parallel deviation Parallel deviation Parallel deviation Setting distance L (m ft) → Setting distance L (m ft)→ Setting distance L (m ft) → 60 (H H) 600 distance L 400 Emitter Emitte Emittei Emitte 20 Receiver Receiver 0 200 0 40 0 1,000 0 400 500 500 1,000 100 Ò 100 200 20 Ó 20 200 200 400 0.787 ➤ Right U./8 Left ◄ 7.074 → Right -Center Left < Left -Center ► Right Left --Center → Right - Center Operating point ℓ (mm in) Operating point ℓ (mm in) Operating point & (mm in) Operating point ℓ (mm in) RX2-M5 Thru-beam type Parallel deviation Parallel deviation with slit masks Parallel deviation with slit masks Parallel deviation with slit masks $(0.5 \times 5 \text{ mm } 0.020 \times 0.197 \text{ in})$ $(1 \times 5 \text{ mm } 0.039 \times 0.197 \text{ in})$ $(3 \times 5 \text{ mm } 0.118 \times 0.197 \text{ in})$ Slit on Slit on emitter Setting distance L (m ft) → Setting distance L (m ft) + 4.92 3.28 1.64 (m ft) - 1.55 (m ft) - 1.64 (Setting distance L (m ft)→ Setting distance L (m ft) 1.5 Slit on receive Slit on Emitte Emitte Emitte Emitte Slit on receive Ċ Slit on 0.5 0.5 Slit on |--- l -- i L Slit on Slit on 0 400 74 0+ 100 100 3.937 0 ↓ 200 200 200 400 50 50 100 50 50 100 100 100 Left -Right Center Right ► Right -Center Operating point (mm in) Operating point ℓ (mm in) Operating point ℓ (mm in) **RX-PRVM3** Retroreflective type **RX-RVM5** Retroreflective type **RX2-PRVM2** Retroreflective type Parallel deviation Parallel deviation Parallel deviation Setting distance L (m ft) → Setting distance L (m Setting distance L (m Reflector (**RF-230**) Reflector (RF-230) (RF-230 |-l-i |-- l--| 0 ↓ 100 0 100 50 Ó 50 100 3.937 50 100 50 100 50 50 100 1.969 → Right

FIBER SENSORS

SAFETY LIGHT CURTAINS / SAFETY COMPONENTS

PRESSURE / FLOW SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

MEASURE-MENT SENSORS STATIC CONTROL DEVICES

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES

FA COMPONENTS

VISION SYSTEMS

EX-Z CX-400 CY-100

EX-10 **EX-20**

EX-30 EX-40

CX-440 EQ-30

EQ-500 MQ-W

RX-LS200

LASER SENSORS

MICRO PHOTO-ELECTRIC SENSORS AREA SENSORS COMPONENTS PRESSURE / FLOW SENSORS INDUCTIVE PROXIMITY SENSORS

SENSORS SENSOR OPTIONS SIMPLE WIRE-SAVING UNITS

PARTICULAR

MEASURE-MENT SENSORS STATIC CONTROL DEVICES LASER MARKERS

distance I

-Setting

PLC HUMAN

SOLUTIONS FA COMPONENTS MACHINE VISION SYSTEMS

CURING SYSTEMS

Amplifiei Built-ir Power Supply Built-in

> EX-Z CX-400 CY-100 EX-10 **EX-20** EX-30


EX-40 CX-440 EQ-30 EQ-500 MQ-W RX-LS200

RT-610


SENSING CHARACTERISTICS (TYPICAL)

RX-D700 Diffuse reflective type

Sensing field

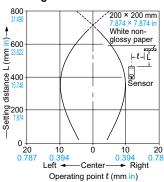

Correlation between sensing object size and sensing range

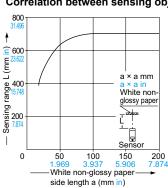


As the sensing object size becomes smaller than the standard size (white non-glossy paper 200 \times 200 mm 7.874 \times 7.874 in), the sensing range shortens, as shown in the left graph.

For plotting the left graph, the sensitivity has been set such that a 200 × 200 mm 7.874 × 7.874 in white non-glossy paper is just detectable at a distance of 700 mm 27.559 in.

RX-D200R Sensing field

Correlation between sensing object size and sensing range

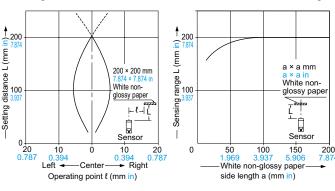


As the sensing object size becomes smaller than the standard size (white non-glossy paper 200 × 200 mm 7.874 × 7.874 in), the sensing range shortens, as shown in the left graph.

Diffuse reflective type


For plotting the left graph, the sensitivity has been set such that a 200 × 200 mm 7.874 × 7.874 in white non-glossy paper is just detectable at a distance of 200 mm 7.874 in.

RX2-D300 Diffuse reflective type

Sensing field

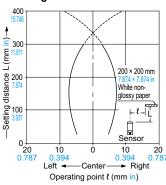

Correlation between sensing object size and sensing range

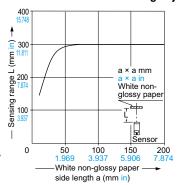

As the sensing object size becomes smaller than the standard size (white non-glossy paper 200 × 200 mm 7.874 × 7.874 in), the sensing range shortens, as shown in the left graph.

For plotting the left graph, the sensitivity has been set such that a 200 × 200 mm 7.874 × 7.874 in white non-glossy paper is just detectable at a distance of 300 mm 11.811 in.

PRECAUTIONS FOR PROPER USE

Refer to p.1552~ for general precautions.




- Never use this product as a sensing device for personnel protection.
- · In case of using sensing devices for personnel protection, use products which meet laws and standards, such as OSHA, ANSI or IEC etc., for personnel protection applicable in each region or country.

Wiring

 The self-diagnosis output does not incorporate a shortcircuit protection circuit. Do not connect it directly to a power supply or a capacitive load.

Mounting

· The tightening torque should be 1.17 N·m or less.

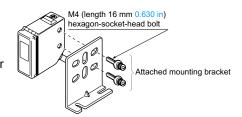


Others

 Do not use during the initial transient time (50 ms) after the power supply is switched on.

RX-RVM5

Glossy object sensing

- Please take care of the following points when detecting materials having a gloss.
- ①Make L, shown in the diagram, sufficiently long.
- 2 Install at an angle of 10 to 30 degrees to the sensing object.

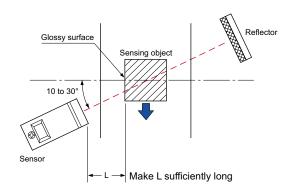

RX-PRVM3 RX2-PRVM2

Retroreflective type sensor with polarizing filters

 If a shiny object is covered or wrapped with a transparent film such as those described below, the retroreflective type sensor with polarizing filters may not be able to detect it.

In that case, follow the steps given below.

Example of sensing objects

- · Can wrapped by clear film
- · Aluminum sheet covered by plastic film
- · Gold or silver color (specular) label or wrapping paper

Steps


- Tilt the sensor with respect to the sensing object while fitting.
- · Reduce the sensitivity.
- Increase the distance between the sensor and the sensing object.

RX2-□


Wiring

 Always connect the sensor to the power supply through a load. If the sensor is connected to the power supply directly, the short-circuit protection makes the sensor inoperable. (The output stays in the OFF state and no indicator lights up.) If this happens, connect the sensor to the power supply through a load.


Further, note that the sensor will be damaged if the power supply is connected in reverse without a load.

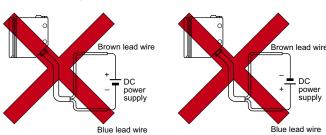

• Do not connect sensors in series (AND circuit).

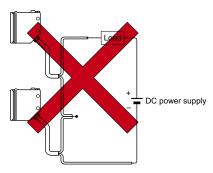

 The residual voltage of the sensor is 4 V. Before connecting to a relay, be aware of the actuation voltage of the relay. (Not all 12 V relays may be connected as the load.)

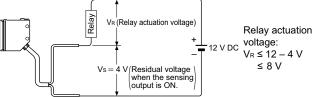


RX4-


Connection of protective tube connector

Connect the junction connector securely as shown below.
 The tightening torque should be 0.98 N·m or less.


When mounted on a plate

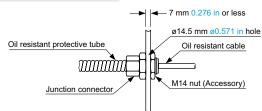

When mounted with a female screw

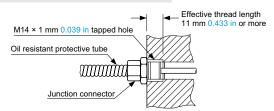

When connected to another protective tube

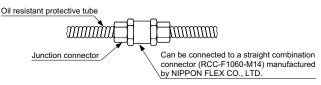

FIBER SENSORS

LASER SENSORS

> PHOTO-ELECTRIC SENSORS MICRO PHOTO-ELECTRIC

AREA SENSORS

CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS SENSOR OPTIONS

SIMPLE WIRE-SAVING

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

PLC

ENERGY MANAGEMENT SOLUTIONS

FA COMPONENTS

MACHINE VISION SYSTEMS

CURING SYSTEMS

Selection Guide

Amplifier Built-in

Power Supply Built-in

separated

EX-Z

CX-400 CY-100

EX-10 EX-20

EX-30 EX-40

CX-440

EQ-30 EQ-500

MQ-W RX-LS200

RX

LASER

AREA SENSORS

COMPONENTS

PRESSURE /

INDUCTIVE PROXIMITY SENSORS

PARTICULAR

SENSORS SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

PLC

HUMAN

MACHINE INTERFACES

SOLUTIONS

FA COMPONENTS

MACHINE

VISION SYSTEMS

CURING SYSTEMS

SENSORS

DIMENSIONS (Unit: mm in)

The CAD data can be downloaded from our website.

Refer to **CX-400** series pages (p.269 and p.272) for dimensions of the reflector or the reflector mounting bracket.

RX-M10 RX-M2R RX-500G RX2-M5

Sens

Sensitivity adjuster (Note 1)
Operation mode switch (Note 1)

Operation mode switch (Note 1)

Cover-fixing screw

Operation indicator (Red) (Note 1)

14
1.551

Operation indicator (Red) (Note 1)

2-M4 × 0.7 0.028 thru-hole threads

14
0.551

0.787

0.787

0.787

0.787

0.787

0.787


0.787

0.787

Notes: 1) Not incorporated on the emitter.

2) It is the emitting indicator (red) on the emitter.

RX-M50 Sensor

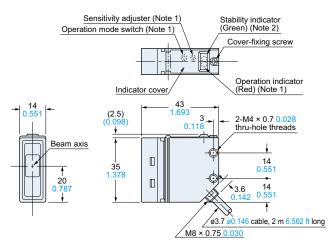


Notes: 1) Not incorporated on the emitter.

2) It is the emitting indicator (red) on the emitter.

RX4-M5□ Sensor


/M8 × 0.75 0.030

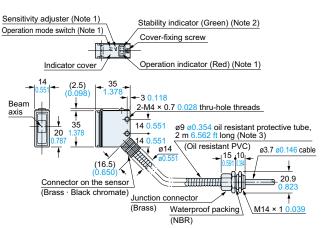


Notes: 1) Not incorporated on the emitter.

- 2) It is the emitting indicator (red) on the emitter.
- 3) The given length of the protective tube is for RX4-M5-C3. (RX4-M5: 1 m 3.281 ft, RX4-M5-C5: 4 m 13.123 ft)

RX-D700 RX-D200R RX2-D300 Sensor

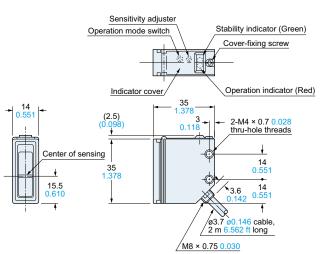

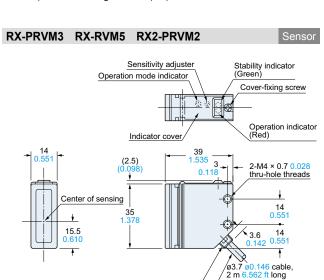

M8 × 0.75 0.030

Selection Guide Amplifier Built-in Power Supply Built-in Amplifierseparated

EX-Z CX-400 CY-100 EX-10 EX-20

EX-40 CX-440 EQ-30

MQ-W RX-LS200

DIMENSIONS (Unit: mm in)

The CAD data can be downloaded from our website.

Refer to CX-400 series pages (p.269 and p.272) for dimensions of the reflector or the reflector mounting bracket.

FIBER SENSORS

LASER SENSORS

SAFETY LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS

PARTICULAR USE SENSORS SENSOR OPTIONS

MEASURE-MENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

PLC

FA COMPONENTS

VISION SYSTEMS

EX-Z CX-400

CY-100 EX-10

FX-20 EX-30

EX-40 CX-440

EQ-30 EQ-500


MQ-W RX-LS200

RT-610

Assembly dimensions Mounting drawing with RX-D700

MS-RX-1

Sensor mounting bracket (Accessory for **RX-**□, **RX2-**□)

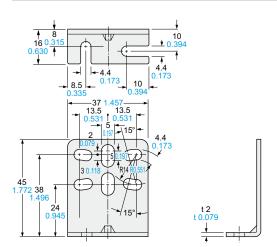

Material: Cold rolled carbon steel (SPCC)

Two M4 (length 16 mm 0.630 in) hexagon-socket-head bolts are attached.


37 (2.5) (0.098 35

25.5

-23 0.906 - -30 1.181-

MS-RX-2


Sensor mounting bracket (Accessory for **RX4-**□)

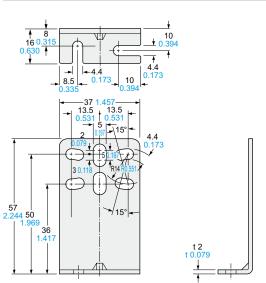

Material: Cold rolled carbon steel (SPCC)


Two M4 (length 16 mm 0.630 in) hexagon-socket-head bolts are attached.

Assembly dimensions

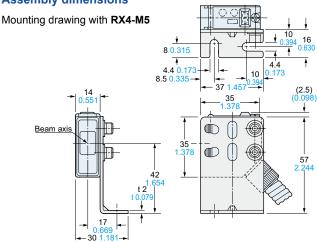

PT-RX500 PT-RX1000

Protective tube (Optional)

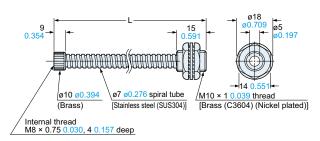

• Length L

Model No.	Length L		
PT-RX500	500 ^{+ 10}	19.685 + 0.394	
PT-RX1000	1,000 + 10	39.370 + 0.394	