


REV.	DATE	REVISION DESCRIPTION	BY	C.K'D'
1	7/28/86	REV. REF. PRINT	DC20057	JM H.C.

RUN		TAP		CAT. NO.	FIG.	RUN			TAP				INSTALLATION DATA, RUN				INSTALLATION DATA, TAP				REFERENCE
						I.D.	O.D.	L	I.D.	O.D.	B	H	MD6-8 HYTOOL		Y35 HYPRESS		DIE INDEX	MD6-8 HYTOOL	Y35 HYPRESS		
CODE NAME	MM ²	CODE NAME	MM ²	DIE INDEX	DIE SET & NO. OF CRIMPS PER END								DIE SET & NO. OF CRIMPS PER END	DIE INDEX	DIE SET & NO. OF CRIMPS	DIE SET & NO. OF CRIMPS					
ANT RABBIT	50	GNAT	25	YTU25R2W	1	10.4 X 14.7	17.5 X 27.7	122.9	7.1	16.5	20.2	62.0	C	W-C 2	U-C 1	3	BG	W-BG 1	U-BG 1	3	
ANT RABBIT	50	GOPHER	25	YTU25R2R	1	10.4 X 14.7	17.5 X 27.7	122.9	9.0	16.5	20.2	62.0	C	W-C 2	U-C 1	3	BG	W-BG 1	U-BG 1	3	
ANT RABBIT	50	ANT RABBIT	50	YTU25R25R	1	10.4 X 14.7	17.5 X 27.7	122.9	10.7	16.5	20.2	62.0	C	W-C 2	U-C 1	3	BG	W-BG 1	U-BG 1	3	
WASP DOG	100	GOPHER	25	YTU28R2R	1	19.6	29.2	136.7	9.0	27.0	50.8	90.7	L	—	—	U-L 1	L	—	—	U-L 2	
WASP DOG	100	WASP DOG	100	YTU28R28R	1	19.6	29.2	179.3	15.1	27.0	50.8	90.7	L	—	—	U-L 2	L	—	—	U-L 2	
CHAFER	200	GNAT	25	YTU33R2W	1	24.6	35.6	168.7	7.1	16.5	20.2	68.6	M	—	—	U-M 2	BG	W-BG 3	U-BG 1	3	
PANTHER	200	PANTHER	200	YOT35R35R	1A	26.9	33.5	314.5	21.8	31.7	110.5	158.7	M	—	—	U-M 4	M	—	—	U-M 4	

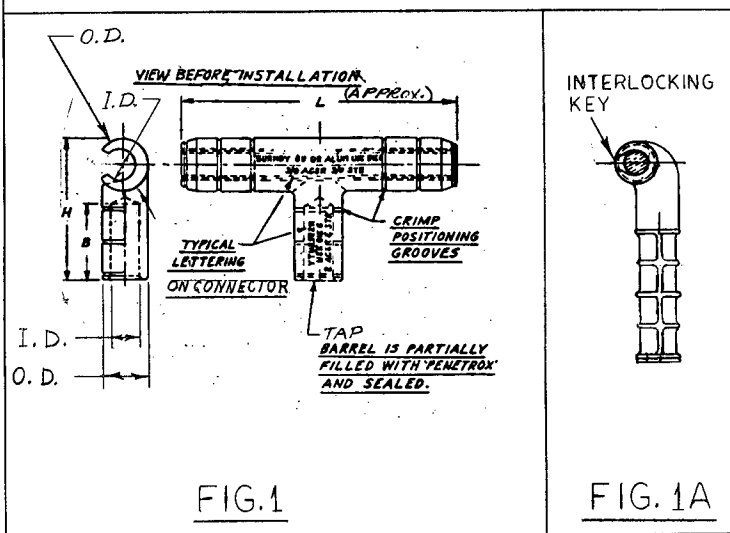

NOTES:

1. SCRATCH BRUSH CONDUCTOR & CONNECTOR CONTACT SURFACES DRY THEN APPLY PENETROX A. PENETROX A NOT INCLUDED IN CAT. NO., CAN BE PURCHASED FROM BURNDY CORPORATION IN CANS OR PLASTIC SQUEEZE BOTTLES.
2. INSERT CONDUCTOR IN CONNECTOR AND MAKE REQUIRED NUMBER OF CRIMPS STARTING AT CROTCH AND WORKING TOWARDS ENDS.
- 3 TWO CRIMPS MADE SIMULTANEOUSLY.
4. ALL DIMENSIONS SHOWN ARE IN MILLIMETERS.

MATERIAL:
CAST ALUM. ALLOY

FOR PAKISTAN ONLY

© BURNDY CORPORATION 1986

T - TAP		SCALE
CAT. NO.	YTU--R-- YOT35R35R (TABLE)	4
DRAWN	JM 6-9-86	CHECKED H.C. 6-9-86
DES. APPROV.	MDM 6-10-86	MFG. APPROV.
Q.C. APPROV.		
DRAWING NO.		REV.
SC200122		1
DO50767		