

Preliminary W741C20X



4-BIT MICROCONTROLLER

Table of Contents--

GENERAL DESCRIPTION	2
FEATURES	2
PIN CONFIGURATION	3
PIN DESCRIPTION	4
BLOCK DIAGRAM	5
FUNCTIONAL DESCRIPTION	6
ABSOLUTE MAXIMUM RATINGS	27
DC CHARACTERISTICS	28
AC CHARACTERISTICS	29
PAD ASSIGNMENT & POSITIONS	30
TYPICAL APPLICATION CIRCUIT	31
INSTRUCTION SET TABLE	32
PACKAGE DIMENSIONS	79

Preliminary W741C20X



GENERAL DESCRIPTION

The W741C20X is a high-performance 4-bit microcontroller (μ C) that operates on very low current. The device contains a 4-bit ALU, two 8-bit timers, a divider, a serial port, and five 4-bit I/O ports (including 3 output ports for LED driving). There are also seven interrupt sources and 8-level subroutine nesting for interrupt applications. The W741C20X has two power reduction modes, hold mode and stop mode, which help to minimize power dissipation.

The W741C20X is suitable for remote controllers, toy controllers, keyboard controllers, speech synthesis LSI controllers, and other products.

FEATURES


- Operating voltage: 2.2V to 5.5V
- Crystal or RC oscillation circuit can be selected by the code option
 - Crystal/Ceramic oscillator: up to 4 MHz
 - RC oscillator: up to 4 MHz
- Both in crystal or RC oscillator operation mode, high-frequency (400 KHz to 4 MHz) or low-frequency (32.768 KHz) oscillation must be determined by the code option
- Memory
 - 2048 x 16 bit program ROM (including 2K x 4 bit look-up table)
 - 128 x 4 bit data RAM (including 16 working registers)
- 21 input/output pins
 - Input/output ports: 4 ports/16 pins
 - Serial input/output port: 1 port /4 pins (high sink current for LED driving)
 - MFP output pin: 1 pin (MFP)
- Power-down mode
 - Hold function: no operation (except for oscillator)
 - Stop function: no operation (including oscillator)
- Seven types of interrupts
 - Five internal interrupts (Divider 0, Timer 0, Timer 1, and Serial I/O)
 - Two external interrupts (Port RC and \overline{INT} pin)
- MFP output pin
 - Output is software selectable as modulating or nonmodulating frequency
 - Works as frequency output specified by Timer 1
- Built-in 14-bit clock frequency divider circuit
- Two built-in 8-bit programmable countdown timers
 - Timer 0: One of two internal clock frequencies (Fosc/4 or Fosc/1024) can be selected
 - Timer 1: Offers auto-reload function, and one of two internal clock frequencies (Fosc or Fosc/64) can be selected, or falling edge of pin RC.0 can be selected (output through MFP pin)
- Built-in 18/14-bit watchdog timer selectable for system reset

Preliminary W741C20X



- Powerful instruction set: 118 instructions
- 8-level subroutine (include interrupt) nesting
- One serial transmission/receiver port specified by software
- Up to 1 μ S instruction cycle (with 4 MHz operating frequency)
- Packaged in 18-pin, 20-pin, 28-pin PDIP and 20-pin, 28-pin SOP

PIN CONFIGURATION

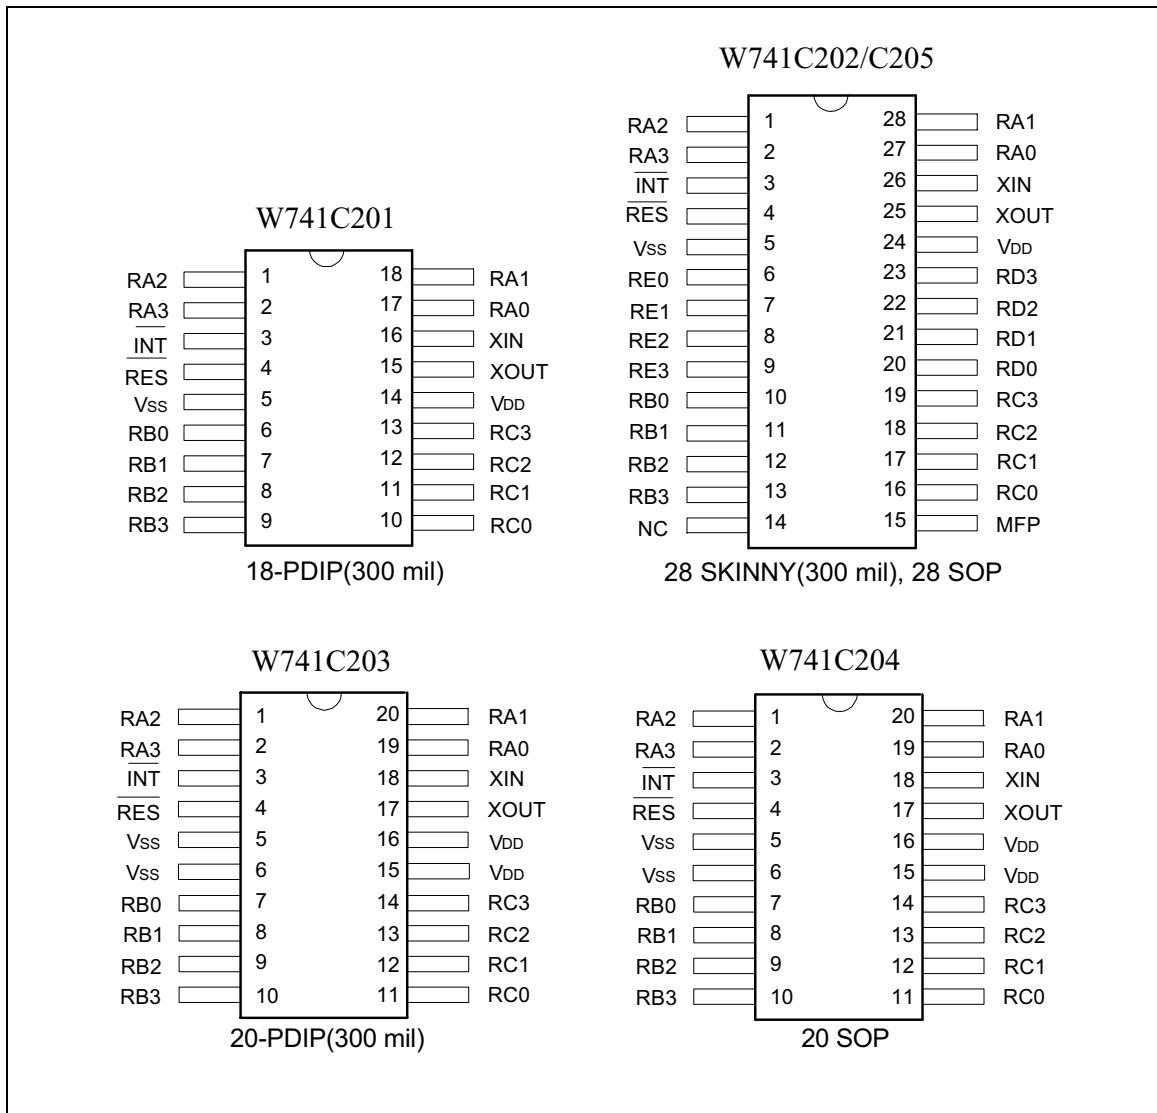


Preliminary W741C20X



PIN DESCRIPTION

SYMBOL	I/O	FUNCTION
XIN	I	Input pin for oscillator. Connected to crystal or resistor to generate system clock by code option.
XOUT	O	Output pin for oscillator. Connected to crystal or resistor to generate system clock by code option.
RA0–RA3	I/O	Input/Output port. Input/output mode specified by port mode 1 register (PM1). When used as output port, can provide high sink current for driving LED.
RB0–RB3	I/O	Input/Output port. Input/output mode specified by port mode 2 register (PM2). When used as output port, can provide high sink current for driving LED.
RC0–RC3	I/O	Input/Output port. Input/output mode specified by port mode 4 register (PM4). Each pin has an independent interrupt capability in input mode.
RD0–RD3	I/O	Input/Output port. Input/output mode specified by port mode 5 register (PM5).
RE0/DOUT RE1/CLKO RE2/DIN RE3/CLKI	I/O	Special input/output port. This port can be configured by software to act as the output of internal port RT or the serial I/O port. When used as output port, can provide high sink current for driving LED.
MFP	O	Output pin only. This pin can output modulating or nonmodulating frequency, or Timer 1 clock output specified by mode register 1 (MR1).
INT	I	External interrupt pin with pull-high resistor.
RES	I	System reset pin with pull-high resistor.
VDD	I	Positive power supply (+).
Vss	I	Negative power supply (-).

BLOCK DIAGRAM

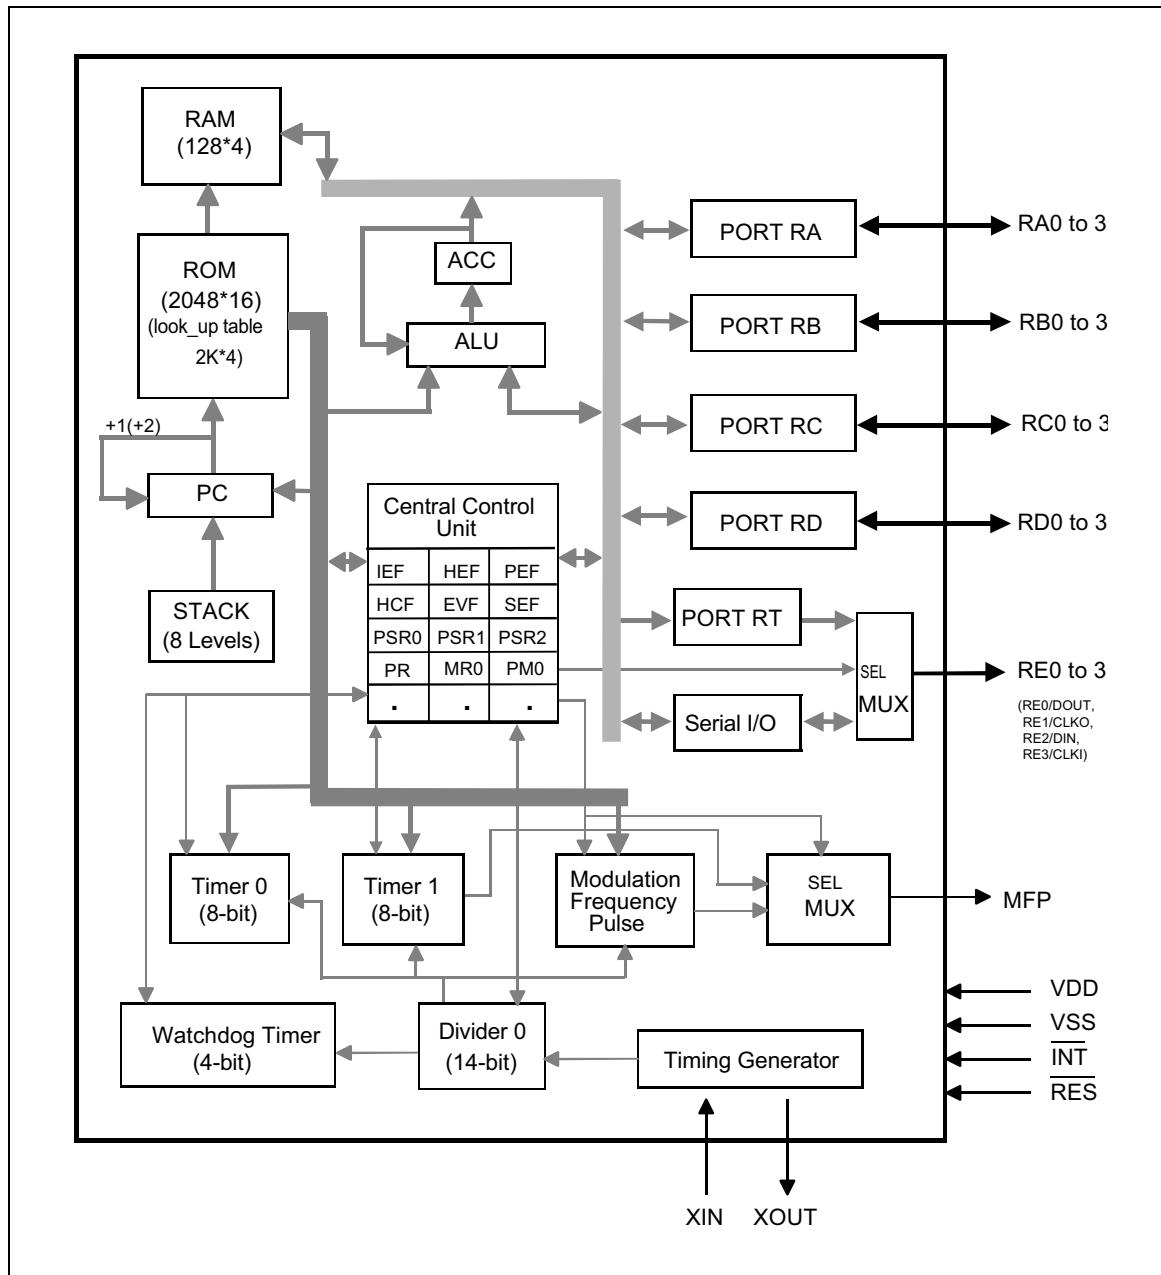

Preliminary W741C20X



FUNCTIONAL DESCRIPTION

Program Counter (PC)

Organized as an 11-bit binary counter (PC0 to PC10), the program counter generates the addresses of the 2048×16 on-chip ROM containing the program instruction words. When jump or subroutine call instructions or interrupt, or initial reset conditions are to be executed, the address corresponding to the instruction will be loaded into the program counter. The format used is shown below.

ITEM	ADDRESS	INTERRUPT PRIORITY
Initial Reset	000H	-
INT 0 (Divider)	004H	1st
INT 1 (Timer 0)	008H	2nd
INT 2 (Port RC)	00CH	3rd
INT 3 (INT pin)	014H	4th
INT 4 (Serial Port Input)	018H	5th
INT 5 (Serial Port Output)	01CH	6th
INT 6 (Timer 1)	020H	7th
JMP Instruction	XXXH	-
Subroutine Call	XXXH	-

Stack Register (STACK)

The stack register is organized as 11 bits x 8 levels (first-in, last-out). When either a call subroutine or an interrupt is executed, the program counter will be pushed onto the stack register automatically. At the end of a call subroutine or an interrupt service subroutine, the RTN instruction must be executed to pop the contents of the stack register into the program counter. When the stack register is pushed over the eighth level, the contents of the first level will be lost. In other words, the stack register is always eight levels deep.

Program Memory (ROM)

The read-only memory (ROM) is used to store program codes; the look-up table is arranged as 2048×4 bits. The first three quarters of ROM (000H to 5FFH) are used to store instruction codes only, but the last quarter (600H to 7FFH) can store both instruction codes and the look-up table. Each look-up table element is composed of 4 bits, so the look-up table can be addressed up to 2048 elements. Instruction MOVC R is used to read the look-up table and transfer table data to the RAM. The organization of the program memory is shown in Figure 1.

Preliminary W741C20X

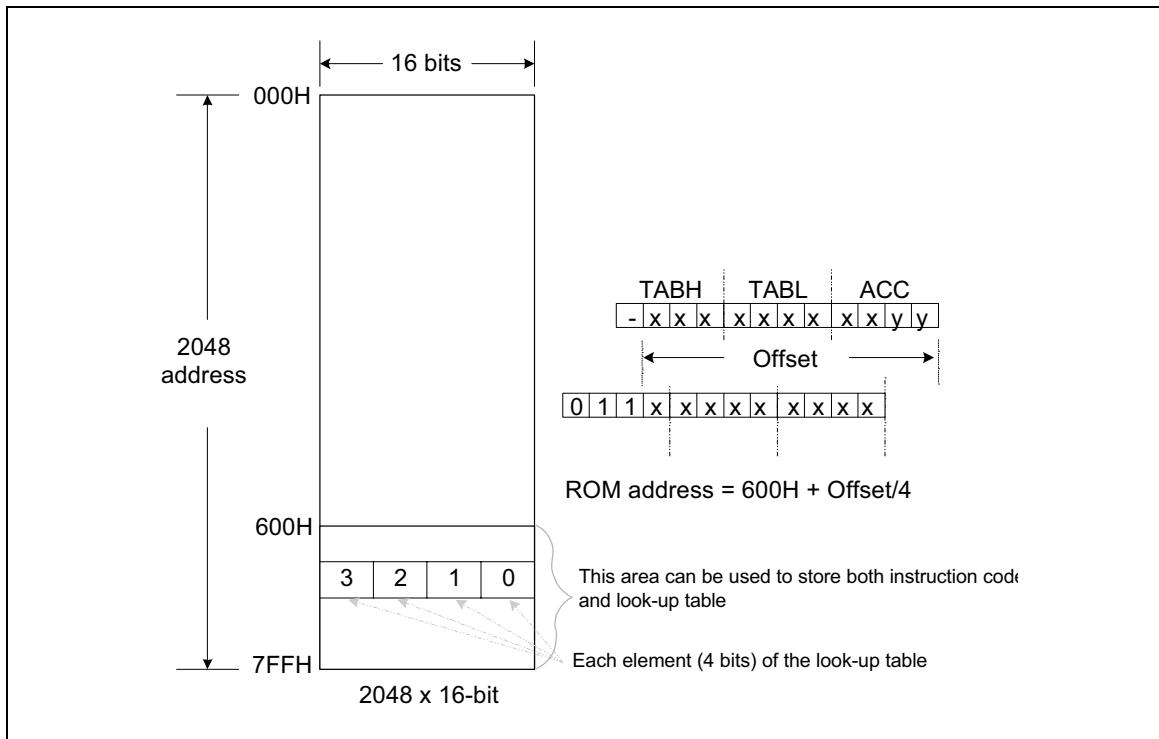


Figure 1. Program Memory Organization

Data Memory (RAM)

1. Architecture

The static data memory (RAM) used to store data is arranged as 128×4 bits. The data memory can be addressed directly or indirectly. The organization of the data memory is shown in Figure 2.

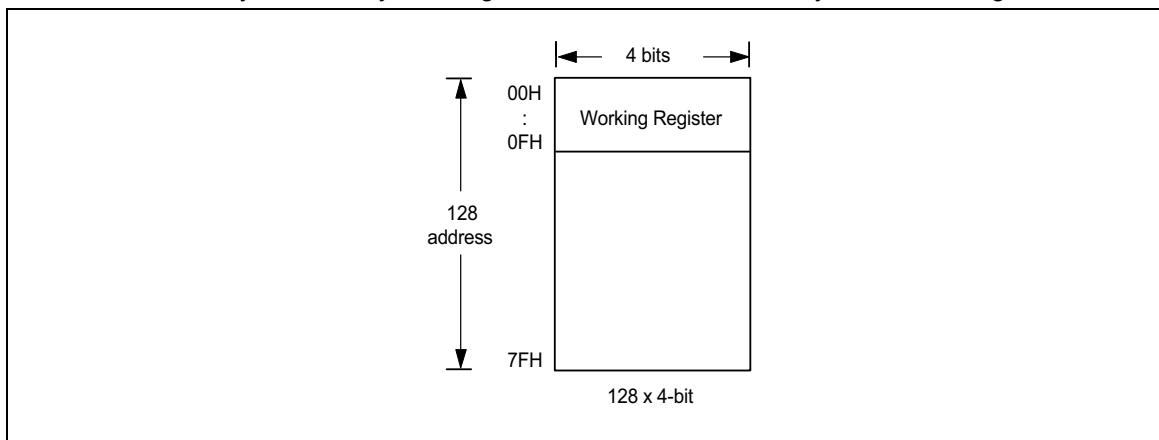


Figure 2. Data Memory Organization

Preliminary W741C20X



The first sixteen addresses (00H to 0FH) in the data memory are known as the working registers (WR). The other data memory is used as general memory and cannot operate directly with immediate data. The relationship between data memory locations and the page register (PAGE) in indirect addressing mode is described in the next section.

2. Page Register (PAGE)

The page register is organized as a 4-bit binary register. The bit descriptions are as follows:

PAGE	3	2	1	0
	—	R/W	R/W	R/W

Note: R/W means read/write available.

Bit 3 is reserved.

Bit 2, Bit 1, Bit 0 Indirect addressing mode preselect bits:

- 000 = Page 0 (00H - 0FH)
- 001 = Page 1 (10H - 1FH)
- 010 = Page 2 (20H - 2FH)
- 011 = Page 3 (30H - 3FH)
- 100 = Page 4 (40H - 4FH)
- 101 = Page 5 (50H - 5FH)
- 110 = Page 6 (60H - 6FH)
- 111 = Page 7 (70H - 7FH)

Accumulator (ACC)

The accumulator (ACC) is a 4-bit register used to hold results from the ALU and transfer data between the memory, I/O ports, and registers.

Arithmetic and Logic Unit (ALU)

This is a circuit which performs arithmetic and logic operations. The ALU provides the following functions:

- Logic operations: ANL, XRL, ORL
- Branch decisions: JB0, JB1, JB2, JB3, JNZ, JZ, JC, JNC, DSKZ, DSKNZ, SKB0, SKB1, SKB2, SKB3
- Shift operations: SHRC, RRC, SHLC, RLC
- Binary additions/subtractions: ADC, SBC, ADD, SUB, ADU, DEC, INC

After any of the above instructions are executed, the status of the carry flag (CF) and zero flag (ZF) is stored in the internal registers. CF can be read out by executing MOVA R, CF.

Clock Generator

The W741C20X provides a crystal or RC oscillation circuit selected by option codes to generate the system clock through external connections. If a crystal oscillator is used, a crystal or a ceramic resonator must be connected to XIN and XOUT, and the capacitor must be connected if an accurate frequency is needed. When a crystal oscillator is used, a high-frequency clock (400 KHz to 4 MHz) or low-frequency clock (32 KHz) can be selected for the system clock by means of option codes. If the RC oscillator is used, a resistor in the range of 20 K Ω to 1.6 M Ω must be connected to XIN and XOUT, as shown in Figure 3. The system clock frequency range is from 32 KHz to 4 MHz. One machine cycle consists of a four-phase system clock sequence and can run up to 1 μ s with a 4 MHz system clock.

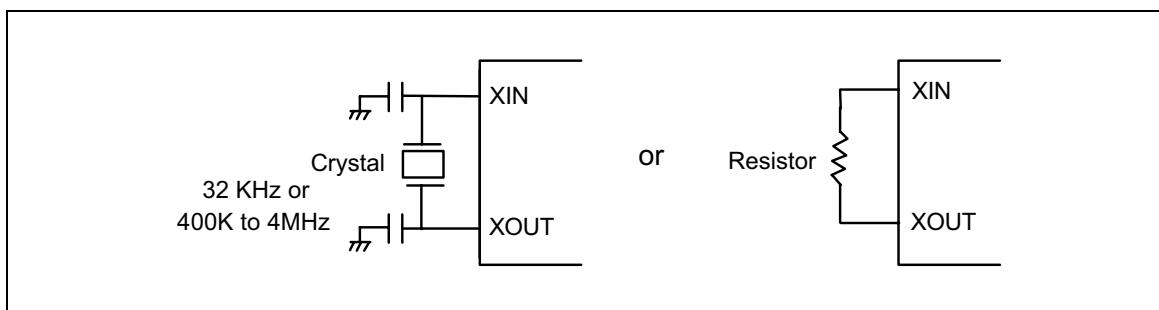


Figure 3. Oscillator Configuration

Divider 0

Divider 0 is organized as a 14-bit binary up-counter designed to generate periodic interrupts, as shown in Figure 4. When the system starts, the divider is incremented by each system clock (Fosc). When an overflow occurs, the divider event flag is set to 1 (EVF.0 = 1). Then, if the divider interrupt enable flag has been set (IEF.0 = 1), the interrupt is executed, while if the hold release enable flag has been set (HEF.0 = 1), the hold state is terminated. The last 4-stage of the Divider 0 can be reset by executing CLR DIVR0 instruction. If the oscillator is connected to the 32768 Hz crystal, the EVF.0 will be set to 1 periodically at each 500 mS interval.

Watchdog Timer (WDT)

The watchdog timer (WDT) is organized as a 4-bit up counter and is designed to protect the program from unknown errors. The WDT is enable when the corresponding option code bit of the WDT is set to 1. If the WDT overflows, the chip will be reset. At initial reset, the input clock of the WDT is Fosc/1024. The input clock of the WDT can be switched to Fosc/16384 (or Fosc/1024) by executing the SET PMF, #08H (or CLR PMF, #08H) instruction. The contents of the WDT can be reset by the instruction CLR WDT. In normal operation, the application program must reset WDT before it overflows. A WDT overflow indicates that the operation is not under control and the chip will be reset. The WDT minimum overflow period is 468.75 mS when the system clock (Fosc) is 32 KHz and WDT clock input is Fosc/1024. When the corresponding option code bit of the WDT is set to 0, the WDT function is disabled. The organization of the Divider0 and watchdog timer is shown in Figure 4.

Preliminary W741C20X

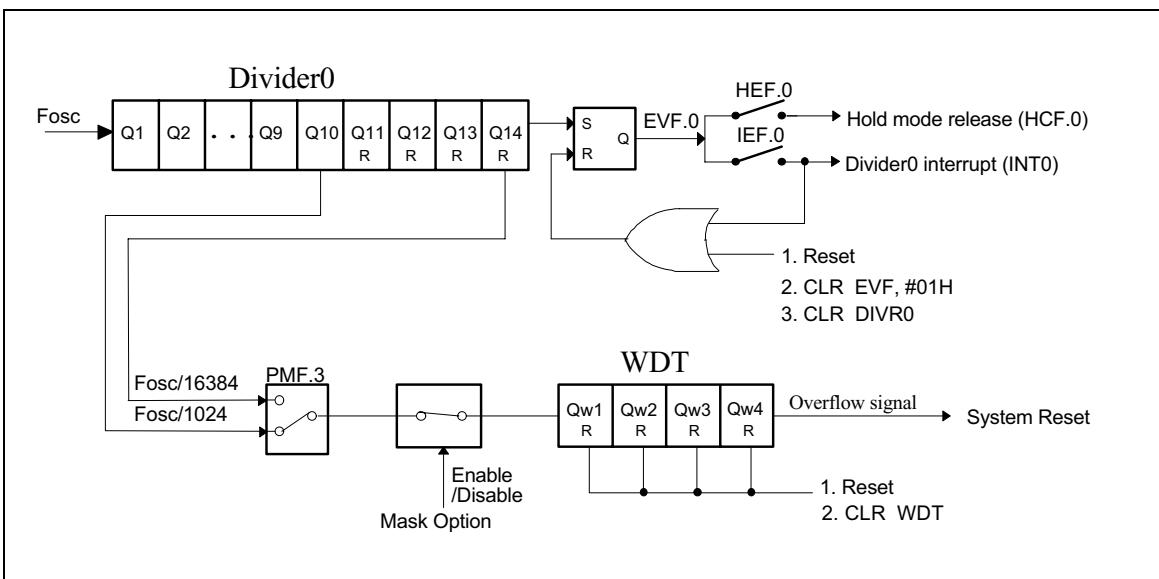


Figure 4. Organization of Divider and Watchdog Timer

Parameter Flag (PMF)

The parameter flag is organized as a 4-bit binary register (PMF.0 to PMF.3). The PMF is controlled by the SET PMF, #I or CLR PMF, #I instruction. The bit descriptions are as follows:

PMF	3	2	1	0
	W	—	—	—

Note: W means write only.

Bit 0, Bit 1 & Bit 2 are reserved.

Bit 3 = 0 The fundamental frequency of the watch dog timer is Fosc/1024.

= 1 The fundamental frequency of the watch dog timer is Fosc/16384.

At initial reset, bit 3 of PMF is set to "0".

Timer/Counter

Timer 0 (TMO)

Timer 0 (TM0) is a programmable 8-bit binary down-counter. The specified value can be loaded into TM0 by executing the MOV TM0L (TM0H), R or MOV TM0, #I instruction. When the MOV TM0L (TM0H), R instructions are executed, the TM0 will stop down-counting (if the TM0 is down-counting), the MR0.3 will be reset to 0, and the specified value is loaded into TM0. If MR0.3 is set to 1, the event flag 1 (EVF.1) is reset and the TM0 starts to count. When it decrements to FFH, Timer 0 stops operating and generates an underflow (EVF.1 = 1). The interrupt is executed if the Timer 0 interrupt enable flag has been set (IEF.1 = 1); and the hold state is terminated if the hold release enable flag 1 has been set (HEF.1 = 1). The Timer 0 clock input can be set as Fosc/1024 or Fosc/4 by setting MR0.0 to 1 or by resetting MR0.0 to 0. The default timer value is Fosc/4. The organization of Timer 0 is shown in Figure 5.

If the Timer 0 clock input is $\text{Fosc}/4$, then:

Desired time 0 interval = (preset value +1) \times 4 \times 1/Fosc

If the Timer 0 clock input is Fosc/1024, then:

Desired time 0 interval = (preset value +1) \times 1024 \times 1/Fosc

Preset value: Decimal number of Timer 0 preset value

Fosc: Clock oscillation frequency

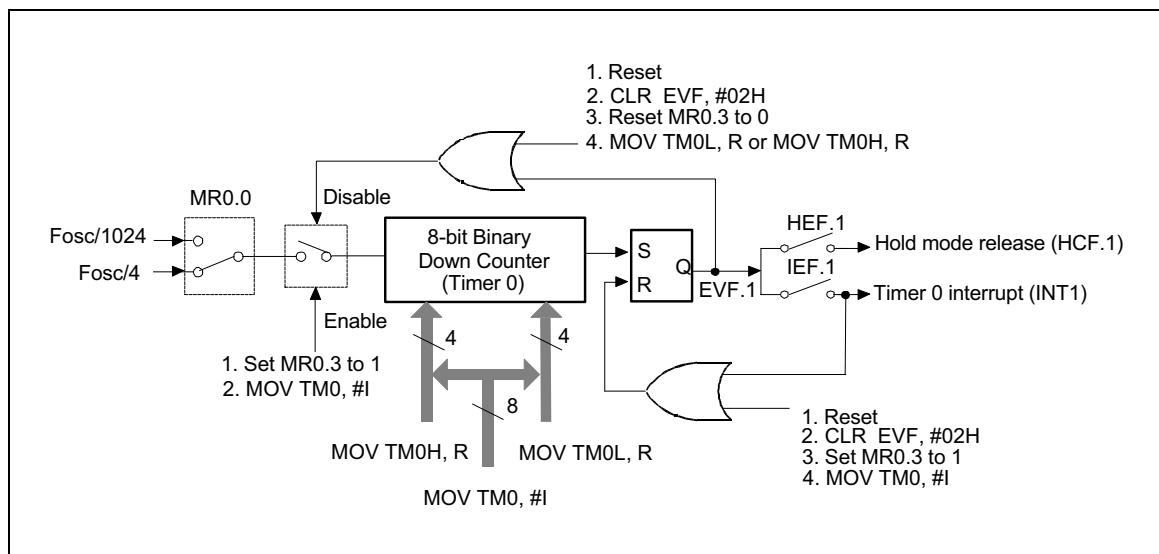


Figure 5. Organization of Timer 0

Timer 1 (TM1)

Timer 1 (TM1) is also a programmable 8-bit binary down counter, as shown in Figure 6. Timer 1 can be used as a counter to count external events or to output an arbitrary frequency to the MFP pin. The input clock of Timer 1 can be one of three sources: Fosc/64, Fosc, or an external clock from the RC.0 input pin. The source can be selected by setting bit 0 and bit 1 of mode register 1 (MR1). At initial reset, the Timer 1 clock input is Fosc. If an external clock is selected as the clock source of Timer 1, the content of Timer 1 is decreased by 1 at the falling edge of RC.0. When the MOV TM1L, R or MOV TM1H,R instruction is executed, the specified data are loaded into the auto-reload buffer and the TM1 down-counting will be disabled (i.e. MR1.3 is reset to 0). If the bit 3 of MR1 is set (MR1.3 = 1), the contents of the auto-reload buffer will be loaded into the TM1 down counter, Timer 1 starts to down count, and the event flag 7 is reset (EVF.7 = 0). When the MOV TM1, #I instruction is executed, the event flag 7 (EVF.7) and MR1.3 are reset and the specified value is loaded into auto-reload buffer and TM1 by the internal hardware, then the MR1.3 is set, that is the TM1 starts to count by the hardware. When the timer decrements to FFH, it will generate an underflow (EVF.7 = 1) and be auto-reloaded with the specified data, after which it will continue to count down. An interrupt is executed if the interrupt enable flag 7 has been set to 1 (IEF.7 = 1), and the hold state is terminated if the hold mode release enable flag 7 is set to 1 (HEF.7 = 1). The specified frequency of Timer 1 can be delivered to the MFP output pin by programming bit 2 of MR1. Bit 3 of MR1 can be used to make Timer 1 stop or start counting.

If the Timer 1 clock input is FT, then:

$$\text{Desired Timer 1 interval} = (\text{preset value} + 1) / F_T$$

$$\text{Desired frequency for MFP output pin} = F_T \div (\text{preset value} + 1) \div 2 \text{ (Hz)}$$

Preset value: Decimal number of Timer 1 preset value, and

Fosc: Clock oscillation frequency

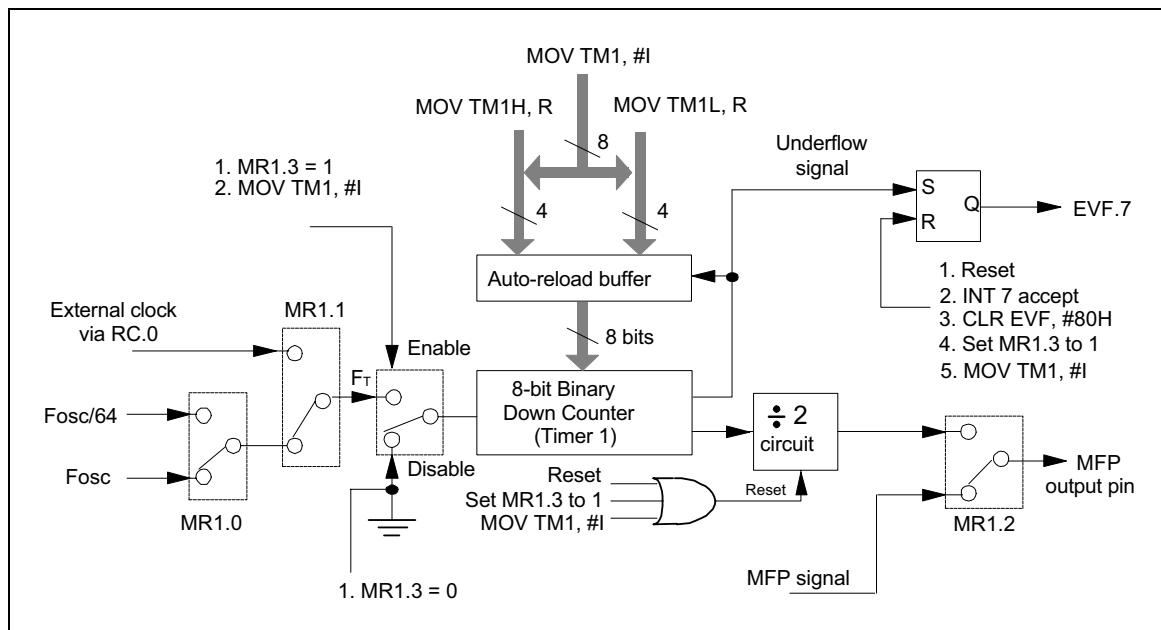


Figure 6. Organization of Timer 1

Preliminary W741C20X



For example, when F_T equals 32768 Hz, depending on the preset value of TM1, the MFP pin will output a single tone signal in the tone frequency range from 64 Hz to 16384 Hz. The relation between the tone frequency and the preset value of TM1 is shown in the table below.

		3rd octave			4th octave			5th octave		
		Tone frequency	TM1 preset value & MFP frequency	Tone frequency	TM1 preset value & MFP frequency	Tone frequency	TM1 preset value & MFP frequency	Tone frequency	TM1 preset value & MFP frequency	
T	C	130.81	7CH	131.07	261.63	3EH	260.06	523.25	1EH	528.51
	C#	138.59	75H	138.84	277.18	3AH	277.69	554.37	1CH	564.96
	D	146.83	6FH	146.28	293.66	37H	292.57	587.33	1BH	585.14
	D#	155.56	68H	156.03	311.13	34H	309.13	622.25	19H	630.15
	E	164.81	62H	165.49	329.63	31H	327.68	659.26	18H	655.36
	F	174.61	5DH	174.30	349.23	2EH	372.36	698.46	16H	712.34
	F#	185.00	58H	184.09	369.99	2BH	390.09	739.99	15H	744.72
	G	196.00	53H	195.04	392.00	29H	420.10	783.99	14H	780.19
	G#	207.65	4EH	207.39	415.30	26H	443.81	830.61	13H	819.20
	A	220.00	49H	221.40	440.00	24H	442.81	880.00	12H	862.84
E	A#	233.08	45H	234.05	466.16	22H	468.11	932.23	11H	910.22
	B	246.94	41H	248.24	493.88	20H	496.48	987.77	10H	963.76

Note: Central tone is A4 (440 Hz).

Mode Register 0 (MR0)

Mode Register 0 is organized as a 4-bit binary register (MR0.0 to MR0.3). MR0 can be used to control the operation of Timer 0. The bit descriptions are as follows:

	3	2	1	0
MR0	W	-	-	W

Note: W means write only.

Bit 0 = 0 The fundamental frequency of Timer 0 is $F_{osc}/4$.

= 1 The fundamental frequency of Timer 0 is $F_{osc}/1024$.

Bit 1 & Bit 2 are reserved

Bit 3 = 0 Timer 0 stops down-counting.

= 1 Timer 0 starts down-counting.



Mode Register 1 (MR1)

Mode Register 1 is organized as a 4-bit binary register (MR1.0 to MR1.3). MR1 can be used to control the operation of Timer 1. The bit descriptions are as follows:

MR1	3	2	1	0
	W	W	W	W

Note: W means write only.

Bit 0 = 0 The internal fundamental frequency of Timer 1 is Fosc.

= 1 The internal fundamental frequency of Timer 1 is Fosc/64.

Bit 1 = 0 The fundamental frequency source of Timer 1 is the internal clock.

= 1 The fundamental frequency source of Timer 1 is the external clock from RC.0 input pin.

Bit 2 = 0 The specified waveform of the MFP generator is delivered at the MFP output pin.

= 1 The specified frequency of Timer 1 is delivered at the MFP output pin.

Bit 3 = 0 Timer 1 stops down-counting.

= 1 Timer 1 starts down-counting.

Input/Output Ports RA, RB

Port RA consists of pins RA.0 to RA.3 and Port RB consists of pins RB.0 to RB.3. At initial reset, input/output ports RA and RB are both in input mode. When RA and RB are used as output ports, CMOS or NMOS open drain output type can be selected by the PM0 register. Each pin of port RA or RB can be specified as input or output mode independently by the PM1 and PM2 registers. The MOVA R, RA or MOVA R, RB instructions operate the input functions and the MOV RA, R or MOV RB, R operate the output functions. For more details, refer to the instruction table and Figure 7.

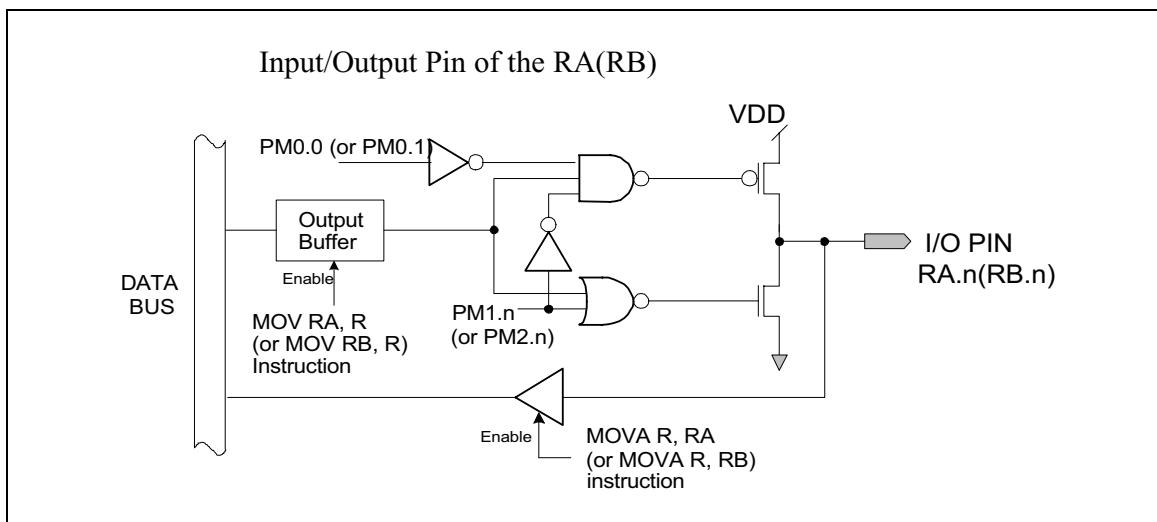


Figure 7. Architecture of RA & RB Input/Output Pins

Preliminary W741C20X



Port Mode 0 Register (PM0)

The port mode 0 register is organized as 4-bit binary register (PM0.0 to PM0.3). PM0 can be used to determine the structure of the input/output ports; it is controlled by the MOV PM0, #I instruction. The bit descriptions are as follows:

PM0	3	2	1	0
	-	-	w	w

Note: W means write only.

Bit 0 = 0 RA port is CMOS output type. Bit 0 = 1 RA port is NMOS open drain output type.

Bit 1 = 0 RB port is CMOS output type. Bit 0 = 1 RB port is NMOS open drain output type.

Bit 2 & Bit 3 are reserved.

Port Mode 1 Register (PM1)

The port mode 1 register is organized as 4-bit binary register (PM1.0 to PM1.3). PM1 can be used to control the input/output mode of port RA. PM1 is controlled by the MOV PM1, #I instruction. The bit descriptions are as follows:

PM1	3	2	1	0
	w	w	w	w

Note: W means write only.

Bit 0 = 0 RA.0 works as output pin; Bit 0 = 1 RA.0 works as input pin

Bit 1 = 0 RA.1 works as output pin; Bit 1 = 1 RA.1 works as input pin

Bit 2 = 0 RA.2 works as output pin; Bit 2 = 1 RA.2 works as input pin

Bit 3 = 0 RA.3 works as output pin; Bit 3 = 1 RA.3 works as input pin

At initial reset, port RA is input mode (PM1 = 1111B).

Port Mode 2 Register (PM2)

The port mode 2 register is organized as 4-bit binary register (PM2.0 to PM2.3). PM2 can be used to control the input/output mode of port RB. PM2 is controlled by the MOV PM2, #I instruction. The bit descriptions are as follows:

PM2	3	2	1	0
	w	w	w	w

Note: W means write only.


Preliminary W741C20X



Bit 0 = 0 RB.0 works as output pin; Bit 0 = 1 RB.0 works as input pin
Bit 1 = 0 RB.1 works as output pin; Bit 1 = 1 RB.1 works as input pin
Bit 2 = 0 RB.2 works as output pin; Bit 2 = 1 RB.2 works as input pin
Bit 3 = 0 RB.3 works as output pin; Bit 3 = 1 RB.3 works as input pin
At initial reset, the port RB is input mode (PM2 = 1111B).

Port Mode 3 register (PM3)

Port Mode 3 Register is organized as a 4-bit binary register (PM3.0 to PM3.3). PM3 can be used to determine the operating mode of the output port RE and the clock rate of the serial I/O function. The PM3 control diagram is shown in Figure 8. The bit descriptions are as follows:

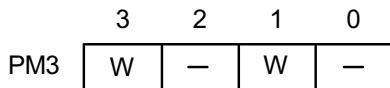

Note: W means write only.

Bit 0 is reserved.

Bit 1 = 0 The output of the port RE is the output of the internal parallel port RT.

= 1 The port RE works as the serial input/output port.

Bit 2 is reserved.

Bit 3 = 0 Serial Tx rate = Fosc/2

= 1 Serial Tx rate = Fosc/256

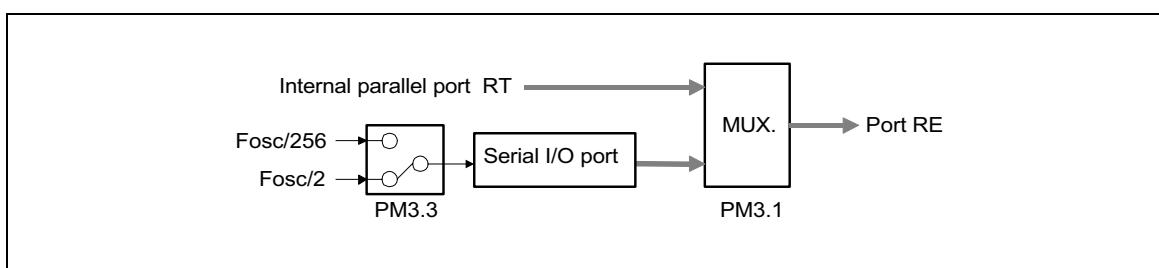


Figure 8. PM3 Control Diagram



Port Mode 4 Register (PM4)

The port mode 4 register is organized as 4-bit binary register (PM4.0 to PM4.3). PM4 can be used to control the input/output mode of port RC. PM4 is controlled by the MOV PM4, #I instruction. The bit descriptions are as follows:

PM4	3	2	1	0
	w	w	w	w

Note: W means write only.

Bit 0 = 0 RC.0 works as output pin; Bit 0 = 1 RC.0 works as input pin

Bit 1 = 0 RC.1 works as output pin; Bit 1 = 1 RC.1 works as input pin

Bit 2 = 0 RC.2 works as output pin; Bit 2 = 1 RC.2 works as input pin

Bit 3 = 0 RC.3 works as output pin; Bit 3 = 1 RC.3 works as input pin

At initial reset, port RC is input mode (PM4 = 1111B).

Port Mode 5 Register (PM5)

The port mode 5 register is organized as 4-bit binary register (PM5.0 to PM5.3). PM5 can be used to control the input/output mode of port RD. PM5 is controlled by the MOV PM5, #I instruction. The bit descriptions are as follows:

PM5	3	2	1	0
	w	w	w	w

Note: W means write only.

Bit 0 = 0 RD.0 works as output pin; Bit 0 = 1 RD.0 works as input pin

Bit 1 = 0 RD.1 works as output pin; Bit 1 = 1 RD.1 works as input pin

Bit 2 = 0 RD.2 works as output pin; Bit 2 = 1 RD.2 works as input pin

Bit 3 = 0 RD.3 works as output pin; Bit 3 = 1 RD.3 works as input pin

At initial reset, the port RB is input mode (PM2 = 1111B).

Input/Output Ports RC, RD

Port RC consists of pins RC.0 to RC.3, and port RD consists of pins RD.0 to RD.3. At initial reset, input/output ports RC and RD are both in input mode. When RC and RD are used as output ports, the CMOS type is the only output driving type. Each pin of port RC or RD can be specified as input or output mode independently by the PM4 and PM5 registers. The MOVA R, RC or MOVA R, RD instructions operate the input functions and the MOV RC, R or MOV RD, R operate the output functions. When the PEF, HEF, and IEF corresponding to the RC port are set, a signal change at the specified pins of port RC will execute the hold mode release or interrupt subroutine. Port status register 0 (PSR0) records the status of port RC, and that can be read out and cleared by the MOV R, PSR0, and CLR PSR0 instructions. Before the port mode of the RC port is changed from output mode to input mode in the hold mode release and interrupt application, the output value must be preset to the same as the system status to prevent the undesired signal change being accepted.

Preliminary W741C20X



When the interrupt of RC port is accepted, the corresponding event flag (EVF.2) will be reset, but the content of PSR0 should not be changed except the CLR PSR0 or MOV PEF, #1 instruction being executed or performing the reset function. In addition, the falling edge signal on the pin of port RC specified by the instruction MOV SEF, #1 will cause the device to exit the stop mode. The RD port is used as the I/O port only. Refer to Figure 9, Figure 10 and the instruction table for more details.

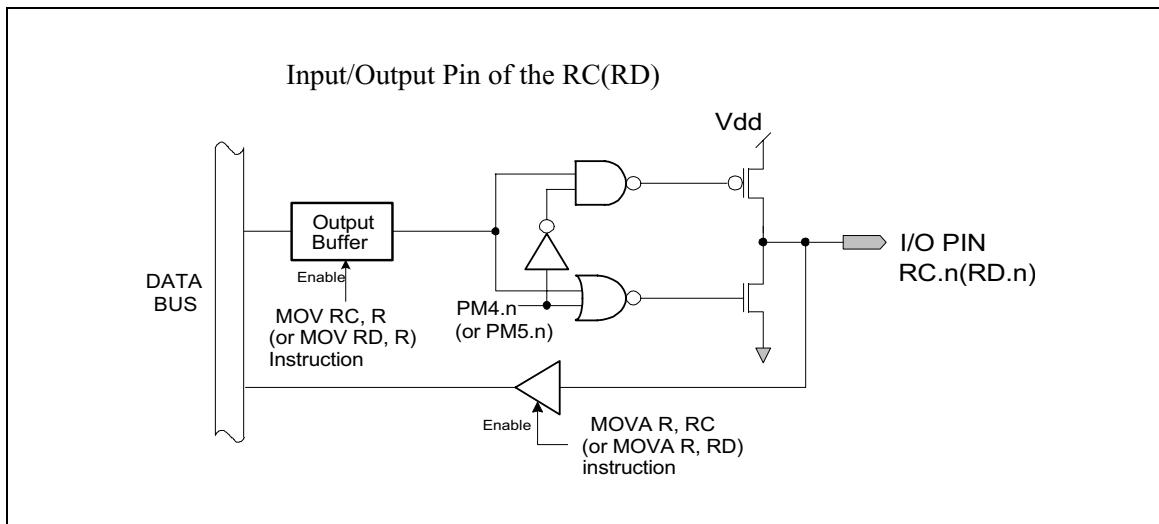


Figure 9. Architecture of RC & RD Input/Output Pins

Port Enable Flag (PEF)

The port enable flag is organized as 4-bit binary register (PEF.0 to PEF.3). Before port RC may be used to release the hold mode or perform interrupt function, the content of the PEF must be set first. The PEF is controlled by the MOV PEF, #1 instruction. The bit descriptions are as follows:

PEF	3	2	1	0
	w	w	w	w

Note: W means write only.

PEF.0: Enable/disable the signal change at pin RC.0 to release hold mode or perform interrupt.

PEF.1: Enable/disable the signal change at pin RC.1 to release hold mode or perform interrupt.

PEF.2: Enable/disable the signal change at pin RC.2 to release hold mode or perform interrupt.

PEF.3: Enable/disable the signal change at pin RC.3 to release hold mode or perform interrupt.

Port Status Register 0 (PSR0)

Port status register 0 is organized as 4-bit binary register (PSR0.0 to PSR0.3). PSR0 can be read or cleared by the MOVA R, PSR0, and CLR PSR0 instructions. The bit descriptions are as follows:

PSR0	3	2	1	0
	R	R	R	R

Note: R means read only.

Bit 0 = 1 Signal change at RC.0
Bit 1 = 1 Signal change at RC.1
Bit 2 = 1 Signal change at RC.2
Bit 3 = 1 Signal change at RC.3

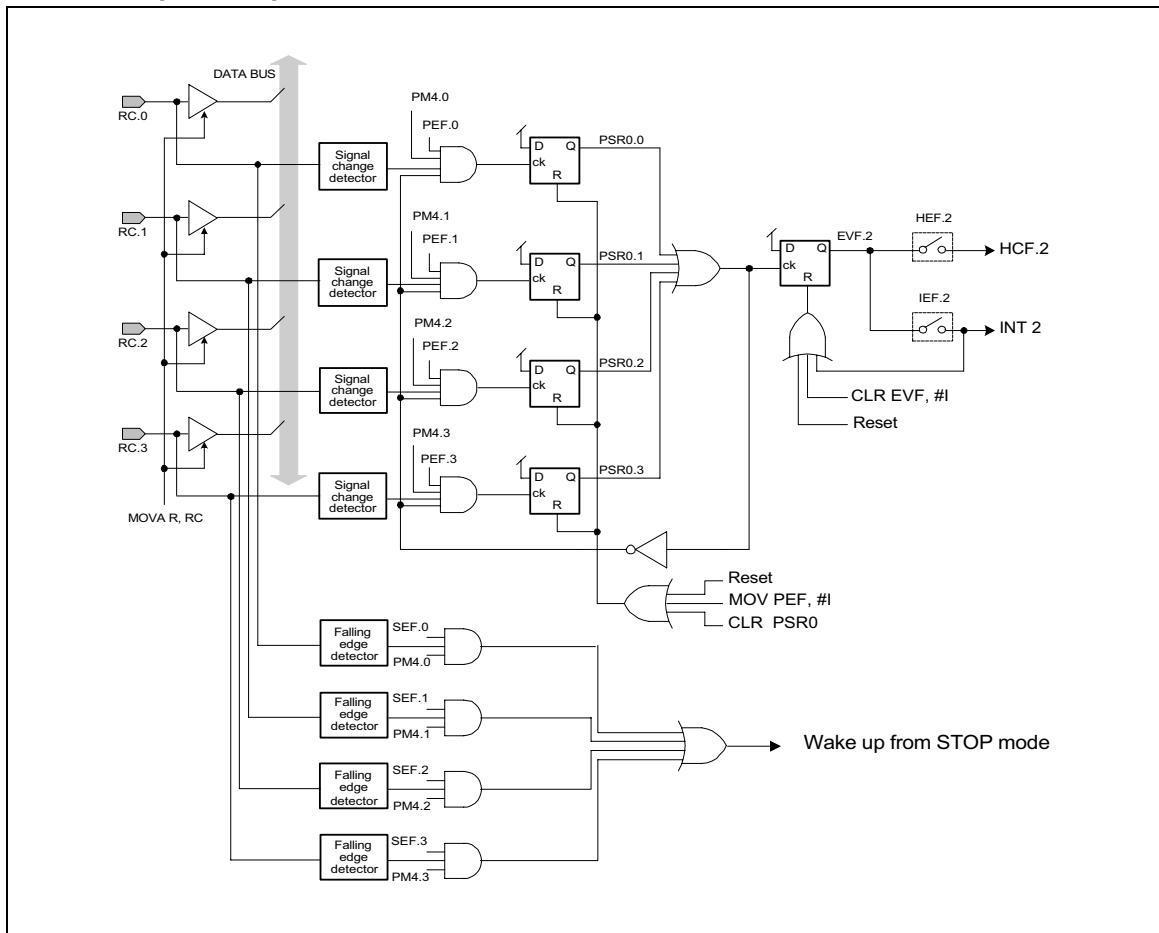


Figure 10. Input Architecture of Ports RC

Output Port RE

Output port RE can be used as an output of the internal RT port, or as a serial input/output port. The control flow is shown in Figure 8. When bit 1 of port mode 3 register (PM3) equals to 0, port RE works as an output of internal port RT. When the MOV RE, R instruction is executed, the data in the RAM will be output to port RT through port RE. When RE works as a parallel output port, it provides a high sink current to drive LEDs. When bit 1 of PM3 equals to 1, the RE port works as a serial input/output port, and RE.0 to RE.3 are used as DOUT, CLKO, DIN, and CLKI, respectively. In this case, the DIN pin will have a built-in pull-high resistor. The serial I/O functions are controlled by the instructions SOP R and SIP R. The functions of the two instructions are described below:

Preliminary W741C20X



(1) When the SIP R instruction is executed, the data will be loaded from the serial input buffer to the ACC and RAM first, and bit 1 of port status register 2 will automatically be set to "1" (BUSYI = 1). Then the CLKI pin will send out 8 clocks and the data from the DIN pin will be loaded to SIB at the rising edge of the CLKI pin. After the 8 clocks have been sent, BUSYI will be reset to "0" and EVF.5 will be set to "1." At this time, if IEF.5 has been set (IEF.5 = 1), an interrupt is executed; if HEF.5 has been set (HEF.5 = 1), the hold state is terminated. Users can check the status of PSR2.1 (BUSYI) to know whether the serial input process is completed or not. If a serial input process is not completed, and the SIP R instruction is executed again, the data will be lost. The timing is shown in Figure 11.

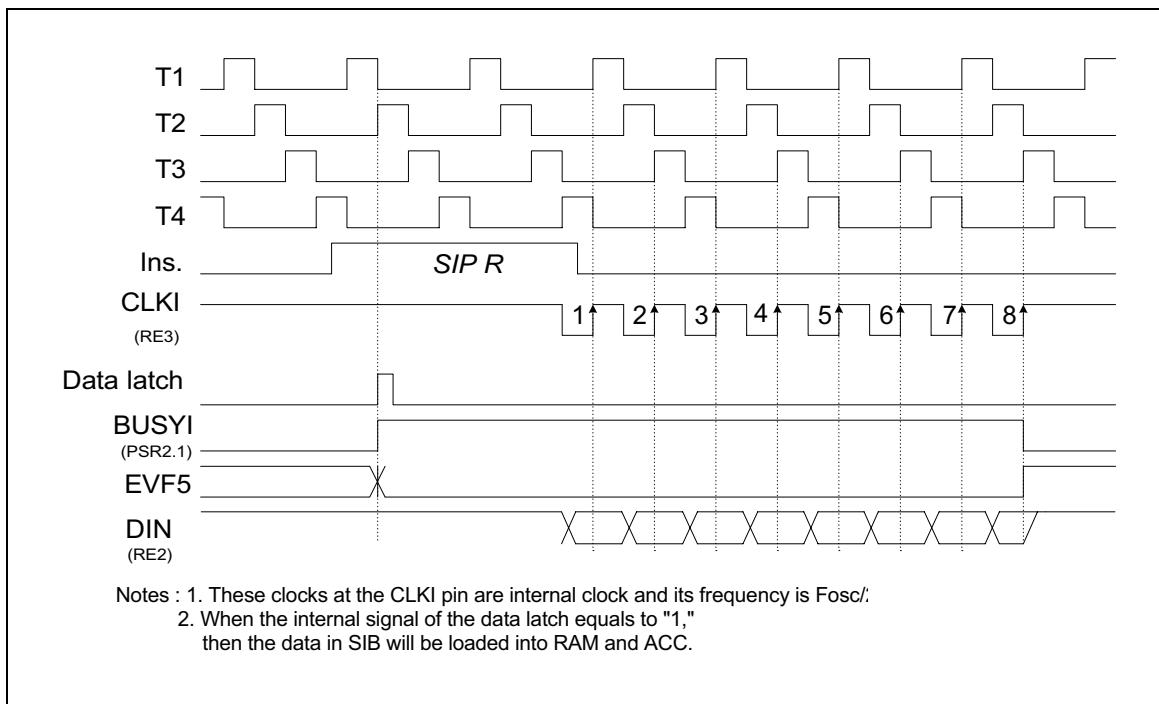


Figure 11. Timing of the Serial Input Function (SIP R)

(2) When the SOP R instruction is executed, the data will be loaded to the serial output buffer (SOB) and bit 3 of port status register 2 will be set to "1" (BUSY_O = 1). Then the CLKO pin will send out 8 clocks and the data in SOB will be sent out at the falling edge of the CLKO pin. After the 8 clocks have been sent, BUSY_O will be reset to "0" and EVF.6 will be set to "1." At this time, if IEF.6 has been set (IEF.6 = 1), an interrupt is executed; if HEF.6 has been set (HEF.6 = 1), the hold state is terminated. Users can check the status of PSR2.3 (BUSY_O) to know whether the serial output process is completed or not. If a serial output process is not completed, and the SOP R instruction is executed again, the data will be lost. The timing is shown in Figure 12.

Preliminary W741C20X

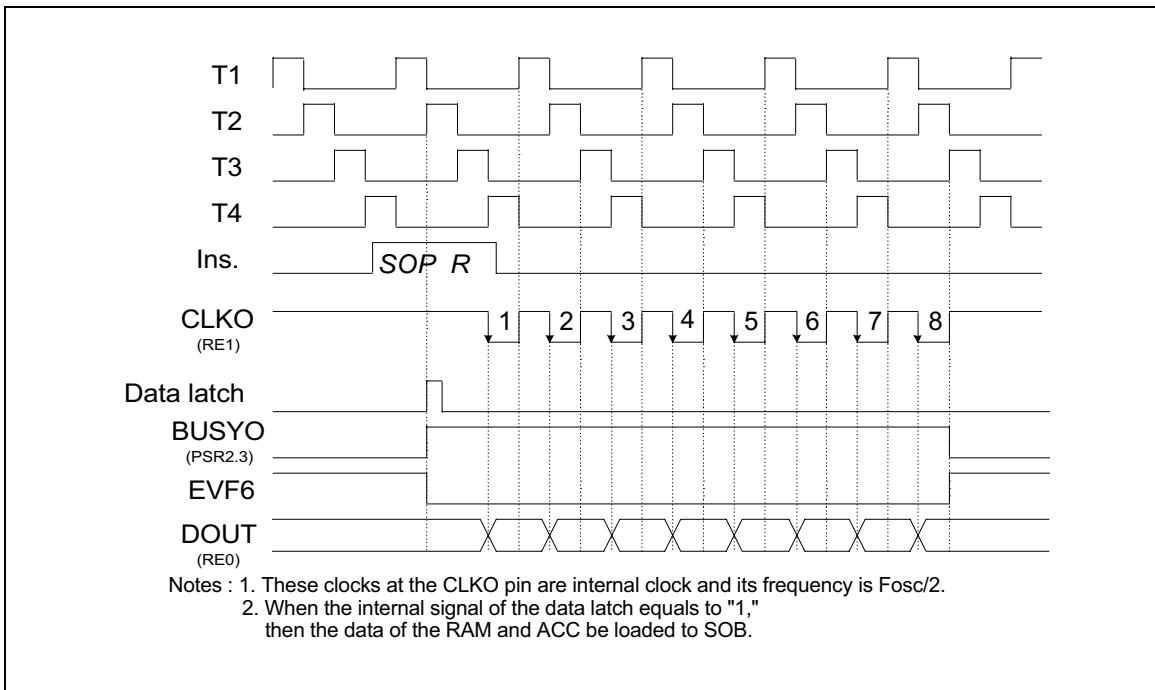


Figure 12. Timing of the Serial Output Function (SOP R)

In the above description, the low nibble location of the serial input/output register is contributed to the ACC, and the high nibble is to R. The port status register 2 (PSR2) including BUSYI, and BUSYO can be read out or cleared by the MOVA R, PSR2, or CLR PSR2 instruction.

Port Status Register 2 (PSR2)

Port status register 2 is organized as 4-bit binary register (PSR2.0 to PSR2.3). PSR2 is controlled by the MOVA R, PSR2, and CLR PSR2 instructions. The bit descriptions are as follows:

PSR2	3	2	1	0
	R	-	R	-

Note: R means read only.

Bit 0 is reserved.

Bit 1 (BUSYI): Serial port input busy flag.

Bit 2 is reserved.

Bit 3 (BUSYO): Serial port output busy flag.

Preliminary W741C20X



MFP Output Pin (MFP)

The MFP output pin can output the Timer 1 clock or the modulation frequency; the output of the pin is determined by mode register 1 (MR1). The organization of MR1 is shown in Figure 6. When bit 2 of MR1 is reset to "0," the MFP output can deliver a modulation output in any combination of one signal from among DC, 4096Hz, 2048Hz, and one or more signals from among 128 Hz, 64 Hz, 8 Hz, 4 Hz, 2 Hz, or 1 Hz (when using a 32.768 KHz crystal). The MOV MFP, #1 instruction is used to specify the modulation output combination. The data specified by the 8-bit operand and the MFP output pin are shown as below.

(Fosc = 32.768 KHz)

R7 R6	R5	R4	R3	R2	R1	R0	FUNCTION
0 0	0	0	0	0	0	0	Low level
	0	0	0	0	0	1	128 Hz
	0	0	0	0	1	0	64 Hz
	0	0	0	1	0	0	8 Hz
	0	0	1	0	0	0	4 Hz
	0	1	0	0	0	0	2 Hz
	1	0	0	0	0	0	1 Hz
0 1	0	0	0	0	0	0	High level
	0	0	0	0	0	1	128 Hz
	0	0	0	0	1	0	64 Hz
	0	0	0	1	0	0	8 Hz
	0	0	1	0	0	0	4 Hz
	0	1	0	0	0	0	2 Hz
	1	0	0	0	0	0	1 Hz
1 0	0	0	0	0	0	0	2048 Hz
	0	0	0	0	0	1	2048 Hz * 128 Hz
	0	0	0	0	1	0	2048 Hz * 64 Hz
	0	0	0	1	0	0	2048 Hz * 8 Hz
	0	0	1	0	0	0	2048 Hz * 4 Hz
	0	1	0	0	0	0	2048 Hz * 2 Hz
	1	0	0	0	0	0	2048 Hz * 1 Hz
1 1	0	0	0	0	0	0	4096 Hz
	0	0	0	0	0	1	4096 Hz * 128 Hz
	0	0	0	0	1	0	4096 Hz * 64 Hz
	0	0	0	1	0	0	4096 Hz * 8 Hz
	0	0	1	0	0	0	4096 Hz * 4 Hz
	0	1	0	0	0	0	4096 Hz * 2 Hz
	1	0	0	0	0	0	4096 Hz * 1 Hz

Preliminary W741C20X



Interrupts

The W741C20X provides five internal interrupt sources (Divider 0, Timer 0, Timer 1, serial I/O) and two external interrupt sources (INT, port RC). Vector addresses for each of the interrupts are located in the range of program memory (ROM) addresses 004H to 020H. The flags IEF, PEF, and EVF are used to control the interrupts. When EVF is set to "1" by hardware and the corresponding bits of IEF and PEF have been set by software, an interrupt is generated. When an interrupt occurs, all of the interrupts are inhibited until the EN INT or MOV IEF, #1 instruction is invoked. The interrupts can also be disabled by executing the DIS INT instruction. When an interrupt is generated in hold mode, the hold mode will be released momentarily and interrupt subroutine will be executed. After the RTN instruction is executed in an interrupt subroutine, the μ C will enter hold mode again. The operation flow chart is shown in Figure 14. The control diagram is shown below.

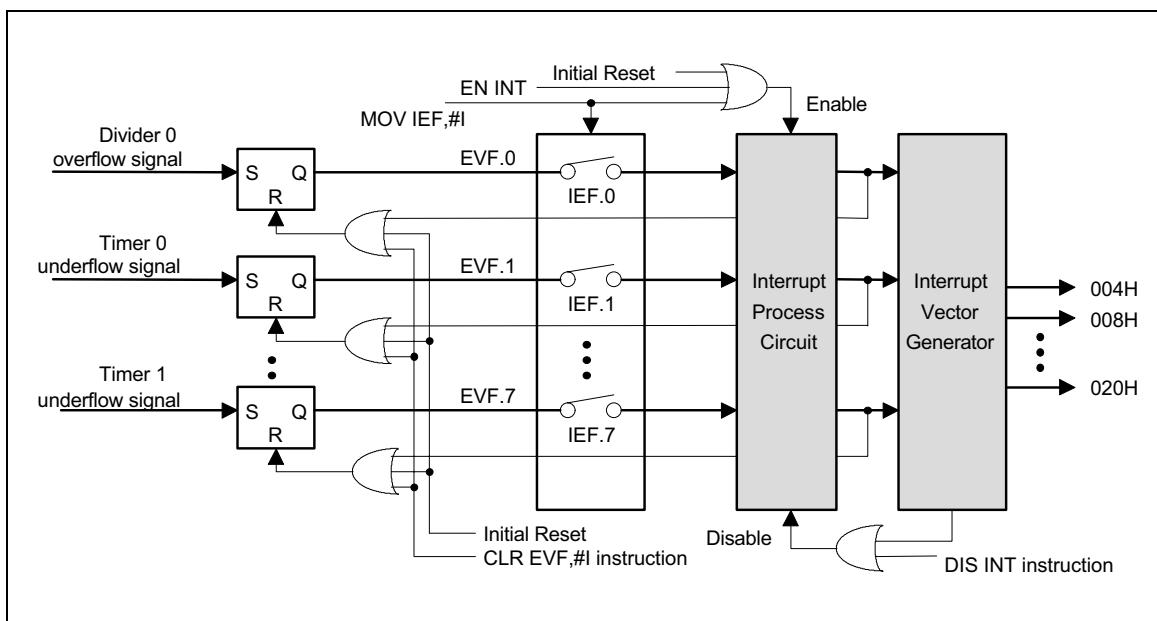


Figure 13. Interrupt event control diagram

Interrupt Enable Flag (IEF)

The interrupt enable flag is organized as an 8-bit binary register (IEF.0 to IEF.7). These bits are used to control the interrupt conditions. It is controlled by the `MOV IEF, #I` instruction. When one of these interrupts is accepted, the corresponding bit of the event flag will be reset, but the other bits are unaffected. In interrupt subroutine, these interrupts will be disabled till the instruction `MOV IEF, #I` or `EN INT` is executed again. To enable these interrupts, the instructions `MOV IEF, #I` or `EN INT` must be executed again. Otherwise, these interrupts can be disabled by executing `DIS INT` instruction. The bit descriptions are as follows:

	7	6	5	4	3	2	1	0
IEF	w	w	w	w	—	w	w	w

Note: W means write only.



- IEF.0 = 1 Interrupt 0 is accepted by overflow from the Divider 0.
- IEF.1 = 1 Interrupt 1 is accepted by underflow from the Timer 0.
- IEF.2 = 1 Interrupt 2 is accepted by a signal change at port RC.
- IEF.3 is reserved.
- IEF.4 = 1 Interrupt 4 is accepted by a falling edge signal at the INT pin.
- IEF.5 = 1 Interrupt 5 is accepted by the serial port received completely.
- IEF.6 = 1 Interrupt 6 is accepted by the serial port transmitted completely.
- IEF.7 = 1 Interrupt 7 is accepted by underflow from Timer 1.

External INT

The external interrupt INT pin contains a pull-up resistor. When the HEF.4 or IEF.4 flag is set, the falling edge of the INT pin will execute the hold mode release or interrupt subroutine. A low level on the INT pin will release the stop mode.

Stop Mode Operation

In stop mode, all operations of the μ C cease (including the operation of the oscillator). The μ C enters stop mode when the STOP instruction is executed and exits stop mode when an external trigger is activated (by a low level on the INT pin or a falling signal on the RC port). When the designated signal is accepted, the μ C awakens and warms up, and then executes the next instruction.

Stop Mode Wake-up Enable Flag for Ports RC (SEF)

The stop mode wake-up flag for ports RC is organized as a 4-bit binary register (SEF.0 to SEF.3). Before port RC may be used to make the device exit the stop mode, the content of the SEF must be set first. The SEF is controlled by the MOV SEF, #I instruction. The bit descriptions are as follows:

	3	2	1	0
SEF	w	w	w	w

Note: W means write only.

- SEF 0 = 1 Device will exit stop mode when falling edge signal is applied to pin RC.0
- SEF 1 = 1 Device will exit stop mode when falling edge signal is applied to pin RC.1
- SEF 2 = 1 Device will exit stop mode when falling edge signal is applied to pin RC.2
- SEF 3 = 1 Device will exit stop mode when falling edge signal is applied to pin RC.3

Hold Mode Operation

In hold mode, all operations of the μ C cease, except for the operation of the oscillator and timer. The μ C enters hold mode when the HOLD instruction is executed. The hold mode can be released in one of five ways: by the action of timer 0, timer 1, the divider, the INT pin, the RC port. Before the device enters the hold mode, the HEF, PEF, and IEF flags must be set to define the hold mode release conditions. For more details, refer to the instruction-set table and the following flow chart.

Preliminary W741C20X

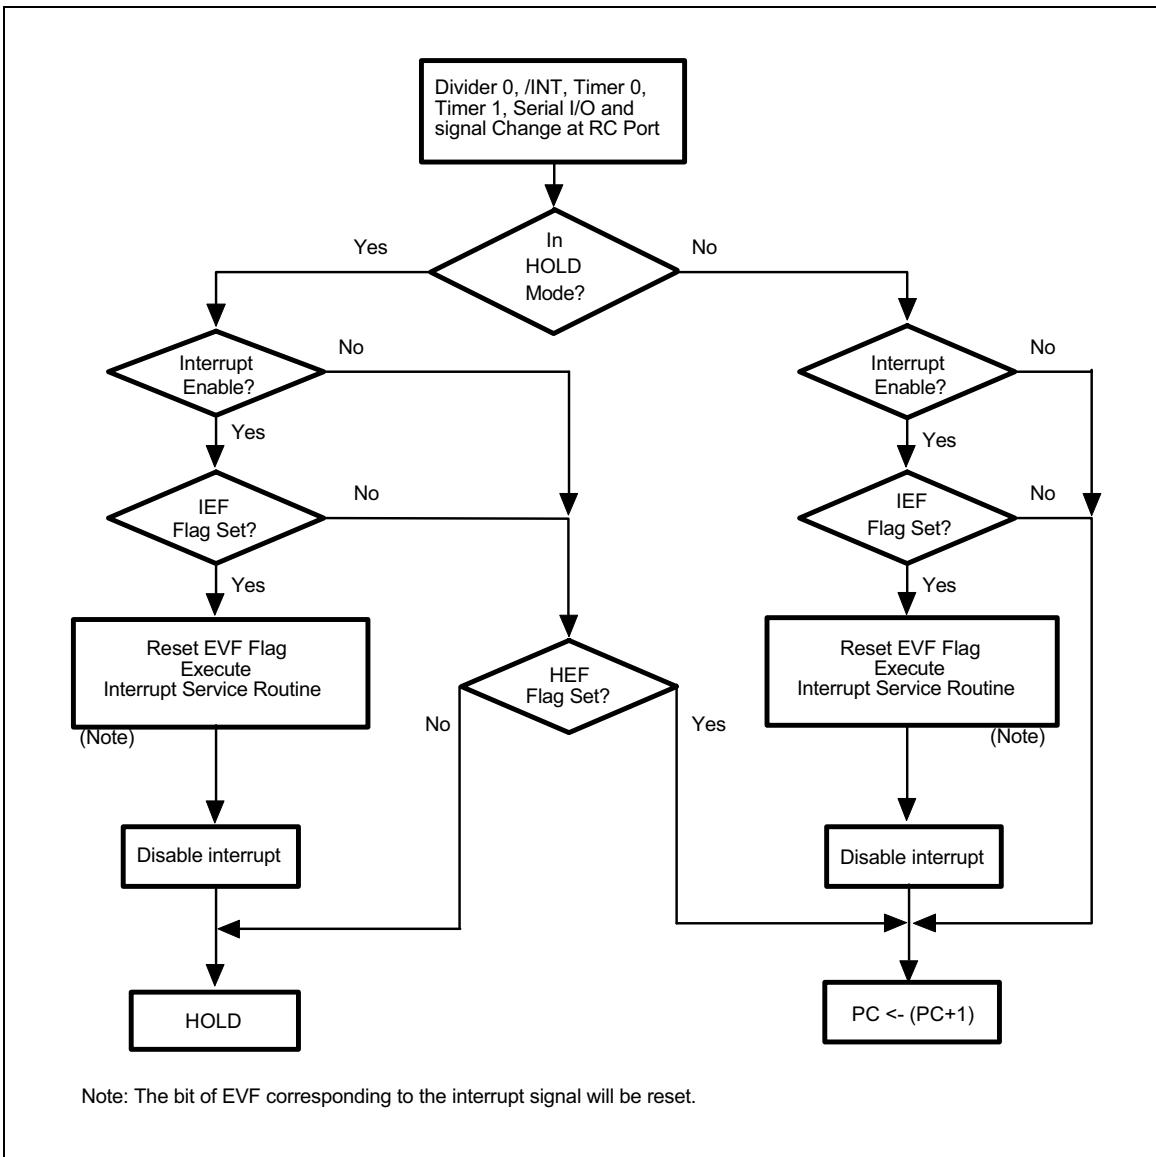


Figure 14. Hold Mode and Interrupt Operation Flow Chart

Preliminary W741C20X



Hold Mode Release Enable Flag (HEF)

The hold mode release enable flag is organized as an 8-bit binary register (HEF.0 to HEF.7). The HEF is used to control the hold mode release conditions. It is controlled by the MOV HEF, #I instruction. The bit descriptions are as follows:

HEF	7	6	5	4	3	2	1	0
	w	w	w	w	-	w	w	w

Note: W means write only.

HEF.0 = 1 Overflow from the Divider 0 causes Hold mode to be released.

HEF.1 = 1 Underflow from Timer 0 causes Hold mode to be released.

HEF.2 = 1 Signal change at port RC causes Hold mode to be released.

HEF.3 is reserved.

HEF.4 = 1 Falling edge signal at the INT pin causes Hold mode to be released.

HEF.5 = 1 The serial port received completely causes Hold mode to be released.

HEF.6 = 1 The serial port transmitted completely causes Hold mode to be released.

HEF.7 = 1 Underflow from Timer 1 causes Hold mode to be released.

Hold Mode Release Condition Flag (HCF)

The hold mode release condition flag is organized as a 8-bit binary register (HCF0 to HCF7). It indicates by which interrupt source the hold mode has been released, and is loaded by hardware. The HCF can be read out by the MOVA R, HCFL and MOVA R, HCFH instructions. When any of the HCF bits is "1," the hold mode will be released and the HOLD instruction is invalid. The HCF can be reset by the CLR EVF or MOV HEF,#I (HEF = 0) instructions. When EVF and HEF have been reset, the corresponding bit of HCF is reset simultaneously. The bit descriptions are as follows:

HCF	7	6	5	4	3	2	1	0
	R	R	R	R	-	R	R	R

Note: R means read only.

HCF.0 = 1 Hold mode was released by overflow from the Divider 0

HCF.1 = 1 Hold mode was released by underflow from the timer 0

HCF.2 = 1 Hold mode was released by a signal change at port RC

HCF.3 is reserved.

HCF.4 = 1 Hold mode was released by a falling edge signal at the INT pin

HCF.5 = 1 Hold mode was released by underflow from the timer 1

HCF.6 = 1 Hold mode was released by the serial port received completely.

HCF.7 = 1 Hold mode was released by the serial port transmitted completely.

Preliminary W741C20X



Event Flag (EVF)

The event flag is organized as a 8-bit binary register (EVF0 to EVF7). It is set by hardware and reset by CLR EVF,#I instruction or the occurrence of an interrupt. The bit descriptions are as follows:

	7	6	5	4	3	2	1	0
EVF	R	R	R	R	—	R	R	R

Note: R means read only.

EVF.0 = 1 Overflow from Divider 0 occurred.

EVF.1 = 1 Underflow from Timer 0 occurred.

EVF.2 = 1 Signal change at port RC occurred.

EVF.3 is reserved.

EVF.4 = 1 Falling edge signal at the \overline{INT} pin occurred.

EVF.5 = 1 The serial port received completely.

EVF.6 = 1 The serial port transmitted completely.

EVF.7 = 1 Underflow from Timer 1 occurred.

Reset Function

The W741C20X is reset either by a power-on reset or by using the external \overline{RES} pin. The initial state of the W741C20X after the reset function is executed is described below.

Program Counter (PC)	000H
TM0, TM1	Reset
MR0, MR1, PAGE registers	Reset
PSR0, PSR2, PM3 registers	Reset
IEF, HEF, HCF, PEF, EVF, SEF flags	Reset
Timer 0 input clock	Fosc/4
Timer 1 input clock	Fosc
MFP output	Low
Input/output ports RA, RB	Input mode
Input/output ports RC, RD	Input mode
Output port RE	High
RA and RB ports output type	CMOS type
Input clock of the watchdog timer	Fosc/1024

Preliminary W741C20X



ABSOLUTE MAXIMUM RATINGS

PARAMETER	RATING	UNIT
Supply Voltage to Ground Potential	-0.3 to +7.0	V
Applied Input/Output Voltage	-0.3 to +7.0	V
Power Dissipation	120	mW
Ambient Operating Temperature	0 to +70	°C
Storage Temperature	-55 to +150	°C

Note: Exposure to conditions beyond those listed under Absolute Maximum Ratings may adversely affect the life and reliability of the device.

DC CHARACTERISTICS

(V_{DD}-V_{SS} = 3.0V, Fosc. = 32.768 KHz, Ta = 25° C; unless otherwise specified)

PARAMETER	SYM.	CONDITIONS	MIN.	TYP.	MAX.	UNIT
Op. Voltage	V _{DD}	-	2.2	-	5.5	V
Op. Current (Crystal type)	I _{OP1}	No load (Ext-V)	-	8	20	µA
Op. Current (RC type)	I _{OP2}	No load (Ext-V)	-	35	65	µA
Hold Current (Crystal type)	I _{HM1}	Hold mode No load (Ext-V)	-	4	6	µA
Hold Current (RC type)	I _{HM2}	Hold mode No load (Ext-V)	-	16	40	µA
Stop Current (Crystal type)	I _{SM1}	Stop mode No load (Ext-V)	-	0.1	2	µA
Stop Current (RC type)	I _{SM2}	Stop mode No load (Ext-V)	-	0.1	2	µA
Input Low Voltage	V _{IL}	-	V _{SS}	-	0.3 V _{DD}	V
Input High Voltage	V _{IH}	-	0.7 V _{DD}	-	V _{DD}	V
MFP Output Low Voltage	V _{ML}	I _{OL} = 3.5 mA	-	-	0.4	V
MFP Output High Voltage	V _{MH}	I _{OH} = -3.5 mA	2.4	-	-	V
Port RA, RB Sink Current	I _{ABL}	V _{OL} = 0.9V	9	-	-	mA
Port RA, RB Source Current	I _{ABH}	V _{OH} = 2.4V	0.4	1.2	-	mA
Port RC, RD Output Low Voltage	V _{CDL}	I _{OL} = 2.0 mA	-	-	0.4	V
Port RC, RD Output High Voltage	V _{CDH}	I _{OH} = -2.0 mA	2.4	-	-	V
Port RE Sink Current	I _{EL}	V _{OL} = 0.9V	9	-	-	mA
Port RE Source Current	I _{EH}	V _{OH} = 2.4V	0.4	1.2	-	mA

Preliminary W741C20X



DC Characteristics, continued

PARAMETER	SYM.	CONDITIONS	MIN.	TYP.	MAX.	UNIT
INT Pull-up Resistor	RINT	-	50	250	1000	KΩ
DIN Pin Pull-up Resistor	RDIN	RE.2 used as serial input pin	50	250	1000	KΩ
RES Pull-up Resistor	RRES	-	20	100	500	KΩ

AC CHARACTERISTICS


(V_{DD}-V_{SS} = 3.0 V, Ta = 25° C; unless otherwise specified)

PARAMETER	SYM.	CONDITIONS	MIN.	TYP.	MAX.	UNIT
Op. Frequency	Fosc	RC type	-	-	4000	KHz
		Crystal type 1 (Option low speed type)	-	32.768	-	
		Crystal type 2 (Option high speed type)	400	-	4190	
Frequency Deviation by Voltage drop for RC Oscillator	$\frac{\Delta f}{f}$	$f(3V) - f(2.4V)$ $f(3V)$	-	-	10	%
Instruction Cycle Time	T _I	One machine cycle	-	4/FOSC	-	S
Serial Port Data Ready Time	T _{DR}	-	200	-	-	nS
Serial Port Data Hold Time	T _{DH}	-	200	-	-	nS
Reset Active Width	T _{RAW}	FOSC = 32.768 KHz	1	-	-	μS
Interrupt Active Width	T _{IAW}	FOSC = 32.768 KHz	1	-	-	μS

Preliminary W741C20X




PAD ASSIGNMENT & POSITIONS

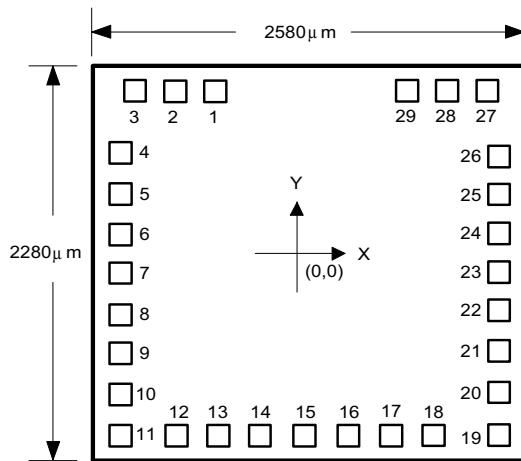

Note: The chip substrate must be connected to system ground (Vss).

PAD NO.	PAD NAME	X	Y	PAD NO.	PAD NAME	X	Y
1	RA2	-576.30	943.70	16	RC0	215.10	-965.00
2	RA3	-819.50	943.70	17	RC1	476.30	-965.00
3	INT	-1063.00	943.70	18	RC2	722.30	-965.00
4	RES	-1115.00	671.70	19	RC3	1113.90	-959.30
5	Vss	-1115.00	464.20	20	VDD	1113.90	-749.30
6	RE0	-1115.00	207.00	21	RD0	1113.90	-492.10
7	RE1	-1115.00	-21.00	22	RD1	1113.90	-264.10
8	RE2	-1115.00	-264.20	23	RD2	1113.90	-20.90
9	RE3	-1115.00	-492.20	24	RD3	1113.90	207.10
10	Vss	-1115.00	-749.40	25	VDD	1113.90	464.30
11	RB0	-1115.00	-965.00	26	XOUT	1113.90	738.00
12	RB1	-813.30	-965.00	27	XIN	1061.30	943.70
13	RB2	-552.10	-965.00	28	RA0	752.20	943.70
14	RB3	-302.10	-965.00	29	RA1	509.00	943.70
15	MFP	-40.90	-965.00				

TYPICAL APPLICATION CIRCUIT

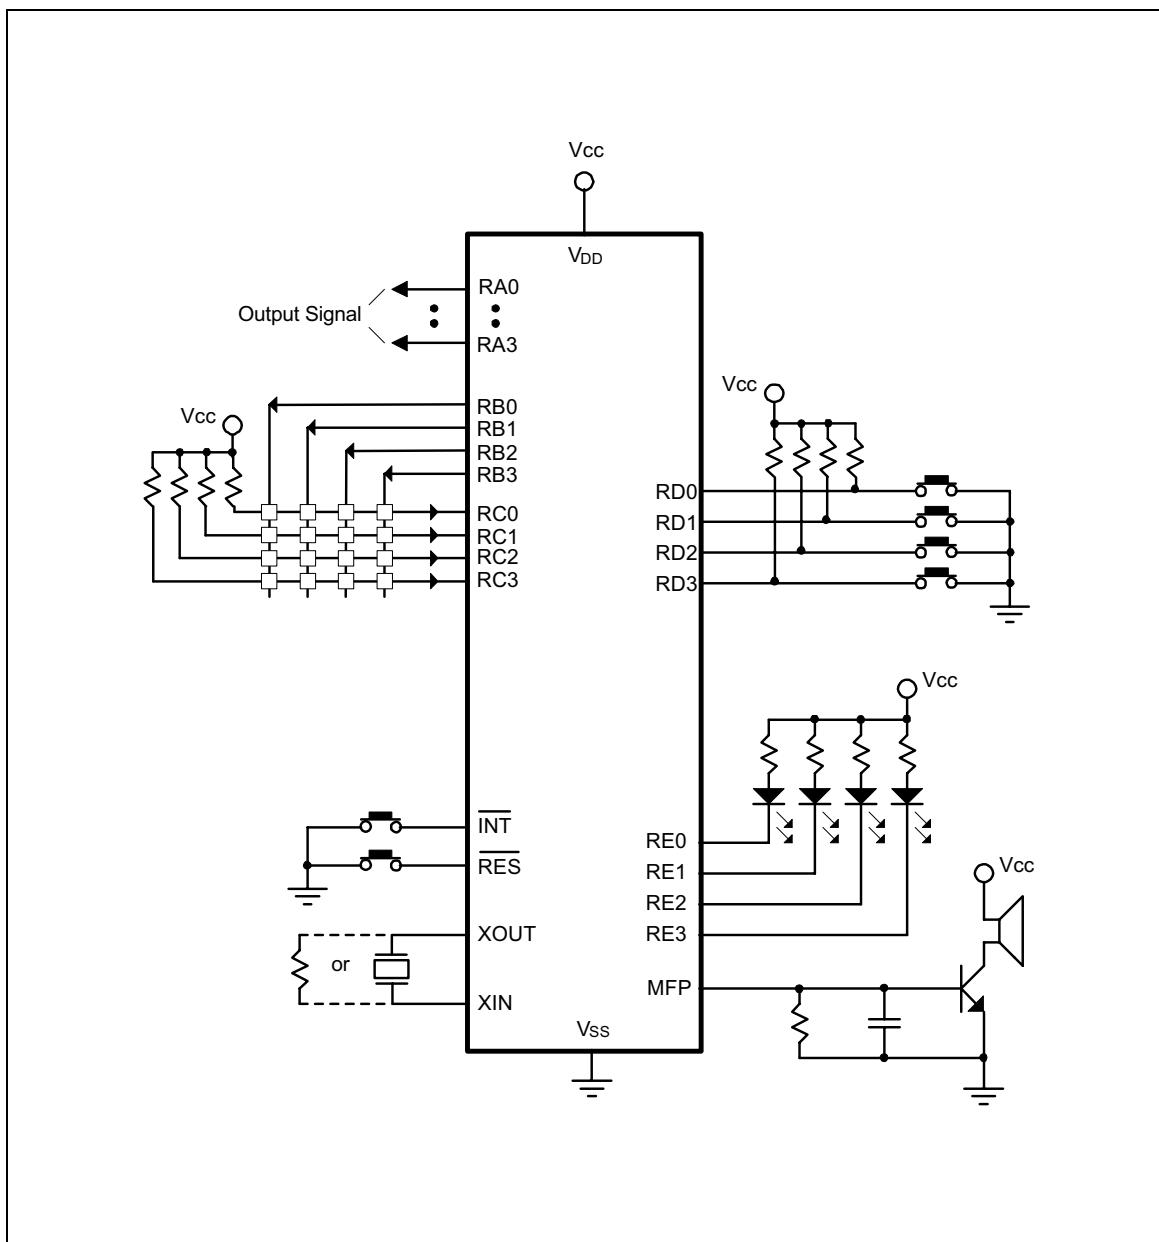

INSTRUCTION SET TABLE

Symbol Description

ACC:	Accumulator
ACC.n:	Accumulator bit n
WR:	Working Register
PAGE:	Page Register
MR0:	Mode Register 0
MR1:	Mode Register 1
PM0:	Port Mode 0
PM1:	Port Mode 1
PM2:	Port Mode 2
PM3:	Port Mode 3
PM4:	Port Mode 4
PM5:	Port Mode 5
PSR0:	Port Status Register 0
PSR2:	Port Status Register 2
R:	Memory (RAM) of address R
R.n:	Memory bit n of address R
I:	Constant parameter
L:	Branch or jump address
CF:	Carry Flag
ZF:	Zero Flag
PC:	Program Counter
TM0L:	Low nibble of the Timer 0 counter
TM0H:	High nibble of the Timer 0 counter
TM1L:	Low nibble of the Timer 1 counter
TM1H:	High nibble of the Timer 1 counter
TABL:	Low nibble of the look-up table address buffer
TABH:	High nibble of the look-up table address buffer
IEF.n:	Interrupt Enable Flag n
HCF.n:	HOLD mode release Condition Flag n
HEF.n:	HOLD mode release Enable Flag n
SEF.n:	STOP mode wake-up Enable Flag n
PEF.n:	Port Enable Flag n

Preliminary W741C20X



Continued

EVF.n: Event Flag n
 !=: Not equal
 &: AND
 ^: OR
 EX: Exclusive OR
 ←: Transfer direction, result

[PAGE*10H+()]: Contents of address PAGE(bit2, bit1, bit0)*10H+()
 [P()): Contents of port P

INSTRUCTION SET TABLE 1

Mnemonic	Function		Flag Affected	Cycle
Arithmetic				
ADD	R, ACC	ACC←(R) + (ACC)	ZF, CF	1
ADD	WR, #I	ACC←(WR) + I	ZF, CF	1
ADDR	R, ACC	ACC, R←(R) + (ACC)	ZF, CF	1
ADDR	WR, #I	ACC, WR←(WR) + I	ZF, CF	1
ADC	R, ACC	ACC←(R) + (ACC) + (CF)	ZF, CF	1
ADC	WR, #I	ACC←(WR) + I + (CF)	ZF, CF	1
ADCR	R, ACC	ACC, R←(R) + (ACC) + (CF)	ZF, CF	1
ADCR	WR, #I	ACC, WR←(WR) + I + (CF)	ZF, CF	1
ADU	R, ACC	ACC←(R) + (ACC)	ZF	1
ADU	WR, #I	ACC←(WR) + I	ZF	1
ADUR	R, ACC	ACC, R←(R) + (ACC)	ZF	1
ADUR	WR, #I	ACC, W R←(WR) + I	ZF	1
SUB	R, ACC	ACC←(R) - (ACC)	ZF, CF	1
SUB	WR, #I	ACC←(WR) - I	ZF, CF	1
SUBR	R, ACC	ACC, R←(R) - (ACC)	ZF, CF	1
SUBR	WR, #I	ACC, WR←(WR) - I	ZF, CF	1
SBC	R, ACC	ACC←(R) - (ACC) - (CF)	ZF, CF	1
SBC	WR, #I	ACC←(WR) - I - (CF)	ZF, CF	1
SBCR	R, ACC	ACC, R←(R) - (ACC) - (CF)	ZF, CF	1
SBCR	WR, #I	ACC, WR←(WR) - I - (CF)	ZF, CF	1

Preliminary W741C20X



Instruction Set Table 1, continued

Mnemonic		Function	Flag Affected	Cycle
INC	R	ACC, R \leftarrow (R) + 1	ZF, CF	1
DEC	R	ACC, R \leftarrow (R) - 1	ZF, CF	1
Logic Operations				
ANL	R, ACC	ACC \leftarrow (R) & (ACC)	ZF	1
ANL	WR, #I	ACC \leftarrow (WR) & I	ZF	1
ANLR	R, ACC	ACC, R \leftarrow (R) & (ACC)	ZF	1
ANLR	W, R #I	ACC, WR \leftarrow (WR) & I	ZF	1
ORL	R, ACC	ACC \leftarrow (R) \wedge (ACC)	ZF	1
ORL	WR, #I	ACC \leftarrow (WR) \wedge I	ZF	1
ORLR	R, ACC	ACC, R \leftarrow (R) \wedge (ACC)	ZF	1
ORLR	WR, #I	ACC, WR \leftarrow (WR) \wedge I	ZF	1
XRL	R, ACC	ACC \leftarrow (R) EX (ACC)	ZF	1
XRL	WR, #I	ACC \leftarrow (WR) EX I	ZF	1
XRLR	R, ACC	ACC, R \leftarrow (R) EX (ACC)	ZF	1
XRLR	WR, #I	ACC, WR \leftarrow (WR) EX I	ZF	1
Branch				
JMP	L	PC10~PC0 \leftarrow L10~L0		1
JB0	L	PC10~PC0 \leftarrow L10~L0; if ACC.0 = "1"		1
JB1	L	PC10~PC0 \leftarrow L10~L0; if ACC.1 = "1"		1
JB2	L	PC10~PC0 \leftarrow L10~L0; if ACC.2 = "1"		1
JB3	L	PC10~PC0 \leftarrow L10~L0; if ACC.3 = "1"		1
JZ	L	PC10~PC0 \leftarrow L10~L0; if ACC = 0		1
JNZ	L	PC10~PC0 \leftarrow L10~L0; if ACC != 0		1
JC	L	PC10~PC0 \leftarrow L10~L0; if CF = "1"		1
JNC	L	PC10~PC0 \leftarrow L10~L0; if CF != "1"		1
DSKZ	R	ACC, R \leftarrow (R) - 1; skip if ACC = 0	ZF, CF	1
DSKNZ	R	ACC, R \leftarrow (R) - 1; skip if ACC != 0	ZF, CF	1
SKB0	R	Skip if R.0 = "1"		1
SKB1	R	Skip if R.1 = "1"		1
SKB2	R	Skip if R.2 = "1"		1
SKB3	R	Skip if R.3 = "1"		1

Preliminary W741C20X



Instruction Set Table 1, continued

Mnemonic	Function		Flag Affected	Cycle
Data Move				
MOV	WR, R	WR \leftarrow (R)		1
MOV	R, WR	R \leftarrow (WR)		1
MOVA	WR, R	ACC, WR \leftarrow (R)	ZF	1
MOVA	R, WR	ACC, R \leftarrow (WR)	ZF	1
MOV	R, ACC	R \leftarrow (ACC)		1
MOV	ACC, R	ACC \leftarrow (R)	ZF	1
MOV	R, #I	R \leftarrow I		1
MOV	WR, @R	WR \leftarrow [PR(bit2, bit1, bit0)x10H +(R)]		2
MOV	@R, WR	[PR(bit2, bit1, bit0)x10H +(R)] \leftarrow WR		2
MOV	TABL, R	TABL \leftarrow (R)		1
MOV	TABH, R	TABH \leftarrow (R)		1
MOVC	R	R \leftarrow [TAB \times 10H + (ACC)]		2
MOVC	WR, #I	WR \leftarrow [(I6 ~ I0) \times 10H + (ACC)]		2
Input & Output				
MOVA	R, RA	ACC, R \leftarrow [RA]	ZF	1
MOVA	R, RB	ACC, R \leftarrow [RB]	ZF	1
MOVA	R, RC	ACC, R \leftarrow [RC]	ZF	1
MOVA	R, RD	ACC, R \leftarrow [RD]	ZF	1
MOV	RA, R	[RA] \leftarrow (R)		1
MOV	RB, R	[RB] \leftarrow (R)		1
MOV	RC, R	[RC] \leftarrow (R)		1
MOV	RD, R	[RD] \leftarrow (R)		1
MOV	RE, R	[RE] \leftarrow (R)		1
SOP	R	RE0 \leftarrow (R), (ACC); RE1 \leftarrow CLK		1
SIP	R	R, ACC \leftarrow SIB; RE3 \leftarrow CLK		2
MOV	MFP, #I	[MFP] \leftarrow I		1
Flag & Register				
MOVA	R, PAGE	ACC, R \leftarrow PAGE (Page Register)	ZF	1
MOV	PAGE, R	PAGE \leftarrow (R)		1
MOV	MR0, #I	MR0 \leftarrow I		1
MOV	MR1, #I	MR1 \leftarrow I		1

Preliminary W741C20X



Instruction Set Table 1, continued

Mnemonic	Function	Flag Affected	Cycle
MOV PAGE, #I	PAGE \leftarrow I		1
MOVA R, CF	ACC.0, R.0 \leftarrow CF	ZF	1
MOV CF, R	CF \leftarrow (R.0)	CF	1
MOVA R, HCFL	ACC, R \leftarrow HCF0~HCF3	ZF	1
MOVA R, HCFH	ACC, R \leftarrow HCF4~HCF7	ZF	1
CLR PMF, #I	Clear Parameter Flag if In = 1		1
SET PMF, #I	Set Parameter Flag if In = 1		1
MOV PM0, #I	Port Mode 0 \leftarrow I		1
MOV PM1, #I	Port Mode 1 \leftarrow I		1
MOV PM2, #I	Port Mode 2 \leftarrow I		1
MOV PM3, #I	Port Mode 3 \leftarrow I		1
MOV PM4, #I	Port Mode 4 \leftarrow I		1
MOV PM5, #I	Port Mode 5 \leftarrow I		1
CLR EVF, #I	Clear Event Flag if In = 1		1
MOV PEF, #I	Set/Reset Port Enable Flag		1
MOV IEF, #I	Set/Reset Interrupt Enable Flag		1
MOV HEF, #I	Set/Reset HOLD mode release Enable Flag		1
MOV SEF, #I	Set/Reset STOP mode wake-up Enable Flag for RC port		1
MOVA R, PSR0	ACC, R \leftarrow Port Status Register 0	ZF	1
CLR PSR0	Clear Port Status Register 0		1
MOVA R, PSR2	ACC, R \leftarrow Port Status Register 2	ZF	1
CLR PSR2	Clear Port Status Register 2		1
SET CF	Set Carry Flag	CF	1
CLR CF	Clear Carry Flag	CF	1
CLR DIVR0	Clear the last 4-bit of the Divider 0		1
CLR WDT	Clear WatchDog Timer		1

Preliminary W741C20X



Instruction Set Table 1, continued

Mnemonic	Function		Flag Affected	Cycle
Shift & Rotate				
SHRC R	ACC.n, R.n \leftarrow (R.n+1); ACC.3, R.3 \leftarrow 0; CF \leftarrow R.0		ZF, CF	1
RRC R	ACC.n, R.n \leftarrow (R.n+1); ACC.3, R.3 \leftarrow CF; CF \leftarrow R.0		ZF, CF	1
SHLC R	ACC.n, R.n \leftarrow (R.n-1); ACC.0, R.0 \leftarrow 0; CF \leftarrow R.3		ZF, CF	1
RLC R	ACC.n, R.n \leftarrow (R.n-1); ACC.0, R.0 \leftarrow CF; CF \leftarrow R.3		ZF, CF	1
Timer				
MOV TM0L, R	TM0L \leftarrow (R)			1
MOV TM0H, R	TM0H \leftarrow (R)			1
MOV TM0, #I	Timer 0 set			1
MOV TM1L, R	TM1L \leftarrow (R)			1
MOV TM1H, R	TM1H \leftarrow (R)			1
MOV TM1, #I	Timer 1 set			1
Subroutine				
CALL L	STACK \leftarrow (PC)+1; PC10 ~ PC0 \leftarrow L10 ~ L0			1
RTN	(PC) \leftarrow STACK			1
Other				
HOLD	Enter Hold mode			1
STOP	Enter Stop mode			1
NOP	No Operation			1
EN INT	Enable Interrupt Function			1
DIS INT	Disable Interrupt Function			1

Preliminary W741C20X



INSTRUCTION SET TABLE 2

ADC R, ACC	Add R to ACC with CF																									
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>0</td><td>1</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>										0	0	0	0	1	0	0	0	0	R6	R5	R4	R3	R2	R1	R0
0	0	0	0	1	0	0	0																			
0	R6	R5	R4	R3	R2	R1	R0																			
Machine Cycle:	1																									
Operation:	$ACC \leftarrow (R) + (ACC) + (CF)$																									
Description:	The contents of the data memory location addressed by R6 to R0, ACC, and CF are binary added and the result is loaded into the ACC.																									
Flag Affected:	CF & ZF																									
ADC WR, #I	Add immediate data to WR with CF																									
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>0</td><td>1</td><td>1</td><td>0</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>I3</td><td>I2</td><td>I1</td><td>I0</td><td>W3</td><td>W2</td><td>W1</td><td>W0</td></tr> </table>										0	0	0	0	1	1	0	0	I3	I2	I1	I0	W3	W2	W1	W0
0	0	0	0	1	1	0	0																			
I3	I2	I1	I0	W3	W2	W1	W0																			
Machine Cycle:	1																									
Operation:	$ACC \leftarrow (WR) + I + (CF)$																									
Description:	The contents of the Working Register (WR), I and CF are binary added and the result is loaded into the ACC.																									
Flag Affected:	CF & ZF																									
ADCR R, ACC	Add R to ACC with CF																									
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>										0	0	0	0	1	0	0	1	0	R6	R5	R4	R3	R2	R1	R0
0	0	0	0	1	0	0	1																			
0	R6	R5	R4	R3	R2	R1	R0																			
Machine Cycle:	1																									
Operation:	$ACC, R \leftarrow (R) + (ACC) + (CF)$																									
Description:	The contents of the data memory location addressed by R6 to R0, ACC, and CF are binary added and the result is placed in the ACC and the data memory.																									
Flag Affected:	CF & ZF																									

Preliminary W741C20X



Instruction Set Table 2, continued

ADCR WR, #I	Add immediate data to WR with CF																																					
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>0</td><td>1</td><td>1</td><td>0</td><td>1</td><td></td><td></td><td></td><td></td><td></td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>I3</td><td>I2</td><td>I1</td><td>I0</td><td>W3</td><td>W2</td><td>W1</td><td>W0</td><td></td><td></td><td></td><td></td><td></td></tr> </table>												0	0	0	0	1	1	0	1						I3	I2	I1	I0	W3	W2	W1	W0					
0	0	0	0	1	1	0	1																															
I3	I2	I1	I0	W3	W2	W1	W0																															
Machine Cycle:	1																																					
Operation:	ACC, WR \leftarrow (WR) + I + (CF)																																					
Description:	The contents of the Working Register (WR), I, CF are binary added and the result is placed in the ACC and the WR.																																					
Flag Affected:	CF & ZF																																					
ADD R, ACC	Add R to ACC																																					
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>1</td><td>1</td><td>0</td><td>0</td><td>0</td><td></td><td></td><td></td><td></td><td></td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td><td></td><td></td><td></td><td></td><td></td></tr> </table>												0	0	0	1	1	0	0	0						0	R6	R5	R4	R3	R2	R1	R0					
0	0	0	1	1	0	0	0																															
0	R6	R5	R4	R3	R2	R1	R0																															
Machine Cycle:	1																																					
Operation:	ACC \leftarrow (R) + (ACC)																																					
Description:	The contents of the data memory location addressed by R6 to R0 and ACC are binary added and the result is loaded into the ACC.																																					
Flag Affected:	CF & ZF																																					
ADD WR, #I	Add immediate data to WR																																					
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>1</td><td>1</td><td>1</td><td>0</td><td>0</td><td></td><td></td><td></td><td></td><td></td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>I3</td><td>I2</td><td>I1</td><td>I0</td><td>W3</td><td>W2</td><td>W1</td><td>W0</td><td></td><td></td><td></td><td></td><td></td></tr> </table>												0	0	0	1	1	1	0	0						I3	I2	I1	I0	W3	W2	W1	W0					
0	0	0	1	1	1	0	0																															
I3	I2	I1	I0	W3	W2	W1	W0																															
Machine Cycle:	1																																					
Operation:	ACC \leftarrow (WR) + I																																					
Description:	The contents of the Working Register (WR) and the immediate data I are binary added and the result is loaded into the ACC.																																					
Flag Affected:	CF & ZF																																					

Preliminary W741C20X



Instruction Set Table 2, continued

ADDR R, ACC	Add R to ACC																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>1</td><td>1</td><td>0</td><td>0</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	0	0	1	1	0	0	1	0	R6	R5	R4	R3	R2	R1	R0
0	0	0	1	1	0	0	1										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	ACC, R \leftarrow (R) + (ACC)																
Description:	The contents of the data memory location addressed by R6 to R0 and ACC are binary added and the result is placed in the ACC and the data memory.																
Flag Affected:	CF & ZF																
ADDR WR, #I	Add immediate data to WR																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>1</td><td>1</td><td>1</td><td>0</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>I3</td><td>I2</td><td>I1</td><td>I0</td><td>W3</td><td>W2</td><td>W1</td><td>W0</td></tr> </table>	0	0	0	1	1	1	0	1	I3	I2	I1	I0	W3	W2	W1	W0
0	0	0	1	1	1	0	1										
I3	I2	I1	I0	W3	W2	W1	W0										
Machine Cycle:	1																
Operation:	ACC, WR \leftarrow (WR) + I																
Description:	The contents of the Working Register (WR) and the immediate data I are binary added and the result is placed in the ACC and the WR.																
Flag Affected:	CF & ZF																
ADU R, ACC	Add R to ACC and Carry Flag unchange																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>1</td><td>0</td><td>1</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	0	1	0	1	0	0	0	0	R6	R5	R4	R3	R2	R1	R0
0	0	1	0	1	0	0	0										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	ACC \leftarrow (R) + (ACC)																
Description:	The contents of the data memory location addressed by R6 to R0 and ACC are binary added and the result is loaded into the ACC.																
Flag Affected:	ZF																

Preliminary W741C20X



Instruction Set Table 2, continued

ADU	WR, #I	Add immediate data to WR and Carry Flag unchange																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>1</td><td>0</td><td>1</td><td>1</td><td>0</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>I3</td><td>I2</td><td>I1</td><td>I0</td><td>W3</td><td>W2</td><td>W1</td><td>W0</td></tr> </table>	0	0	1	0	1	1	0	0	I3	I2	I1	I0	W3	W2	W1	W0	
0	0	1	0	1	1	0	0											
I3	I2	I1	I0	W3	W2	W1	W0											
Machine Cycle:	1																	
Operation:	ACC \leftarrow (WR) + I																	
Description:	The contents of the Working Register (WR) and the immediate data I are binary added and the result is loaded into the ACC.																	
Flag Affected:	ZF																	
ADUR	R, ACC	Add R to ACC and Carry Flag unchange																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>1</td><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	0	1	0	1	0	0	1	0	R6	R5	R4	R3	R2	R1	R0	
0	0	1	0	1	0	0	1											
0	R6	R5	R4	R3	R2	R1	R0											
Machine Cycle:	1																	
Operation:	ACC, R \leftarrow (R) + (ACC)																	
Description:	The contents of the data memory location addressed by R6 to R0 and ACC are binary added and the result is placed in the ACC and the data memory.																	
Flag Affected:	ZF																	
ADUR	WR, #I	Add immediate data to WR and Carry Flag unchange																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>1</td><td>0</td><td>1</td><td>1</td><td>0</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>I3</td><td>I2</td><td>I1</td><td>I0</td><td>W3</td><td>W2</td><td>W1</td><td>W0</td></tr> </table>	0	0	1	0	1	1	0	1	I3	I2	I1	I0	W3	W2	W1	W0	
0	0	1	0	1	1	0	1											
I3	I2	I1	I0	W3	W2	W1	W0											
Machine Cycle:	1																	
Operation:	ACC, WR \leftarrow (WR) + I																	
Description:	The contents of the Working Register (WR) and the immediate data I are binary added and the result is placed in the WR and the ACC.																	
Flag Affected:	ZF																	

Preliminary W741C20X



Instruction Set Table 2, continued

ANL R, ACC	And R to ACC																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>1</td><td>0</td><td>1</td><td>0</td><td>1</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	0	1	0	1	0	1	0	0	R6	R5	R4	R3	R2	R1	R0
0	0	1	0	1	0	1	0										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	$ACC \leftarrow (R) \& (ACC)$																
Description:	The contents of the data memory location addressed by R6 to R0 and the ACC are ANDed and the result is loaded into the ACC.																
Flag Affected:	ZF																
ANL WR, #I	And immediate data to WR																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>1</td><td>0</td><td>1</td><td>1</td><td>1</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>I3</td><td>I2</td><td>I1</td><td>I0</td><td>W3</td><td>W2</td><td>W1</td><td>W0</td></tr> </table>	0	0	1	0	1	1	1	0	I3	I2	I1	I0	W3	W2	W1	W0
0	0	1	0	1	1	1	0										
I3	I2	I1	I0	W3	W2	W1	W0										
Machine Cycle:	1																
Operation:	$ACC \leftarrow (WR) \& I$																
Description:	The contents of the Working Register (WR) and the immediate data I are ANDed and the result is loaded into the ACC.																
Flag Affected:	ZF																
ANLR R, ACC	And R to ACC																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>1</td><td>0</td><td>1</td><td>0</td><td>1</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	0	1	0	1	0	1	1	0	R6	R5	R4	R3	R2	R1	R0
0	0	1	0	1	0	1	1										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	$ACC, R \leftarrow (R) \& (ACC)$																
Description:	The contents of the data memory location addressed by R6 to R0 and the ACC are ANDed and the result is placed in the data memory and the ACC.																
Flag Affected:	ZF																

Preliminary W741C20X



Instruction set table 2, continued

ANLR	WR, #I	And immediate data to WR																
Machine Code:		<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>1</td><td>0</td><td>1</td><td>1</td><td>1</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>I3</td><td>I2</td><td>I1</td><td>I0</td><td>W3</td><td>W2</td><td>W1</td><td>W0</td></tr> </table>	0	0	1	0	1	1	1	1	I3	I2	I1	I0	W3	W2	W1	W0
0	0	1	0	1	1	1	1											
I3	I2	I1	I0	W3	W2	W1	W0											
Machine Cycle:		1																
Operation:		ACC, WR \leftarrow (WR) & I																
Description:		The contents of the Working Register (WR) and the immediate data I are ANDed and the result is placed in the WR and the ACC.																
Flag Affected:		ZF																
CALL	L	Call subroutine																
Machine Code:		<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>1</td><td>0</td><td>0</td><td>L10</td><td>L9</td><td>L8</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>L7</td><td>L6</td><td>L5</td><td>L4</td><td>L3</td><td>L2</td><td>L1</td><td>L0</td></tr> </table>	0	1	1	0	0	L10	L9	L8	L7	L6	L5	L4	L3	L2	L1	L0
0	1	1	0	0	L10	L9	L8											
L7	L6	L5	L4	L3	L2	L1	L0											
Machine Cycle:		1																
Operation:		STACK \leftarrow (PC)+1; PC10 ~ PC0 \leftarrow L10 ~ L0																
Description:		The next program counter (PC10 to PC0) is saved in the STACK and then the direct address (L10 to L0) is loaded into the program counter. A subroutine is called.																
CLR	CF	Clear CF																
Machine Code:		<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>1</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table>	0	1	0	1	0	0	0	0	0	0	0	0	0	0	0	0
0	1	0	1	0	0	0	0											
0	0	0	0	0	0	0	0											
Machine Cycle:		1																
Operation:		Clear CF																
Description:		Clear Carry Flag to 0.																
Flag Affected:		CF																

Preliminary W741C20X



Instruction Set Table 2, continued

CLR	DIVR0	Reset the last 4 bits of the DIVideR 0																		
Machine Code:		<table border="1"> <tr><td>0</td><td>0</td><td>0</td><td>1</td><td>0</td><td>1</td><td>1</td><td>1</td></tr> <tr><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table>	0	0	0	1	0	1	1	1	0	0	0	0	0	0	0	0		
0	0	0	1	0	1	1	1													
0	0	0	0	0	0	0	0													
Machine Cycle:		1																		
Operation:		Reset the last 4 bits of the divider 0																		
Description:		When this instruction is executed, the last 4 bits of the divider 0 (14 bits) are reset.																		
CLR	EVF, #I	Clear Event Flag																		
Machine Code:		<table border="1"> <tr><td>0</td><td>1</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> <tr><td>I7</td><td>I6</td><td>I5</td><td>I4</td><td>I3</td><td>I2</td><td>I1</td><td>I0</td></tr> </table>	0	1	0	0	0	0	0	0	I7	I6	I5	I4	I3	I2	I1	I0		
0	1	0	0	0	0	0	0													
I7	I6	I5	I4	I3	I2	I1	I0													
Machine Cycle:		1																		
Operation:		Clear event flag																		
Description:		The condition corresponding to the data specified by I7 to I0 is controlled.																		
		<table border="1"> <tr><td>I0~I7</td><td>Mode after execution of instruction</td></tr> <tr><td>I0 = 1</td><td>EVF0 caused by overflow from the divider 0 is reset.</td></tr> <tr><td>I1 = 1</td><td>EVF1 caused by underflow from the timer 0 is reset.</td></tr> <tr><td>I2 = 1</td><td>EVF2 caused by the signal change at port RC is reset.</td></tr> <tr><td>I3</td><td>Reserved</td></tr> <tr><td>I4 = 1</td><td>EVF4 caused by the falling edge signal on INT pin is reset.</td></tr> <tr><td>I5 = 1</td><td>EVF5 caused by the serial port received completely.</td></tr> <tr><td>I6 = 1</td><td>EVF6 caused by the serial port transmitted completely.</td></tr> <tr><td>I7 = 1</td><td>EVF7 caused by underflow from the timer 1 is reset.</td></tr> </table>	I0~I7	Mode after execution of instruction	I0 = 1	EVF0 caused by overflow from the divider 0 is reset.	I1 = 1	EVF1 caused by underflow from the timer 0 is reset.	I2 = 1	EVF2 caused by the signal change at port RC is reset.	I3	Reserved	I4 = 1	EVF4 caused by the falling edge signal on INT pin is reset.	I5 = 1	EVF5 caused by the serial port received completely.	I6 = 1	EVF6 caused by the serial port transmitted completely.	I7 = 1	EVF7 caused by underflow from the timer 1 is reset.
I0~I7	Mode after execution of instruction																			
I0 = 1	EVF0 caused by overflow from the divider 0 is reset.																			
I1 = 1	EVF1 caused by underflow from the timer 0 is reset.																			
I2 = 1	EVF2 caused by the signal change at port RC is reset.																			
I3	Reserved																			
I4 = 1	EVF4 caused by the falling edge signal on INT pin is reset.																			
I5 = 1	EVF5 caused by the serial port received completely.																			
I6 = 1	EVF6 caused by the serial port transmitted completely.																			
I7 = 1	EVF7 caused by underflow from the timer 1 is reset.																			

Preliminary W741C20X



Instruction Set Table 2, continued

CLR PMF, #I	Clear ParaMeter Flag	
Machine Code:	0 0 0 1 0 1 1 0	1 0 0 0 I3 I2 I1 I0
Machine Cycle:	1	
Operation:	Clear Parameter Flag	
Description:	Description of each flag: I0, I1, I2 : Reserved I3 = 1 : The input clock of the watchdog timer is Fosc/1024.	
CLR PSR0	Clear Port Status Register 0 (RC port signal change flag)	
Machine Code:	0 1 0 0 0 0 1 0	0 0 0 0 0 0 0 0
Machine Cycle:	1	
Operation:	Clear Port Status Register 0 (RC port signal change flag)	
Description:	When this instruction is executed, the RC port signal change flag (PSR0) is cleared.	
CLR PSR2	Clear Port Status Register 2 (serial port status flags)	
Machine Code:	0 1 0 1 0 1 0 1	0 0 0 0 0 0 0 0
Machine Cycle:	1	
Operation:	Clear Port Status Register 2 (serial port status flags)	
Description:	When this instruction is executed, the serial port status flags (PSR2) are cleared.	
CLR WDT	Reset the last 4 bits of the Watchdog Timer	
Machine Code:	0 0 0 1 0 1 1 1	1 0 0 0 0 0 0 0
Machine Cycle:	1	
Operation:	Reset the last 4 bits of the watchdog timer	
Description:	When this instruction is executed, the last 4 bits of the watchdog timer are reset.	

Preliminary W741C20X



Instruction Set Table 2, continued

DEC R	Decrement R content																	
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td><td>0</td><td>1</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	1	0	0	1	0	1	0	1	R6	R5	R4	R3	R2	R1	R0	
0	1	0	0	1	0	1	0											
1	R6	R5	R4	R3	R2	R1	R0											
Machine Cycle:	1																	
Operation:	ACC, R \leftarrow (R) - 1																	
Description:	Decrement the data memory content and load result into the ACC and the data memory.																	
Flag Affected:	CF & ZF																	
DIS INT	Disable Interrupt function																	
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>1</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table>	0	1	0	1	0	0	0	0	0	1	0	0	0	0	0	0	0
0	1	0	1	0	0	0	0	0										
1	0	0	0	0	0	0	0											
Machine Cycle:	1																	
Operation:	Disable interrupt function																	
Description:	Interrupt function is inhibited by executing this instruction.																	
DSKNZ R	Decrement R content then skip if ACC != 0																	
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	1	0	0	1	0	0	0	1	R6	R5	R4	R3	R2	R1	R0	
0	1	0	0	1	0	0	0											
1	R6	R5	R4	R3	R2	R1	R0											
Machine Cycle:	1																	
Operation:	ACC, R \leftarrow (R) - 1; PC \leftarrow (PC) + 2 if ACC != 0																	
Description:	Decrement the data memory content and load result into the ACC and the data memory. If ACC != 0, the program counter is incremented by 2 and produces a skip.																	
Flag Affected:	CF & ZF																	

Preliminary W741C20X



Instruction Set Table 2, continued

DSKZ R		Decrement R content then skip if ACC is zero														
Machine Code:		0 1 0 0 1 0 0 0					0 R6 R5 R4 R3 R2 R1 R0									
Machine Cycle:		1														
Operation:		ACC, R \leftarrow (R) - 1; PC \leftarrow (PC) + 2 if ACC = 0														
Description:		Decrement the data memory content and load result into the ACC and the data memory. If ACC = 0, the program counter is incremented by 2 and produces a skip.														
Flag Affected:		CF & ZF														
EN INT		Enable Interrupt function														
Machine Code:		0 1 0 1 0 0 0 0					1 1 0 0 0 0 0 0									
Machine Cycle:		1														
Operation:		Enable interrupt function														
Description:		This instruction enables the interrupt function.														
HOLD		Enter the HOLD mode														
Machine Code:		0 0 0 0 0 0 0 0					1 0 0 0 0 0 0 0									
Machine Cycle:		1														
Operation:		Enter the HOLD mode														
Description:		The following two conditions cause the HOLD mode to be released. (1) An interrupt is accepted. (2) The HOLD release condition specified by the HEF is met. In HOLD mode, when an interrupt is accepted the HOLD mode will be released and the interrupt service routine will be executed. After completing the interrupt service routine by executing the RTN instruction, the μ C will enter HOLD mode again.														

Preliminary W741C20X



Instruction Set Table 2, continued

INC R	Increment R content																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td><td>0</td><td>1</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	1	0	0	1	0	1	0	0	R6	R5	R4	R3	R2	R1	R0
0	1	0	0	1	0	1	0										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	ACC, R \leftarrow (R) + 1																
Description:	Increment the data memory content and load the result into the ACC and the data memory.																
Flag Affected:	CF & ZF																
JB0 L	Jump when bit 0 of ACC is "1"																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>0</td><td>0</td><td>0</td><td>0</td><td>L10</td><td>L9</td><td>L8</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>L7</td><td>L6</td><td>L5</td><td>L4</td><td>L3</td><td>L2</td><td>L1</td><td>L0</td></tr> </table>	1	0	0	0	0	L10	L9	L8	L7	L6	L5	L4	L3	L2	L1	L0
1	0	0	0	0	L10	L9	L8										
L7	L6	L5	L4	L3	L2	L1	L0										
Machine Cycle:	1																
Operation:	PC10 ~ PC0 \leftarrow L10 ~ L0; if ACC.0 = "1"																
Description:	If bit 0 of the ACC is "1," PC10 to PC0 of the program counter are replaced with the data specified by L10 to L0 and a jump occurs. If bit 0 of the ACC is "0," the program counter (PC) is incremented.																
JB1 L	Jump when bit 1 of ACC is "1"																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>0</td><td>0</td><td>1</td><td>0</td><td>L10</td><td>L9</td><td>L8</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>L7</td><td>L6</td><td>L5</td><td>L4</td><td>L3</td><td>L2</td><td>L1</td><td>L0</td></tr> </table>	1	0	0	1	0	L10	L9	L8	L7	L6	L5	L4	L3	L2	L1	L0
1	0	0	1	0	L10	L9	L8										
L7	L6	L5	L4	L3	L2	L1	L0										
Machine Cycle:	1																
Operation:	PC10 ~ PC0 \leftarrow L10 ~ L0; if ACC.1 = "1"																
Description:	If bit 1 of the ACC is "1," PC10 to PC0 of the program counter are replaced with the data specified by L10 to L0 and a jump occurs. If bit 1 of the ACC is "0," the program counter (PC) is incremented.																
JB2 L	Jump when bit 2 of ACC is "1"																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>0</td><td>1</td><td>0</td><td>0</td><td>L10</td><td>L9</td><td>L8</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>L7</td><td>L6</td><td>L5</td><td>L4</td><td>L3</td><td>L2</td><td>L1</td><td>L0</td></tr> </table>	1	0	1	0	0	L10	L9	L8	L7	L6	L5	L4	L3	L2	L1	L0
1	0	1	0	0	L10	L9	L8										
L7	L6	L5	L4	L3	L2	L1	L0										
Machine Cycle:	1																
Operation:	PC10 ~ PC0 \leftarrow L10 ~ L0; if ACC.2="1"																
Description:	If bit 2 of the ACC is "1," PC10 to PC0 of the program counter are replaced with the data specified by L10 to L0 and a jump occurs. If bit 2 of the ACC is "0," the program counter (PC) is incremented.																

Preliminary W741C20X



Instruction Set Table 2, continued

JB3 L	Jump when bit 3 of ACC is "1"																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>0</td><td>1</td><td>1</td><td>0</td><td>L10</td><td>L9</td><td>L8</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>L7</td><td>L6</td><td>L5</td><td>L4</td><td>L3</td><td>L2</td><td>L1</td><td>L0</td></tr> </table>	1	0	1	1	0	L10	L9	L8	L7	L6	L5	L4	L3	L2	L1	L0
1	0	1	1	0	L10	L9	L8										
L7	L6	L5	L4	L3	L2	L1	L0										
Machine Cycle:	1																
Operation:	PC10 ~ PC0 ← L10 ~ L0; if ACC.3 = "1"																
Description:	If bit 3 of the ACC is "1," PC10 to PC0 of the program counter are replaced with the data specified by L10 to L0 and a jump occurs. If bit 3 of the ACC is "0," the program counter (PC) is incremented.																
JC L	Jump when CF is "1"																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>1</td><td>1</td><td>1</td><td>0</td><td>L10</td><td>L9</td><td>L8</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>L7</td><td>L6</td><td>L5</td><td>L4</td><td>L3</td><td>L2</td><td>L1</td><td>L0</td></tr> </table>	1	1	1	1	0	L10	L9	L8	L7	L6	L5	L4	L3	L2	L1	L0
1	1	1	1	0	L10	L9	L8										
L7	L6	L5	L4	L3	L2	L1	L0										
Machine Cycle:	1																
Operation:	PC10 ~ PC0 ← L10 ~ L0; if CF = "1"																
Description:	If CF is "1," PC10 to PC0 of the program counter are replaced with the data specified by L10 to L0 and a jump occurs. If the CF is "0," the program counter (PC) is incremented.																
JMP L	Jump absolutely																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>1</td><td>1</td><td>0</td><td>L10</td><td>L9</td><td>L8</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>L7</td><td>L6</td><td>L5</td><td>L4</td><td>L3</td><td>L2</td><td>L1</td><td>L0</td></tr> </table>	0	1	1	1	0	L10	L9	L8	L7	L6	L5	L4	L3	L2	L1	L0
0	1	1	1	0	L10	L9	L8										
L7	L6	L5	L4	L3	L2	L1	L0										
Machine Cycle:	1																
Operation:	PC10 ~ PC0 ← L10 ~ L0																
Description:	PC10 to PC0 of the program counter are replaced with the data specified by L10 to L0 and an unconditional jump occurs.																

Preliminary W741C20X



Instruction Set Table 2, continued

JNC L	Jump when CF is not "1"																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>1</td><td>0</td><td>1</td><td>0</td><td>L10</td><td>L9</td><td>L8</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>L7</td><td>L6</td><td>L5</td><td>L4</td><td>L3</td><td>L2</td><td>L1</td><td>L0</td></tr> </table>	1	1	0	1	0	L10	L9	L8	L7	L6	L5	L4	L3	L2	L1	L0
1	1	0	1	0	L10	L9	L8										
L7	L6	L5	L4	L3	L2	L1	L0										
Machine Cycle:	1																
Operation:	PC10 ~ PC0 ← L10 ~ L0; if CF = "0"																
Description:	If CF is "0," PC10 to PC0 of the program counter are replaced with the data specified by L10 to L0 and a jump occurs. If CF is "1," the program counter (PC) is incremented.																
JNZ L	Jump when ACC is not zero																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>1</td><td>0</td><td>0</td><td>0</td><td>L10</td><td>L9</td><td>L8</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>L7</td><td>L6</td><td>L5</td><td>L4</td><td>L3</td><td>L2</td><td>L1</td><td>L0</td></tr> </table>	1	1	0	0	0	L10	L9	L8	L7	L6	L5	L4	L3	L2	L1	L0
1	1	0	0	0	L10	L9	L8										
L7	L6	L5	L4	L3	L2	L1	L0										
Machine Cycle:	1																
Operation:	PC10 ~ PC0 ← L10 ~ L0; if ACC != 0																
Description:	If the ACC is not zero, PC10 to PC0 of the program counter are replaced with the data specified by L10 to L0 and a jump occurs. If the ACC is zero, the program counter (PC) is incremented.																
JZ L	Jump when ACC is zero																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>1</td><td>1</td><td>0</td><td>0</td><td>L10</td><td>L9</td><td>L8</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>L7</td><td>L6</td><td>L5</td><td>L4</td><td>L3</td><td>L2</td><td>L1</td><td>L0</td></tr> </table>	1	1	1	0	0	L10	L9	L8	L7	L6	L5	L4	L3	L2	L1	L0
1	1	1	0	0	L10	L9	L8										
L7	L6	L5	L4	L3	L2	L1	L0										
Machine Cycle:	1																
Operation:	PC10 ~ PC0 ← L10 ~ L0; if ACC = 0																
Description:	If the ACC is zero, PC10 to PC0 of the program counter are replaced with the data specified by L10 to L0 and a jump occurs. If the ACC is not zero, the program counter (PC) is incremented.																

Preliminary W741C20X



Instruction Set Table 2, continued

MOV ACC, R	Move R content to ACC																
Machine Code:	<table border="1"><tr><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td><td>1</td><td>1</td><td>0</td></tr><tr><td>1</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr></table>	0	1	0	0	1	1	1	0	1	R6	R5	R4	R3	R2	R1	R0
0	1	0	0	1	1	1	0										
1	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	ACC \leftarrow (R)																
Description:	The contents of the data memory location addressed by R6 to R0 are loaded into the ACC. ZF																
MOV CF, R	Move R.0 content to CF																
Machine Code:	<table border="1"><tr><td>0</td><td>1</td><td>0</td><td>1</td><td>1</td><td>0</td><td>0</td><td>0</td></tr><tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr></table>	0	1	0	1	1	0	0	0	0	R6	R5	R4	R3	R2	R1	R0
0	1	0	1	1	0	0	0										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	CF \leftarrow (R.0)																
Description:	The bit 0 content of the data memory location addressed by R6 to R0 is loaded into CF.																
Flag Affected:	CF																

Preliminary W741C20X



Instruction Set Table 2, continued

MOV HEF, #1	Set/Reset Hold mode release Enable Flag																															
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>1</td><td></td><td></td><td></td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>I7</td><td>I6</td><td>I5</td><td>I4</td><td>I3</td><td>I2</td><td>I1</td><td>I0</td><td></td><td></td><td></td></tr> </table>										0	1	0	0	0	0	0	1				I7	I6	I5	I4	I3	I2	I1	I0			
0	1	0	0	0	0	0	1																									
I7	I6	I5	I4	I3	I2	I1	I0																									
Machine Cycle:	1																															
Operation:	Hold mode release enable flag control																															
Description:	<table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th style="width: 10%;">I0~I7</th><th style="width: 90%;">Operation</th></tr> </thead> <tbody> <tr> <td>I0 = 1</td><td>The HEF0 is set so that overflow from the divider 0 caused the HOLD mode to be released.</td></tr> <tr> <td>I1 = 1</td><td>The HEF1 is set so that underflow from the Timer 0 caused the HOLD mode to be released.</td></tr> <tr> <td>I2 = 1</td><td>The HEF2 is set so that signal change at port RC caused the HOLD mode to be released.</td></tr> <tr> <td>I3</td><td>Reserved</td></tr> <tr> <td>I4 = 1</td><td>The HEF4 is set so that the falling edge signal at the INT pin caused the HOLD mode to be released.</td></tr> <tr> <td>I5 = 1</td><td>The HEF5 is set so that the serial port received completely caused the HOLD mode to be released.</td></tr> <tr> <td>I6 = 1</td><td>The HEF6 is set so that the serial port transmitted completely caused the HOLD mode to be released.</td></tr> <tr> <td>I7 = 1</td><td>The HEF7 is set so that underflow from the Timer 1 caused the HOLD mode to be released.</td></tr> </tbody> </table>										I0~I7	Operation	I0 = 1	The HEF0 is set so that overflow from the divider 0 caused the HOLD mode to be released.	I1 = 1	The HEF1 is set so that underflow from the Timer 0 caused the HOLD mode to be released.	I2 = 1	The HEF2 is set so that signal change at port RC caused the HOLD mode to be released.	I3	Reserved	I4 = 1	The HEF4 is set so that the falling edge signal at the INT pin caused the HOLD mode to be released.	I5 = 1	The HEF5 is set so that the serial port received completely caused the HOLD mode to be released.	I6 = 1	The HEF6 is set so that the serial port transmitted completely caused the HOLD mode to be released.	I7 = 1	The HEF7 is set so that underflow from the Timer 1 caused the HOLD mode to be released.				
I0~I7	Operation																															
I0 = 1	The HEF0 is set so that overflow from the divider 0 caused the HOLD mode to be released.																															
I1 = 1	The HEF1 is set so that underflow from the Timer 0 caused the HOLD mode to be released.																															
I2 = 1	The HEF2 is set so that signal change at port RC caused the HOLD mode to be released.																															
I3	Reserved																															
I4 = 1	The HEF4 is set so that the falling edge signal at the INT pin caused the HOLD mode to be released.																															
I5 = 1	The HEF5 is set so that the serial port received completely caused the HOLD mode to be released.																															
I6 = 1	The HEF6 is set so that the serial port transmitted completely caused the HOLD mode to be released.																															
I7 = 1	The HEF7 is set so that underflow from the Timer 1 caused the HOLD mode to be released.																															

Preliminary W741C20X



Instruction Set Table 2, continued

MOV	IEF, #I	Set/Reset Interrupt Enable Flag																		
Machine Code:		<table border="1"><tr><td>0</td><td>1</td><td>0</td><td>1</td><td>0</td><td>0</td><td>0</td><td>1</td><td></td><td>I7</td><td>I6</td><td>I5</td><td>I4</td><td>I3</td><td>I2</td><td>I1</td><td>I0</td></tr></table>	0	1	0	1	0	0	0	1		I7	I6	I5	I4	I3	I2	I1	I0	
0	1	0	1	0	0	0	1		I7	I6	I5	I4	I3	I2	I1	I0				
Machine Cycle:		1																		
Operation:		Interrupt Enable flag Control																		
Description:		<p>The interrupt enable flag corresponding to the data specified by I7 - I0 is controlled:</p> <table border="1"><thead><tr><th>I0~I7</th><th>Operation</th></tr></thead><tbody><tr><td>I0 = 1</td><td>The IEF0 is set so that interrupt 0 (overflow from the divider 0) is accepted.</td></tr><tr><td>I1 = 1</td><td>The IEF1 is set so that interrupt 1 (underflow from the Timer 0) is accepted.</td></tr><tr><td>I2 = 1</td><td>The IEF2 is set so that interrupt 2 (signal change at port RC) is accepted.</td></tr><tr><td>I3</td><td>Reserved</td></tr><tr><td>I4 = 1</td><td>The IEF4 is set so that interrupt 4 (falling edge signal at the INT pin) is accepted.</td></tr><tr><td>I5 = 1</td><td>The IEF5 is set so that interrupt 5 (the serial port received completely) is accepted.</td></tr><tr><td>I6 = 1</td><td>The IEF6 is set so that interrupt 6 (the serial port transmitted completely) is accepted.</td></tr><tr><td>I7 = 1</td><td>The IEF7 is set so that interrupt 7 (underflow from the Timer 1) is accepted.</td></tr></tbody></table>	I0~I7	Operation	I0 = 1	The IEF0 is set so that interrupt 0 (overflow from the divider 0) is accepted.	I1 = 1	The IEF1 is set so that interrupt 1 (underflow from the Timer 0) is accepted.	I2 = 1	The IEF2 is set so that interrupt 2 (signal change at port RC) is accepted.	I3	Reserved	I4 = 1	The IEF4 is set so that interrupt 4 (falling edge signal at the INT pin) is accepted.	I5 = 1	The IEF5 is set so that interrupt 5 (the serial port received completely) is accepted.	I6 = 1	The IEF6 is set so that interrupt 6 (the serial port transmitted completely) is accepted.	I7 = 1	The IEF7 is set so that interrupt 7 (underflow from the Timer 1) is accepted.
I0~I7	Operation																			
I0 = 1	The IEF0 is set so that interrupt 0 (overflow from the divider 0) is accepted.																			
I1 = 1	The IEF1 is set so that interrupt 1 (underflow from the Timer 0) is accepted.																			
I2 = 1	The IEF2 is set so that interrupt 2 (signal change at port RC) is accepted.																			
I3	Reserved																			
I4 = 1	The IEF4 is set so that interrupt 4 (falling edge signal at the INT pin) is accepted.																			
I5 = 1	The IEF5 is set so that interrupt 5 (the serial port received completely) is accepted.																			
I6 = 1	The IEF6 is set so that interrupt 6 (the serial port transmitted completely) is accepted.																			
I7 = 1	The IEF7 is set so that interrupt 7 (underflow from the Timer 1) is accepted.																			

Preliminary W741C20X



Instruction Set Table 2, continued

MOV	MFP, #I	Modulation Frequency Pulse generator																																					
Machine Code:		0	0	0	1	0	0	1	0	I7 I6 I5 I4 I3 I2 I1 I0																													
Machine Cycle:		1																																					
Operation:		$[\text{MFP}] \leftarrow I$																																					
Description:		<p>If the bit 2 of MR1 is "0," the waveform specified by I7 to I0 is delivered at the MFP output pin (MFP). The relation between the waveform and immediate data I is shown as follows:</p> <table border="1"> <tr> <td>I5~I0</td> <td>I0 = 1</td> <td>I1 = 1</td> <td>I2 = 1</td> <td>I3 = 1</td> <td>I4 = 1</td> <td>I5 = 1</td> </tr> <tr> <td>Signal</td> <td>$\frac{\text{Fosc}}{256}$</td> <td>$\frac{\text{Fosc}}{512}$</td> <td>$\frac{\text{Fosc}}{4096}$</td> <td>$\frac{\text{Fosc}}{8192}$</td> <td>$\frac{\text{Fosc}}{16384}$</td> <td>$\frac{\text{Fosc}}{32768}$</td> </tr> </table> <table border="1"> <tr> <td>I7</td> <td>I6</td> <td>Signal</td> </tr> <tr> <td>0</td> <td>0</td> <td>Low</td> </tr> <tr> <td>0</td> <td>1</td> <td>High</td> </tr> <tr> <td>1</td> <td>0</td> <td>$\text{Fosc}/16$</td> </tr> <tr> <td>1</td> <td>1</td> <td>$\text{Fosc}/8$</td> </tr> </table>									I5~I0	I0 = 1	I1 = 1	I2 = 1	I3 = 1	I4 = 1	I5 = 1	Signal	$\frac{\text{Fosc}}{256}$	$\frac{\text{Fosc}}{512}$	$\frac{\text{Fosc}}{4096}$	$\frac{\text{Fosc}}{8192}$	$\frac{\text{Fosc}}{16384}$	$\frac{\text{Fosc}}{32768}$	I7	I6	Signal	0	0	Low	0	1	High	1	0	$\text{Fosc}/16$	1	1	$\text{Fosc}/8$
I5~I0	I0 = 1	I1 = 1	I2 = 1	I3 = 1	I4 = 1	I5 = 1																																	
Signal	$\frac{\text{Fosc}}{256}$	$\frac{\text{Fosc}}{512}$	$\frac{\text{Fosc}}{4096}$	$\frac{\text{Fosc}}{8192}$	$\frac{\text{Fosc}}{16384}$	$\frac{\text{Fosc}}{32768}$																																	
I7	I6	Signal																																					
0	0	Low																																					
0	1	High																																					
1	0	$\text{Fosc}/16$																																					
1	1	$\text{Fosc}/8$																																					
MOV	MR0, #I	Load immediate data to Mode Register 0 (MR0)																																					
Machine Code:		0	0	0	1	0	0	1	1	1 0 0 0 I3 I2 I1 I0																													
Machine Cycle:		1																																					
Operation:		$\text{MR0} \leftarrow I$																																					
Description:		<p>The immediate data I are loaded to the MR0.</p> <p>MR0 bits description:</p> <table border="1"> <tr> <td>bit 0</td> <td>= 0 The fundamental frequency of Timer 0 is Fosc/4 = 1 The fundamental frequency of Timer 0 is Fosc/1024</td> </tr> <tr> <td>bit 1</td> <td>Reserved</td> </tr> <tr> <td>bit 2</td> <td>Reserved</td> </tr> <tr> <td>bit 3</td> <td>= 0 Timer 0 stop down-counting = 1 Timer 0 start down-counting</td> </tr> </table>										bit 0	= 0 The fundamental frequency of Timer 0 is Fosc/4 = 1 The fundamental frequency of Timer 0 is Fosc/1024	bit 1	Reserved	bit 2	Reserved	bit 3	= 0 Timer 0 stop down-counting = 1 Timer 0 start down-counting																				
bit 0	= 0 The fundamental frequency of Timer 0 is Fosc/4 = 1 The fundamental frequency of Timer 0 is Fosc/1024																																						
bit 1	Reserved																																						
bit 2	Reserved																																						
bit 3	= 0 Timer 0 stop down-counting = 1 Timer 0 start down-counting																																						

Preliminary W741C20X



Instruction Set Table 2, continued

MOV	MR1, #I	Load immediate data to Mode Register 1 (MR1)																
Machine Code:		<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>0</td><td>I3</td><td>I2</td><td>I1</td><td>I0</td></tr> </table>	0	0	0	1	0	0	1	1	0	0	0	0	I3	I2	I1	I0
0	0	0	1	0	0	1	1											
0	0	0	0	I3	I2	I1	I0											
Machine Cycle:		1																
Operation:		$MR1 \leftarrow I$																
Description:		<p>The immediate data I are loaded to the MR1.</p> <p>MR1 bit description:</p> <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 10%;">bit0</td> <td>= 0 The internal fundamental frequency of Timer 1 is Fosc = 1 The internal fundamental frequency of Timer 1 is Fosc/64</td> </tr> <tr> <td>bit1</td> <td>= 0 The fundamental frequency source of Timer 1 is internal clock = 1 The fundamental frequency source of Timer 1 is external clock via RC.0 input pin</td> </tr> <tr> <td>bit2</td> <td>= 0 The specified waveform of the MFP generator is delivered at the MFP output pin = 1 The specified frequency of the Timer 1 is delivered at the MFP output pin</td> </tr> <tr> <td>bit3</td> <td>= 0 Timer 1 stop down-counting = 1 Timer 1 start down-counting</td> </tr> </table>	bit0	= 0 The internal fundamental frequency of Timer 1 is Fosc = 1 The internal fundamental frequency of Timer 1 is Fosc/64	bit1	= 0 The fundamental frequency source of Timer 1 is internal clock = 1 The fundamental frequency source of Timer 1 is external clock via RC.0 input pin	bit2	= 0 The specified waveform of the MFP generator is delivered at the MFP output pin = 1 The specified frequency of the Timer 1 is delivered at the MFP output pin	bit3	= 0 Timer 1 stop down-counting = 1 Timer 1 start down-counting								
bit0	= 0 The internal fundamental frequency of Timer 1 is Fosc = 1 The internal fundamental frequency of Timer 1 is Fosc/64																	
bit1	= 0 The fundamental frequency source of Timer 1 is internal clock = 1 The fundamental frequency source of Timer 1 is external clock via RC.0 input pin																	
bit2	= 0 The specified waveform of the MFP generator is delivered at the MFP output pin = 1 The specified frequency of the Timer 1 is delivered at the MFP output pin																	
bit3	= 0 Timer 1 stop down-counting = 1 Timer 1 start down-counting																	

Preliminary W741C20X



Instruction Set Table 2, continued

MOV PAGE, #I	Load immediate data to Page Register																																																																																																																						
Machine Code:	0 1 0 1 0 1 1 0						1 0 0 0 I3 I2 I1 I0																																																																																																																
Machine Cycle:	1																																																																																																																						
Operation:	Page Register ← I																																																																																																																						
Description:	The immediate data I are loaded to the PR. Bit 3 is reserved. Bit 0, bit 1, and bit 2 indirect addressing mode preselect bits:																																																																																																																						
	<table border="1"> <tr> <td>bit2</td> <td>bit1</td> <td>bit0</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>0</td> <td>0</td> <td>0</td> <td>= Page 0 (00H~0FH)</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>0</td> <td>0</td> <td>1</td> <td>= Page 1 (10H~1FH)</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>0</td> <td>1</td> <td>0</td> <td>= Page 2 (20H~2FH)</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>0</td> <td>1</td> <td>1</td> <td>= Page 3 (30H~3FH)</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>1</td> <td>0</td> <td>0</td> <td>= Page 4 (40H~4FH)</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>1</td> <td>0</td> <td>1</td> <td>= Page 5 (50H~5FH)</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>1</td> <td>1</td> <td>0</td> <td>= Page 6 (60H~6FH)</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>1</td> <td>1</td> <td>1</td> <td>= Page 7 (70H~7FH)</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> </table>											bit2	bit1	bit0										0	0	0	= Page 0 (00H~0FH)									0	0	1	= Page 1 (10H~1FH)									0	1	0	= Page 2 (20H~2FH)									0	1	1	= Page 3 (30H~3FH)									1	0	0	= Page 4 (40H~4FH)									1	0	1	= Page 5 (50H~5FH)									1	1	0	= Page 6 (60H~6FH)									1	1	1	= Page 7 (70H~7FH)								
bit2	bit1	bit0																																																																																																																					
0	0	0	= Page 0 (00H~0FH)																																																																																																																				
0	0	1	= Page 1 (10H~1FH)																																																																																																																				
0	1	0	= Page 2 (20H~2FH)																																																																																																																				
0	1	1	= Page 3 (30H~3FH)																																																																																																																				
1	0	0	= Page 4 (40H~4FH)																																																																																																																				
1	0	1	= Page 5 (50H~5FH)																																																																																																																				
1	1	0	= Page 6 (60H~6FH)																																																																																																																				
1	1	1	= Page 7 (70H~7FH)																																																																																																																				
MOV PEF, #I	Set/Reset Port Enable Flag																																																																																																																						
Machine Code:	0 1 0 0 0 0 1 1						0 0 0 0 I3 I2 I1 I0																																																																																																																
Machine Cycle:	1																																																																																																																						
Operation:	Port enable flag control																																																																																																																						
Description:	The data specified by I can cause HOLD mode to be released or an interrupt to occur. The signal change on port RC is specified.																																																																																																																						
	<table border="1"> <tr> <td>I0~I7</td> <td>Signal change at port RC</td> <td></td> </tr> <tr> <td>I0 = 1</td> <td>RC0</td> <td></td> </tr> <tr> <td>I1 = 1</td> <td>RC1</td> <td></td> </tr> <tr> <td>I2 = 1</td> <td>RC2</td> <td></td> </tr> <tr> <td>I3 = 1</td> <td>RC3</td> <td></td> </tr> </table>											I0~I7	Signal change at port RC											I0 = 1	RC0											I1 = 1	RC1											I2 = 1	RC2											I3 = 1	RC3																																																										
I0~I7	Signal change at port RC																																																																																																																						
I0 = 1	RC0																																																																																																																						
I1 = 1	RC1																																																																																																																						
I2 = 1	RC2																																																																																																																						
I3 = 1	RC3																																																																																																																						

Preliminary W741C20X



Instruction Set Table 2, continued

MOV PM0, #I	Set/Reset Port Mode 0 register																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>0</td><td>I3</td><td>I2</td><td>I1</td><td>I0</td></tr> </table>	0	1	0	1	0	0	1	1	0	0	0	0	I3	I2	I1	I0
0	1	0	1	0	0	1	1										
0	0	0	0	I3	I2	I1	I0										
Machine Cycle:	1																
Operation:	Set/Reset Port mode 0 register																
Description:	<p>I0 = 0: RA port is CMOS type; I0 = 1: RA port is NMOS type.</p> <p>I1 = 0: RB port is CMOS type; I1 = 1: RB port is NMOS type.</p> <p>I2 = 0: RC port pull-high resistor is disabled;</p> <p>I2 = 1: RC port pull-high resistor is enabled.</p> <p>I3 = 0: RD port pull-high resistor is disabled;</p> <p>I3 = 1: RD port pull-high resistor is enabled.</p>																
MOV PM1, #I	RA port independent Input/Output control																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>1</td><td>0</td><td>1</td><td>1</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>0</td><td>I3</td><td>I2</td><td>I1</td><td>I0</td></tr> </table>	0	1	0	1	0	1	1	1	0	0	0	0	I3	I2	I1	I0
0	1	0	1	0	1	1	1										
0	0	0	0	I3	I2	I1	I0										
Machine Cycle:	1																
Operation:	RA port 4 pins input/output control is independent.																
Description:	<p>I0 = 0: RA.0 is output pin; I0 = 1: RA.0 is input pin.</p> <p>I1 = 0: RA.1 is output pin; I1 = 1: RA.1 is input pin.</p> <p>I2 = 0: RA.2 is output pin; I2 = 1: RA.2 is input pin.</p> <p>I3 = 0: RA.3 is output pin; I3 = 1: RA.3 is input pin.</p> <p>Default condition RA port is input mode (PM = 1111B).</p>																
MOV PM2, #I	RB port independent Input/Output control																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>1</td><td>0</td><td>1</td><td>1</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>0</td><td>0</td><td>0</td><td>I3</td><td>I2</td><td>I1</td><td>I0</td></tr> </table>	0	1	0	1	0	1	1	1	1	0	0	0	I3	I2	I1	I0
0	1	0	1	0	1	1	1										
1	0	0	0	I3	I2	I1	I0										
Machine Cycle:	1																
Operation:	RB port 4 pins input/output control is independent.																
Description:	<p>I0 = 0: RB.0 is output pin; I0 = 1: RB.0 is input pin.</p> <p>I1 = 0: RB.1 is output pin; I1 = 1: RB.1 is input pin.</p> <p>I2 = 0: RB.2 is output pin; I2 = 1: RB.2 is input pin.</p> <p>I3 = 0: RB.3 is output pin; I3 = 1: RB.3 is input pin.</p> <p>Default condition RB port is input mode (PM2 = 1111B).</p>																

Preliminary W741C20X



Instruction Set Table 2, continued

MOV PM3, #I	Set/Reset Port Mode 3 register																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>1</td><td>0</td><td>1</td><td>1</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>0</td><td>I3</td><td>I2</td><td>I1</td><td>I0</td></tr> </table>	0	1	0	1	0	1	1	0	0	0	0	0	I3	I2	I1	I0
0	1	0	1	0	1	1	0										
0	0	0	0	I3	I2	I1	I0										
Machine Cycle:	1																
Operation:	Set/Reset Port mode 3 register																
Description:	<p>I0 is reserved.</p> <p>I1 = 0: The port RE is used as the output of the internal parallel port RT.</p> <p>I1 = 1: The port RE works as the serial input/output port.</p> <p>I2 is reserved.</p> <p>I3 = 0: Serial Tx rate = Fosc/2</p> <p>I3 = 1: Serial Tx rate = Fosc/256</p>																
MOV PM4, #I	RC port independent Input/Output control																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>1</td><td>1</td><td>0</td><td>1</td><td>1</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>0</td><td>I3</td><td>I2</td><td>I1</td><td>I0</td></tr> </table>	0	0	1	1	0	1	1	1	0	0	0	0	I3	I2	I1	I0
0	0	1	1	0	1	1	1										
0	0	0	0	I3	I2	I1	I0										
Machine Cycle:	1																
Operation:	RC port 4 pins input/output control is independent.																
Description:	<p>I0 = 0: RC.0 is output pin; I0 = 1: RC.0 is input pin.</p> <p>I1 = 0: RC.1 is output pin; I1 = 1: RC.1 is input pin.</p> <p>I2 = 0: RC.2 is output pin; I2 = 1: RC.2 is input pin.</p> <p>I3 = 0: RC.3 is output pin; I3 = 1: RC.3 is input pin.</p> <p>Default condition RC port is input mode (PM4 = 1111B).</p>																
MOV PM5, #I	RD port independent Input/Output control																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>1</td><td>1</td><td>0</td><td>1</td><td>1</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>0</td><td>0</td><td>0</td><td>I3</td><td>I2</td><td>I1</td><td>I0</td></tr> </table>	0	0	1	1	0	1	1	1	1	0	0	0	I3	I2	I1	I0
0	0	1	1	0	1	1	1										
1	0	0	0	I3	I2	I1	I0										
Machine Cycle:	1																
Operation:	RD port 4 pins input/output control is independent.																
Description:	<p>I0 = 0: RD.0 is output pin; I0 = 1: RD.0 is input pin.</p> <p>I1 = 0: RD.1 is output pin; I1 = 1: RD.1 is input pin.</p> <p>I2 = 0: RD.2 is output pin; I2 = 1: RD.2 is input pin.</p> <p>I3 = 0: RD.3 is output pin; I3 = 1: RD.3 is input pin.</p> <p>Default condition RD port is input mode (PM5 = 1111B).</p>																

Preliminary W741C20X



Instruction Set Table 2, continued

MOV R, ACC	Move ACC content to R														
Machine Code:	0 1 0 1 1 0 0 1					1 R6 R5 R4 R3 R2 R1 R0									
Machine Cycle:	1														
Operation:	$R \leftarrow (ACC)$														
Description:	The contents of the ACC are loaded to the data memory location addressed by R6 to R0.														
MOVA R, RA	Input RA port data to ACC & R														
Machine Code:	0 1 0 1 1 0 1 1					0 R6 R5 R4 R3 R2 R1 R0									
Machine Cycle:	1														
Operation:	ACC, R $\leftarrow [RA]$														
Description:	The data on port RA are loaded into the data memory location addressed by R6 to R0 and the ACC.														
Flag Affected:	ZF														
MOVA R, RB	Input RB port data to ACC & R														
Machine Code:	0 1 0 1 1 0 1 1					1 R6 R5 R4 R3 R2 R1 R0									
Machine Cycle:	1														
Operation:	ACC, R $\leftarrow [RB]$														
Description:	The data on port RB are loaded into the data memory location addressed by R6 to R0 and the ACC.														
Flag Affected:	ZF														

Preliminary W741C20X



Instruction Set Table 2, continued

MOVA R, RC	Input RC port data to ACC & R																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td><td>0</td><td>1</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	1	0	0	1	0	1	1	0	R6	R5	R4	R3	R2	R1	R0
0	1	0	0	1	0	1	1										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	ACC , R ← [RC]																
Description:	The input data on the input port RC are loaded into the data memory location addressed by R6 to R0 and the ACC.																
Flag Affected:	ZF																
MOVA R, RD	Input RD port data to ACC & R																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td><td>0</td><td>1</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	1	0	0	1	0	1	1	1	R6	R5	R4	R3	R2	R1	R0
0	1	0	0	1	0	1	1										
1	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	ACC , R ← [RD]																
Description:	The input data on the input port RD are loaded into the data memory location addressed by R6 to R0 and the ACC.																
Flag Affected:	ZF																
MOV R, WR	Move WR content to R																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>1</td><td>1</td><td>1</td><td>1</td><td>W3</td><td>W2</td><td>W1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>W0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	1	1	1	1	1	W3	W2	W1	W0	R6	R5	R4	R3	R2	R1	R0
1	1	1	1	1	W3	W2	W1										
W0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	R ← (WR)																
Description:	The contents of the WR are loaded to the data memory location addressed by R6 to R0.																

Preliminary W741C20X



Instruction Set Table 2, continued

MOV R, #I	Load immediate data to R																															
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>0</td><td>1</td><td>1</td><td>1</td><td>I3</td><td>I2</td><td>I1</td><td></td><td></td><td></td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>I0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td><td></td><td></td><td></td></tr> </table>										1	0	1	1	1	I3	I2	I1				I0	R6	R5	R4	R3	R2	R1	R0			
1	0	1	1	1	I3	I2	I1																									
I0	R6	R5	R4	R3	R2	R1	R0																									
Machine Cycle:	1																															
Operation:	$R \leftarrow I$																															
Description:	The immediate data I are loaded to the data memory location addressed by R6 to R0.																															
MOV RA, R	Output R content to RA port																															
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>1</td><td>1</td><td>0</td><td>1</td><td>0</td><td></td><td></td><td></td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td><td></td><td></td><td></td></tr> </table>										0	1	0	1	1	0	1	0				0	R6	R5	R4	R3	R2	R1	R0			
0	1	0	1	1	0	1	0																									
0	R6	R5	R4	R3	R2	R1	R0																									
Machine Cycle:	1																															
Operation:	$[RA] \leftarrow (R)$																															
Description:	The data in the data memory location addressed by R6 to R0 are output to the port RA.																															
MOV RB, R	Output R content to RB port																															
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>1</td><td>1</td><td>0</td><td>1</td><td>0</td><td></td><td></td><td></td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td><td></td><td></td><td></td></tr> </table>										0	1	0	1	1	0	1	0				1	R6	R5	R4	R3	R2	R1	R0			
0	1	0	1	1	0	1	0																									
1	R6	R5	R4	R3	R2	R1	R0																									
Machine Cycle:	1																															
Operation:	$[RB] \leftarrow (R)$																															
Description:	The contents of the data memory location addressed by R6 to R0 are output to the port RB.																															
MOV RC, R	Output R content to RC port																															
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>0</td><td>0</td><td>0</td><td>1</td><td>1</td><td>0</td><td>0</td><td></td><td></td><td></td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td><td></td><td></td><td></td></tr> </table>										1	0	0	0	1	1	0	0				0	R6	R5	R4	R3	R2	R1	R0			
1	0	0	0	1	1	0	0																									
0	R6	R5	R4	R3	R2	R1	R0																									
Machine Cycle:	1																															
Operation:	$[RC] \leftarrow (R)$																															
Description:	The data in the data memory location addressed by R6 to R0 are output to the port RC.																															

Preliminary W741C20X



Instruction Set Table 2, continued

MOV RD, R	Output R content to RD port																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>0</td><td>0</td><td>0</td><td>1</td><td>1</td><td>0</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	1	0	0	0	1	1	0	0	1	R6	R5	R4	R3	R2	R1	R0
1	0	0	0	1	1	0	0										
1	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	$[RD] \leftarrow (R)$																
Description:	The contents of the data memory location addressed by R6 to R0 are output to the port RD.																
MOV RE, R	Output R content to port RE																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>1</td><td>1</td><td>1</td><td>1</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	1	0	1	1	1	1	0	0	R6	R5	R4	R3	R2	R1	R0
0	1	0	1	1	1	1	0										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	$[RE] \leftarrow (R)$																
Description:	The contents of the data memory location addressed by R6 to R0 are output to port RE.																
MOV SEF, #I	Set/Reset STOP mode waked-up Enable Flag for port RC																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>0</td><td>I3</td><td>I2</td><td>I1</td><td>I0</td></tr> </table>	0	1	0	1	0	0	1	0	0	0	0	0	I3	I2	I1	I0
0	1	0	1	0	0	1	0										
0	0	0	0	I3	I2	I1	I0										
Machine Cycle:	1																
Operation:	Set/reset STOP mode wake-up enable flag for port RC																
Description:	<p>The data specified by I cause a wake-up from the STOP mode. The falling-edge signal on port RC can be specified independently.</p> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>I0~I7</td><td>Falling edge signal at port RC</td></tr> <tr><td>I0 = 1</td><td>RC0</td></tr> <tr><td>I1 = 1</td><td>RC1</td></tr> <tr><td>I2 = 1</td><td>RC2</td></tr> <tr><td>I3 = 1</td><td>RC3</td></tr> </table>	I0~I7	Falling edge signal at port RC	I0 = 1	RC0	I1 = 1	RC1	I2 = 1	RC2	I3 = 1	RC3						
I0~I7	Falling edge signal at port RC																
I0 = 1	RC0																
I1 = 1	RC1																
I2 = 1	RC2																
I3 = 1	RC3																

Preliminary W741C20X



Instruction Set Table 2, continued

MOV TM0, #I	Timer 0 set														
Machine Code:	0 0 0 1 0 0 0 0					I7 I6 I5 I4 I3 I2 I1 I0									
Machine Cycle:	1														
Operation:	Timer 0 set														
Description:	The data specified by I7 to I0 is loaded to the Timer 0 to start the timer.														
MOV TM0L, R	Move R content to TM0L														
Machine Code:	0 0 0 1 0 1 0 0					0 R6 R5 R4 R3 R2 R1 R0									
Machine Cycle:	1														
Operation:	TM0L ← (R)														
Description:	The content of the data memory location addressed by R6 to R0 are loaded into the TM0L.														
MOV TM0H, R	Move R content to TM0H														
Machine code:	0 0 0 1 0 1 0 0					1 R6 R5 R4 R3 R2 R1 R0									
Machine Cycle:	1														
Operation:	TM0H ← (R)														
Description:	The content of the data memory location addressed by R6 to R0 are loaded into the TM0H.														
MOV TM1, #I	Timer 1 set														
Machine Code:	0 0 0 1 0 0 0 1					I7 I6 I5 I4 I3 I2 I1 I0									
Machine Cycle:	1														
Operation:	Timer 1 set														
Description:	The data specified by I7 to I0 is loaded to the Timer 1 to start the timer.														

Preliminary W741C20X



Instruction Set Table 2, continued

MOV TM1L, R	Move R content to TM1L																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>1</td><td>0</td><td>1</td><td>0</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	0	0	1	0	1	0	1	0	R6	R5	R4	R3	R2	R1	R0
0	0	0	1	0	1	0	1										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	TM1L ← (R)																
Description:	The content of the data memory location addressed by R6 to R0 are loaded into the TM1L.																
MOV TM1H, R	Move R content to TM1H																
Machine code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>1</td><td>0</td><td>1</td><td>0</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	0	0	1	0	1	0	1	1	R6	R5	R4	R3	R2	R1	R0
0	0	0	1	0	1	0	1										
1	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	TM1H ← (R)																
Description:	The content of the data memory location addressed by R6 to R0 are loaded into the TM1H.																
MOV WR, R	Move R content to WR																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>1</td><td>1</td><td>0</td><td>1</td><td>W3</td><td>W2</td><td>W1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>W0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	1	1	1	0	1	W3	W2	W1	W0	R6	R5	R4	R3	R2	R1	R0
1	1	1	0	1	W3	W2	W1										
W0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	WR ← (R)																
Description:	The contents of the data memory location addressed by R6 to R0 are loaded to the WR.																
MOV WR, @R	Indirect load from R to WR																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>1</td><td>0</td><td>0</td><td>1</td><td>W3</td><td>W2</td><td>W1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>W0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	1	1	0	0	1	W3	W2	W1	W0	R6	R5	R4	R3	R2	R1	R0
1	1	0	0	1	W3	W2	W1										
W0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	2																
Operation:	WR ← [PR (bit2, bit1, bit0) × 10H + (R)]																
Description:	The data memory contents of address [PR (bit2, bit1, bit0) × 10H + (R)] are loaded to the WR.																

Preliminary W741C20X



Instruction Set Table 2, continued

MOV @R, WR	Indirect load from WR to R																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr> <td>1</td><td>1</td><td>0</td><td>1</td><td>1</td><td>W3</td><td>W2</td><td>W1</td> </tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr> <td>W0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td> </tr> </table>	1	1	0	1	1	W3	W2	W1	W0	R6	R5	R4	R3	R2	R1	R0
1	1	0	1	1	W3	W2	W1										
W0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	2																
Operation:	$[PR \text{ (bit2, bit1, bit0)} \times 10H + (R)] \leftarrow WR$																
Description:	The contents of the WR are loaded to the data memory location addressed by $[PR \text{ (bit2, bit1, bit0)} \times 10H + (R)]$.																
MOV PAGE, R	Move R content to Page Register																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr> <td>0</td><td>1</td><td>0</td><td>1</td><td>1</td><td>1</td><td>1</td><td>0</td> </tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr> <td>1</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td> </tr> </table>	0	1	0	1	1	1	1	0	1	R6	R5	R4	R3	R2	R1	R0
0	1	0	1	1	1	1	0										
1	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	$PR \leftarrow (R)$																
Description:	The contents of the data memory location addressed by R6 to R0 are loaded to the PR.																
MOVA R, CF	Move CF content to ACC.0 & R.0																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr> <td>0</td><td>1</td><td>0</td><td>1</td><td>1</td><td>0</td><td>0</td><td>1</td> </tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr> <td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td> </tr> </table>	0	1	0	1	1	0	0	1	0	R6	R5	R4	R3	R2	R1	R0
0	1	0	1	1	0	0	1										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	$ACC.0, R.0 \leftarrow (CF)$																
Description:	The content of CF is loaded to bit 0 of the data memory location addressed by R6 to R0 and the ACC. The other bits of the data memory and ACC are reset to "0."																
Flag Affected:	ZF																

Preliminary W741C20X



Instruction Set Table 2, continued

MOVA R, HCFH	Move HCF4~7 to ACC & R																															
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td><td></td><td></td><td></td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td><td></td><td></td><td></td></tr> </table>										0	1	0	0	1	0	0	1				1	R6	R5	R4	R3	R2	R1	R0			
0	1	0	0	1	0	0	1																									
1	R6	R5	R4	R3	R2	R1	R0																									
Machine Cycle:	1																															
Operation:	ACC, R \leftarrow HCF4~7																															
Description:	<p>The contents of HCF bit 4 to bit 7 (HCF4 to HCF7) are loaded to the data memory location addressed by R6 to R0 and the ACC. The ACC contents and the meaning of the bits after execution of this instruction are as follows:</p> <table border="1" style="margin-left: 20px;"> <tr><td>Bit 0</td><td>HCF4: "1" when the HOLD mode is released by the falling edge signal at the INT pin.</td></tr> <tr><td>Bit 1</td><td>HCF5: "1" when the HOLD mode is released by underflow from Timer 1.</td></tr> <tr><td>Bit 2</td><td>HCF6: "1" when the HOLD mode is released by the serial port receiving completely.</td></tr> <tr><td>Bit 3</td><td>HCF7: "1" when the HOLD mode is released by the serial port transmitting completely.</td></tr> </table>										Bit 0	HCF4: "1" when the HOLD mode is released by the falling edge signal at the INT pin.	Bit 1	HCF5: "1" when the HOLD mode is released by underflow from Timer 1.	Bit 2	HCF6: "1" when the HOLD mode is released by the serial port receiving completely.	Bit 3	HCF7: "1" when the HOLD mode is released by the serial port transmitting completely.														
Bit 0	HCF4: "1" when the HOLD mode is released by the falling edge signal at the INT pin.																															
Bit 1	HCF5: "1" when the HOLD mode is released by underflow from Timer 1.																															
Bit 2	HCF6: "1" when the HOLD mode is released by the serial port receiving completely.																															
Bit 3	HCF7: "1" when the HOLD mode is released by the serial port transmitting completely.																															
Flag Affected:	ZF																															
MOVA R, HCFL	Move HCF0~3 to ACC & R																															
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td><td></td><td></td><td></td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td><td></td><td></td><td></td></tr> </table>										0	1	0	0	1	0	0	1				0	R6	R5	R4	R3	R2	R1	R0			
0	1	0	0	1	0	0	1																									
0	R6	R5	R4	R3	R2	R1	R0																									
Machine Cycle:	1																															
Operation:	ACC, R \leftarrow HCF0~3																															
Description:	<p>The contents of HCF bit 0 to bit 3 (HCF0 to HCF3) are loaded to the data memory location addressed by R6 to R0 and the ACC. The ACC contents and the meaning of the bits after execution of this instruction are as follows:</p> <table border="1" style="margin-left: 20px;"> <tr><td>Bit 0</td><td>HCF0: "1" when the HOLD mode is released by overflow from the Divider 0.</td></tr> <tr><td>Bit 1</td><td>HCF1: "1" when the HOLD mode is released by underflow from Timer 0.</td></tr> <tr><td>Bit 2</td><td>HCF2: "1" when the HOLD mode is released by a signal change on port RC.</td></tr> <tr><td>Bit 3</td><td>Reserved.</td></tr> </table>										Bit 0	HCF0: "1" when the HOLD mode is released by overflow from the Divider 0.	Bit 1	HCF1: "1" when the HOLD mode is released by underflow from Timer 0.	Bit 2	HCF2: "1" when the HOLD mode is released by a signal change on port RC.	Bit 3	Reserved.														
Bit 0	HCF0: "1" when the HOLD mode is released by overflow from the Divider 0.																															
Bit 1	HCF1: "1" when the HOLD mode is released by underflow from Timer 0.																															
Bit 2	HCF2: "1" when the HOLD mode is released by a signal change on port RC.																															
Bit 3	Reserved.																															
Flag Affected:	ZF																															

Preliminary W741C20X



Instruction Set Table 2, continued

MOVA R, PAGE	Move Page Register content to ACC & R																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>1</td><td>1</td><td>1</td><td>1</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	1	0	1	1	1	1	1	1	R6	R5	R4	R3	R2	R1	R0
0	1	0	1	1	1	1	1										
1	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	ACC , R ← (Page Register)																
Description:	The contents of the Page Register (PR) are loaded to the data memory location addressed by R6 to R0 and the ACC.																
Flag Affected:	ZF																
MOVA R, PSR0	Move Port Status Register 0 content to ACC & R																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td><td>1</td><td>1</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	1	0	0	1	1	1	1	0	R6	R5	R4	R3	R2	R1	R0
0	1	0	0	1	1	1	1										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	ACC, R ← RC port signal change flag (PSR0)																
Description:	The contents of the RC port signal change flag (PSR0) are loaded to the data memory location addressed by R6 to R0 and the ACC. When the signal changes on any pin of the RC port, the corresponding signal change flag should be set to 1. Otherwise, it should be 0.																
Flag Affected:	ZF																
MOVA R, PSR2	Move Port Status Register 0 content to ACC & R																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>1</td><td>1</td><td>1</td><td>1</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	1	0	1	1	1	1	1	0	R6	R5	R4	R3	R2	R1	R0
0	1	0	1	1	1	1	1										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	ACC, R ← Serial I/O port status flags (PSR2)																
Description:	The contents of the serial I/O port status flags (PSR2) are loaded to the data memory location addressed by R6 to R0 and the ACC.																
Flag Affected:	ZF																

Preliminary W741C20X



Instruction Set Table 2, continued

MOVA R, WR	Move WR content to ACC & R																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>1</td><td>1</td><td>1</td><td>W3</td><td>W2</td><td>W1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>W0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	1	1	1	1	W3	W2	W1	W0	R6	R5	R4	R3	R2	R1	R0
0	1	1	1	1	W3	W2	W1										
W0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	ACC, R \leftarrow (WR)																
Description:	The contents of the WR are loaded to the ACC and the data memory location addressed by R6 to R0.																
Flag Affected:	ZF																
MOVA WR, R	Move R content to ACC & WR																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>1</td><td>0</td><td>1</td><td>W3</td><td>W2</td><td>W1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>W0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	1	1	0	1	W3	W2	W1	W0	R6	R5	R4	R3	R2	R1	R0
0	1	1	0	1	W3	W2	W1										
W0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	ACC, WR \leftarrow (R)																
Description:	The contents of the data memory location addressed by R6 to R0 are loaded to the WR and the ACC.																
Flag Affected:	ZF																
MOV TABL, R	Move R content to TABL																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>0</td><td>0</td><td>1</td><td>1</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	1	0	0	1	1	0	0	0	0	R6	R5	R4	R3	R2	R1	R0
1	0	0	1	1	0	0	0										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	TABL \leftarrow (R)																
Description:	The content of the data memory location addressed by R6 to R0 are loaded into the TABL.																
MOV TABH, R	Move R content to TABH																
Machine code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>0</td><td>0</td><td>1</td><td>1</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	1	0	0	1	1	0	0	0	1	R6	R5	R4	R3	R2	R1	R0
1	0	0	1	1	0	0	0										
1	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	TABH \leftarrow (R)																
Description:	The content of the data memory location addressed by R6 to R0 are loaded into the TABH.																

Preliminary W741C20X



Instruction Set Table 2, continued

MOVC R	Move look-up table ROM addressed by TABL and TABH to R																
Machine code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>0</td><td>0</td><td>1</td><td>1</td><td>0</td><td>0</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	1	0	0	1	1	0	0	1	0	R6	R5	R4	R3	R2	R1	R0
1	0	0	1	1	0	0	1										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	2																
Operation:	$WR \leftarrow [(TABH) \times 10H + (TABL)]$																
Description:	The contents of the look-up table ROM location addressed by TABH and TABL are loaded to R.																
NOP	No Operation																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table>	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0	0	0	0	0	0	0	0										
0	0	0	0	0	0	0	0										
Machine Cycle:	1																
Operation:	No Operation																
ORL R, ACC	OR R to ACC																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>1</td><td>1</td><td>1</td><td>0</td><td>1</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	0	1	1	1	0	1	0	0	R6	R5	R4	R3	R2	R1	R0
0	0	1	1	1	0	1	0										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	$ACC \leftarrow (R) \wedge (ACC)$																
Description:	The contents of the data memory location addressed by R6 to R0 and the ACC are ORed and the result is loaded into the ACC.																
Flag Affected:	ZF																
ORL WR , #I	OR immediate data to WR																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>1</td><td>1</td><td>1</td><td>1</td><td>1</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>I3</td><td>I2</td><td>I1</td><td>I0</td><td>W3</td><td>W2</td><td>W1</td><td>W0</td></tr> </table>	0	0	1	1	1	1	1	0	I3	I2	I1	I0	W3	W2	W1	W0
0	0	1	1	1	1	1	0										
I3	I2	I1	I0	W3	W2	W1	W0										
Machine Cycle:	1																
Operation:	$ACC \leftarrow (WR) \wedge I$																
Description:	The contents of the Working Register (WR) and the immediate data I are ORed and the result is loaded into the ACC.																
Flag Affected:	ZF																

Preliminary W741C20X



Instruction Set Table 2, continued

ORLR R, ACC	OR R to ACC																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>1</td><td>1</td><td>1</td><td>0</td><td>1</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	0	1	1	1	0	1	1	0	R6	R5	R4	R3	R2	R1	R0
0	0	1	1	1	0	1	1										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	ACC, R \leftarrow (R) \wedge (ACC)																
Description:	The contents of the data memory location addressed by R6 to R0 and the ACC are ORed and the result is placed in the data memory and the ACC.																
Flag Affected:	ZF																
ORLR WR , #I	OR immediate data to WR																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>1</td><td>1</td><td>1</td><td>1</td><td>1</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>I3</td><td>I2</td><td>I1</td><td>I0</td><td>W3</td><td>W2</td><td>W1</td><td>W0</td></tr> </table>	0	0	1	1	1	1	1	1	I3	I2	I1	I0	W3	W2	W1	W0
0	0	1	1	1	1	1	1										
I3	I2	I1	I0	W3	W2	W1	W0										
Machine Cycle:	1																
Operation:	ACC, WR \leftarrow (WR) \wedge I																
Description:	The contents of the Working Register(WR) and the immediate data I are ORed and the result is placed in the WR and the ACC.																
Flag Affected:	ZF																
RLC R	Rotate Left R with CF																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td><td>1</td><td>0</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	1	0	0	1	1	0	0	1	R6	R5	R4	R3	R2	R1	R0
0	1	0	0	1	1	0	0										
1	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	ACC.n, R.n \leftarrow (R.n-1); ACC.0, R.0 \leftarrow CF; CF \leftarrow R.3																
Description:	The contents of the ACC and the data memory location addressed by R6 to R0 are rotated left one bit, bit 3 is rotated into CF, and CF rotated into bit 0 (LSB). The same contents are loaded into the ACC.																
Flag Affected:	CF & ZF																

Preliminary W741C20X



Instruction Set Table 2, continued

RRC R	Rotate Right R with CF																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td><td>1</td><td>0</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	1	0	0	1	1	0	1	1	R6	R5	R4	R3	R2	R1	R0
0	1	0	0	1	1	0	1										
1	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	ACC.n, R.n \leftarrow (R.n+1); ACC.3, R.3 \leftarrow CF; CF \leftarrow R.0																
Description:	The contents of the ACC and the data memory location addressed by R6 to R0 are rotated right one bit, bit 0 is rotated into CF, and CF is rotated into bit 3 (MSB). The same contents are loaded into the ACC.																
Flag Affected:	CF & ZF																
RTN	Return from subroutine																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table>	0	0	0	0	0	0	0	1	0	0	0	0	0	0	0	0
0	0	0	0	0	0	0	1										
0	0	0	0	0	0	0	0										
Machine Cycle:	1																
Operation:	(PC) \leftarrow STACK																
Description:	The program counter (PC10 to PC0) is restored from the stack. A return from a subroutine occurs.																
SBC R, ACC	Subtract ACC from R with Borrow																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>0</td><td>1</td><td>0</td><td>1</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	0	0	0	1	0	1	0	0	R6	R5	R4	R3	R2	R1	R0
0	0	0	0	1	0	1	0										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	ACC \leftarrow (R) - (ACC) - (CF)																
Description:	The contents of the ACC and CF are binary subtracted from the contents of the data memory location addressed by R6 to R0 and the result is loaded into the ACC.																
Flag Affected:	CF & ZF																

Preliminary W741C20X



Instruction Set Table 2, continued

SBC	WR, #I	Subtract immediate data from WR with Borrow
Machine Code:	0 0 0 0 1 1 1 0	I3 I2 I1 I0 W3 W2 W1 W0
Machine Cycle:	1	
Operation:	ACC \leftarrow (WR) - I - (CF)	
Description:	The immediate data I and CF are binary subtracted from the contents of the WR and the result is loaded into the ACC.	
Flag Affected:	CF & ZF	
SBCR	R, ACC	Subtract ACC from R with Borrow
Machine Code:	0 0 0 0 1 0 1 1	0 R6 R5 R4 R3 R2 R1 R0
Machine Cycle:	1	
Operation:	ACC, R \leftarrow (R) - (ACC) - (CF)	
Description:	The contents of the ACC and CF are binary subtracted from the contents of the data memory location addressed by R6 to R0 and the result is placed in the ACC and the data memory.	
Flag Affected:	CF & ZF	
SBCR	WR, #I	Subtract immediate data from WR with Borrow
Machine Code:	0 0 0 0 1 1 1 1	I3 I2 I1 I0 W3 W2 W1 W0
Machine Cycle:	1	
Operation:	ACC, R \leftarrow (WR) - I - (CF)	
Description:	The immediate data I and CF are binary subtracted from the contents of the WR and the result is placed in the ACC and the WR.	
Flag Affected:	CF & ZF	

Preliminary W741C20X



Instruction Set Table 2, continued

SET CF	Set CF																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>1</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr> </table>	0	1	0	1	0	0	0	0	0	1	0	0	0	0	0	0
0	1	0	1	0	0	0	0										
0	1	0	0	0	0	0	0										
Machine Cycle:	1																
Operation:	Set CF																
Description:	Set Carry Flag to 1.																
Flag Affected:	CF																
SET PMF, #I	Set ParaMeter Flag																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>1</td><td>0</td><td>1</td><td>1</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>0</td><td>I3</td><td>I2</td><td>I1</td><td>I0</td></tr> </table>	0	0	0	1	0	1	1	0	0	0	0	0	I3	I2	I1	I0
0	0	0	1	0	1	1	0										
0	0	0	0	I3	I2	I1	I0										
Machine Cycle:	1																
Operation:	Set Parameter Flag																
Description:	<p>Description of each flag:</p> <p>I0, I1, I2 : Reserved</p> <p>I3 = 1 : The input clock of the watchdog timer is Fosc/16384.</p>																
SHLC R	SHift Left R with CF and LSB = 0																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td><td>1</td><td>0</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	1	0	0	1	1	0	0	0	R6	R5	R4	R3	R2	R1	R0
0	1	0	0	1	1	0	0										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	ACC.n, R.n \leftarrow (R.n-1); ACC.0, R.0 \leftarrow 0; CF \leftarrow R.3																
Description:	The contents of the ACC and the data memory location addressed by R6 to R0 are shifted left one bit, but bit 3 is shifted into CF, and bit 0 (LSB) is replaced with "0." The same contents are loaded into the ACC.																
Flag Affected:	CF & ZF																

Preliminary W741C20X



Instruction Set Table 2, continued

SHRC R	SHift Right R with CF and MSB = 0																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td><td>1</td><td>0</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	1	0	0	1	1	0	1	0	R6	R5	R4	R3	R2	R1	R0
0	1	0	0	1	1	0	1										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	ACC.n, R.n \leftarrow (R.n+1); ACC.3, R.3 \leftarrow 0; CF \leftarrow R.0																
Description:	The contents of the ACC and the data memory location addressed by R6 to R0 are shifted right one bit, but bit 0 is shifted into CF, and bit 3 (MSB) is replaced with "0." The same contents are loaded into the ACC.																
Flag Affected:	CF & ZF																
SKB0 R	If bit 0 of R is equal to 1 then skip																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>0</td><td>0</td><td>0</td><td>1</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	1	0	0	0	1	0	0	0	0	R6	R5	R4	R3	R2	R1	R0
1	0	0	0	1	0	0	0										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	PC \leftarrow (PC) + 2; if R.0 = 1 "1"																
Description:	If bit 0 of R is equal to 1, the program counter is incremented by 2 and a skip is produced. If bit 0 of R is not equal to 1, the program counter (PC) is incremented.																
SKB1 R	If bit 1 of R is equal to 1 then skip																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>0</td><td>0</td><td>0</td><td>1</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>1</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	1	0	0	0	1	0	0	0	1	R6	R5	R4	R3	R2	R1	R0
1	0	0	0	1	0	0	0										
1	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	PC \leftarrow (PC) + 2; if R.1 = 1 "1"																
Description:	If bit 1 of R is equal to 1, the program counter is incremented by 2 and a skip is produced. If bit 1 of R is not equal to 1, the program counter (PC) is incremented.																

Preliminary W741C20X



Instruction Set Table 2, continued

SKB2 R	If bit 2 of R is equal to 1 then skip											
Machine Code:	1 0 0 0 1 0 1 0				0 R6 R5 R4 R3 R2 R1 R0							
Machine Cycle:	1											
Operation:	$PC \leftarrow (PC) + 2$; if $R.2 = 1$ “1”											
Description:	If bit 2 of R is equal to 1, the program counter is incremented by 2 and a skip is produced. If bit 2 of R is not equal to 1, the program counter (PC) is incremented.											
SKB3 R	If bit 3 of R is equal to 1 then skip											
Machine Code:	1 0 0 0 1 0 1 0				1 R6 R5 R4 R3 R2 R1 R0							
Machine Cycle:	1											
Operation:	$PC \leftarrow (PC) + 2$; if $R.3 = 1$ “1”											
Description:	If bit 3 of R is equal to 1, the program counter is incremented by 2 and a skip is produced. If bit 3 of R is not equal to 1, the program counter (PC) is incremented.											
STOP	Enter the STOP mode											
Machine Code:	0 0 0 0 0 0 0 0				1 1 0 0 0 0 0 0							
Machine Cycle:	1											
Operation:	STOP oscillator											
Description:	Device enters STOP mode. When the falling edge signal of RC port is accepted, the μ C will wake up and execute the next instruction.											

Preliminary W741C20X



Instruction Set Table 2, continued

SUB R, ACC	Subtract ACC from R																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>1</td><td>1</td><td>0</td><td>1</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	0	0	1	1	0	1	0	0	R6	R5	R4	R3	R2	R1	R0
0	0	0	1	1	0	1	0										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	$ACC \leftarrow (R) - (ACC)$																
Description:	The contents of the ACC are binary subtracted from the contents of the data memory location addressed by R6 to R0 and the result is loaded into the ACC.																
Flag Affected:	CF & ZF																
SUB WR , #I	Subtract immediate data from WR																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>1</td><td>1</td><td>1</td><td>1</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>I3</td><td>I2</td><td>I1</td><td>I0</td><td>W3</td><td>W2</td><td>W1</td><td>W0</td></tr> </table>	0	0	0	1	1	1	1	0	I3	I2	I1	I0	W3	W2	W1	W0
0	0	0	1	1	1	1	0										
I3	I2	I1	I0	W3	W2	W1	W0										
Machine Cycle:	1																
Operation:	$ACC \leftarrow (WR) - I$																
Description:	The immediate data I are binary subtracted from the contents of the WR and the result is loaded into the ACC.																
Flag Affected:	CF & ZF																
SUBR R, ACC	Subtract ACC from R																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>1</td><td>1</td><td>0</td><td>1</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	0	0	1	1	0	1	1	0	R6	R5	R4	R3	R2	R1	R0
0	0	0	1	1	0	1	1										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	$ACC, R \leftarrow (R) - (ACC)$																
Description:	The contents of the ACC are binary subtracted from the contents of the data memory location addressed by R6 to R0 and the result is placed in the ACC and the data memory.																
Flag Affected:	CF & ZF																

Preliminary W741C20X



Instruction Set Table 2, continued

SUBR	WR, #I	Subtract immediate data from WR																
Machine Code:		<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>0</td><td>1</td><td>1</td><td>1</td><td>1</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>I3</td><td>I2</td><td>I1</td><td>I0</td><td>W3</td><td>W2</td><td>W1</td><td>W0</td></tr> </table>	0	0	0	1	1	1	1	1	I3	I2	I1	I0	W3	W2	W1	W0
0	0	0	1	1	1	1	1											
I3	I2	I1	I0	W3	W2	W1	W0											
Machine Cycle:		1																
Operation:		ACC, WR \leftarrow (WR) - I																
Description:		The immediate data I are binary subtracted from the contents of the WR and the result is placed in the ACC and the WR.																
Flag Affected:		CF & ZF																
XRL	R, ACC	Exclusive OR R to ACC																
Machine Code:		<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>1</td><td>1</td><td>1</td><td>0</td><td>0</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	0	1	1	1	0	0	0	0	R6	R5	R4	R3	R2	R1	R0
0	0	1	1	1	0	0	0											
0	R6	R5	R4	R3	R2	R1	R0											
Machine Cycle:		1																
Operation:		ACC \leftarrow (R) EX (ACC)																
Description:		The contents of the data memory location addressed by R6 to R0 and the ACC are exclusive-ORed and the result is loaded into the ACC.																
Flag Affected:		ZF																
XRL	WR, #I	Exclusive OR immediate data to WR																
Machine Code:		<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>1</td><td>1</td><td>1</td><td>1</td><td>0</td><td>0</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>I3</td><td>I2</td><td>I1</td><td>I0</td><td>W3</td><td>W2</td><td>W1</td><td>W0</td></tr> </table>	0	0	1	1	1	1	0	0	I3	I2	I1	I0	W3	W2	W1	W0
0	0	1	1	1	1	0	0											
I3	I2	I1	I0	W3	W2	W1	W0											
Machine Cycle:		1																
Operation:		ACC \leftarrow (WR) EX I																
Description:		The contents of the Working Register (WR) and the immediate data I are exclusive-ORed and the result is loaded into the ACC.																
Flag Affected:		ZF																

Preliminary W741C20X



Instruction Set Table 2, continued


XRLR R, ACC	Exclusive OR R to ACC																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>1</td><td>1</td><td>1</td><td>0</td><td>0</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>R6</td><td>R5</td><td>R4</td><td>R3</td><td>R2</td><td>R1</td><td>R0</td></tr> </table>	0	0	1	1	1	0	0	1	0	R6	R5	R4	R3	R2	R1	R0
0	0	1	1	1	0	0	1										
0	R6	R5	R4	R3	R2	R1	R0										
Machine Cycle:	1																
Operation:	ACC, R \leftarrow (R) EX (ACC)																
Description:	The contents of the data memory location addressed by R6 to R0 and the ACC are exclusive-ORed and the result is placed in the data memory and the ACC.																
Flag Affected:	ZF																
XRLR WR, #I	Exclusive OR immediate data to WR																
Machine Code:	<table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>0</td><td>0</td><td>1</td><td>1</td><td>1</td><td>1</td><td>0</td><td>1</td></tr> </table> <table border="1" style="display: inline-table; vertical-align: middle;"> <tr><td>I3</td><td>I2</td><td>I1</td><td>I0</td><td>W3</td><td>W2</td><td>W1</td><td>W0</td></tr> </table>	0	0	1	1	1	1	0	1	I3	I2	I1	I0	W3	W2	W1	W0
0	0	1	1	1	1	0	1										
I3	I2	I1	I0	W3	W2	W1	W0										
Machine Cycle:	1																
Operation:	ACC, WR \leftarrow (WR) EX I																
Description:	The contents of the Working Register(WR) and the immediate data I are exclusive-ORed and the result is placed in the WR and the ACC.																
Flag Affected:	ZF																

Preliminary W741C20X



PACKAGE DIMENSIONS


18L PDIP-300mil

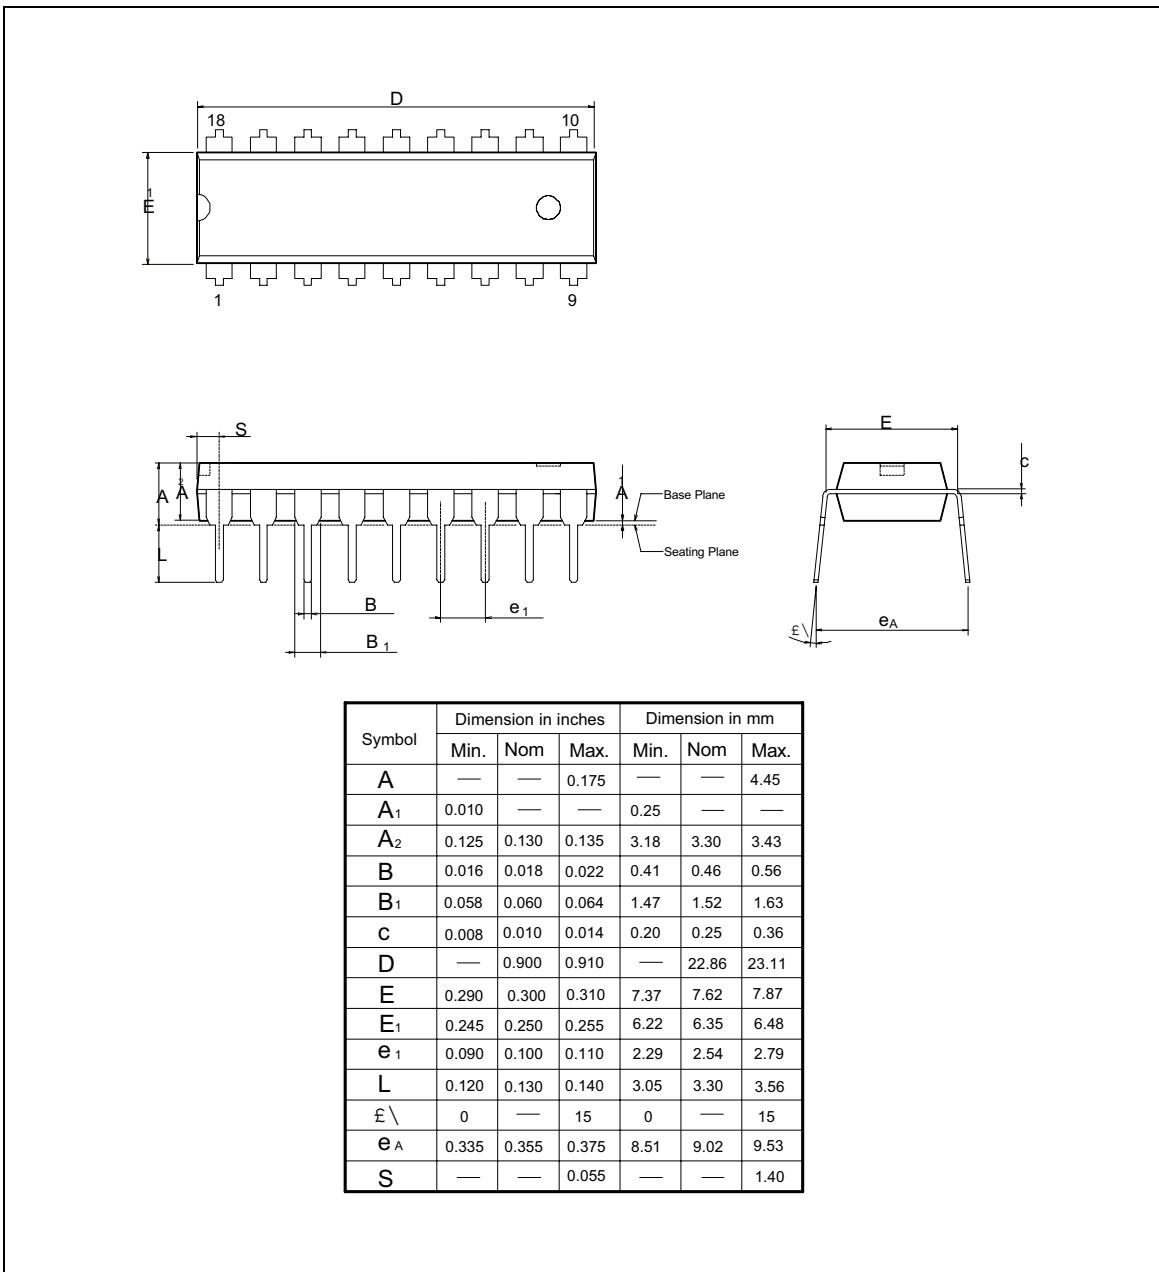

Preliminary W741C20X




20L PDIP

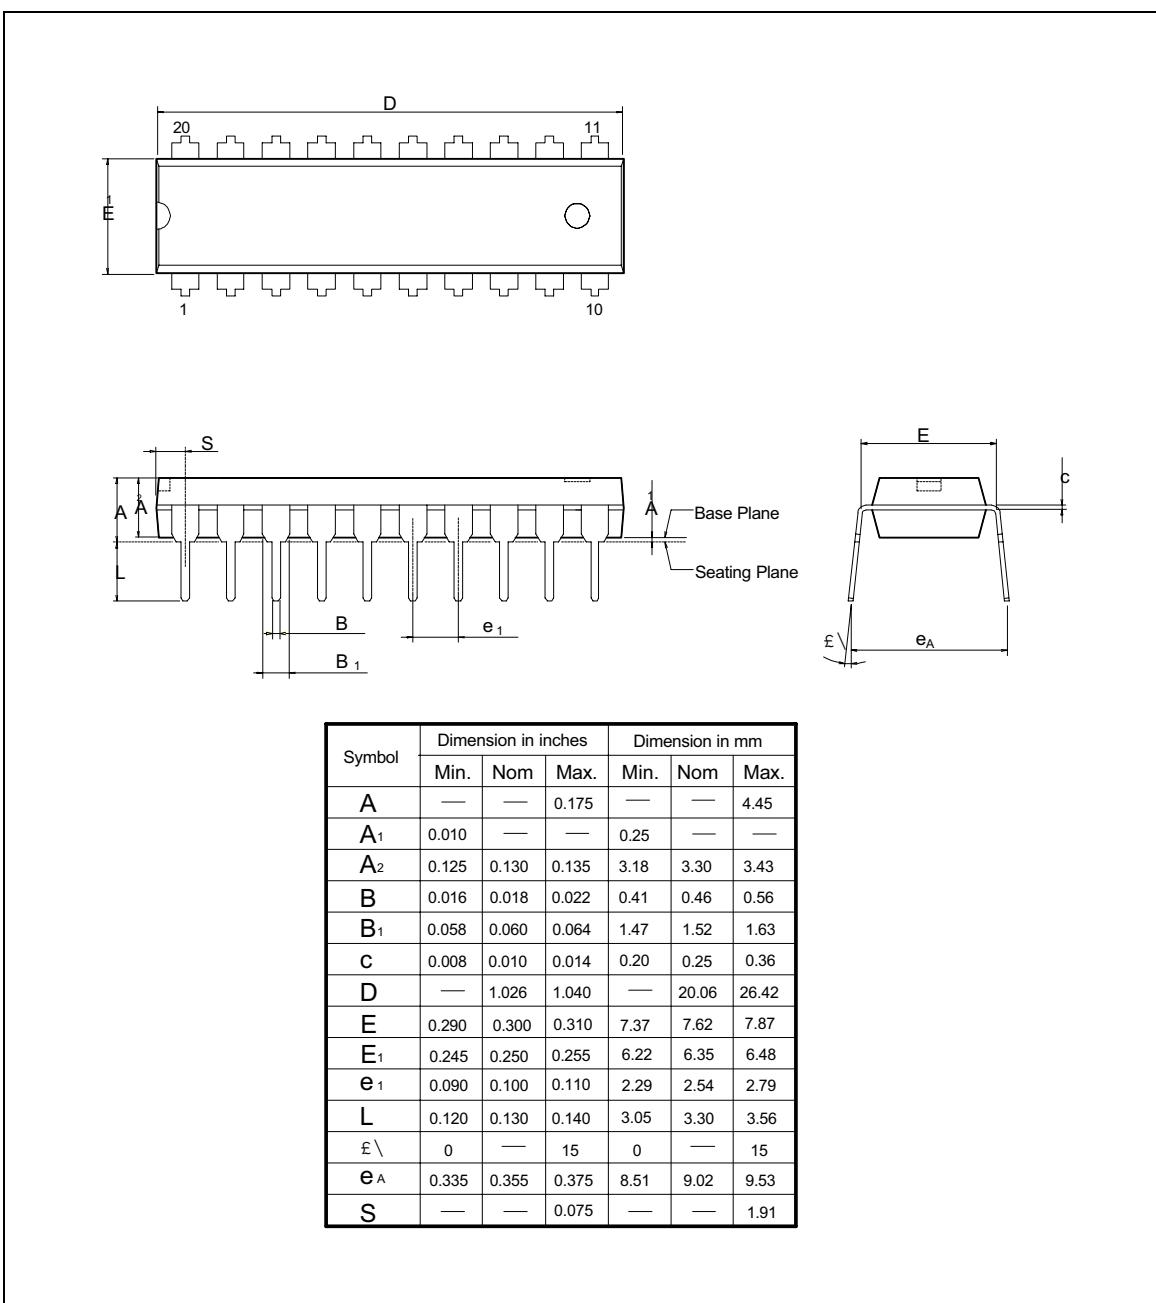

Preliminary W741C20X




28-Lead P-DIP Skinny

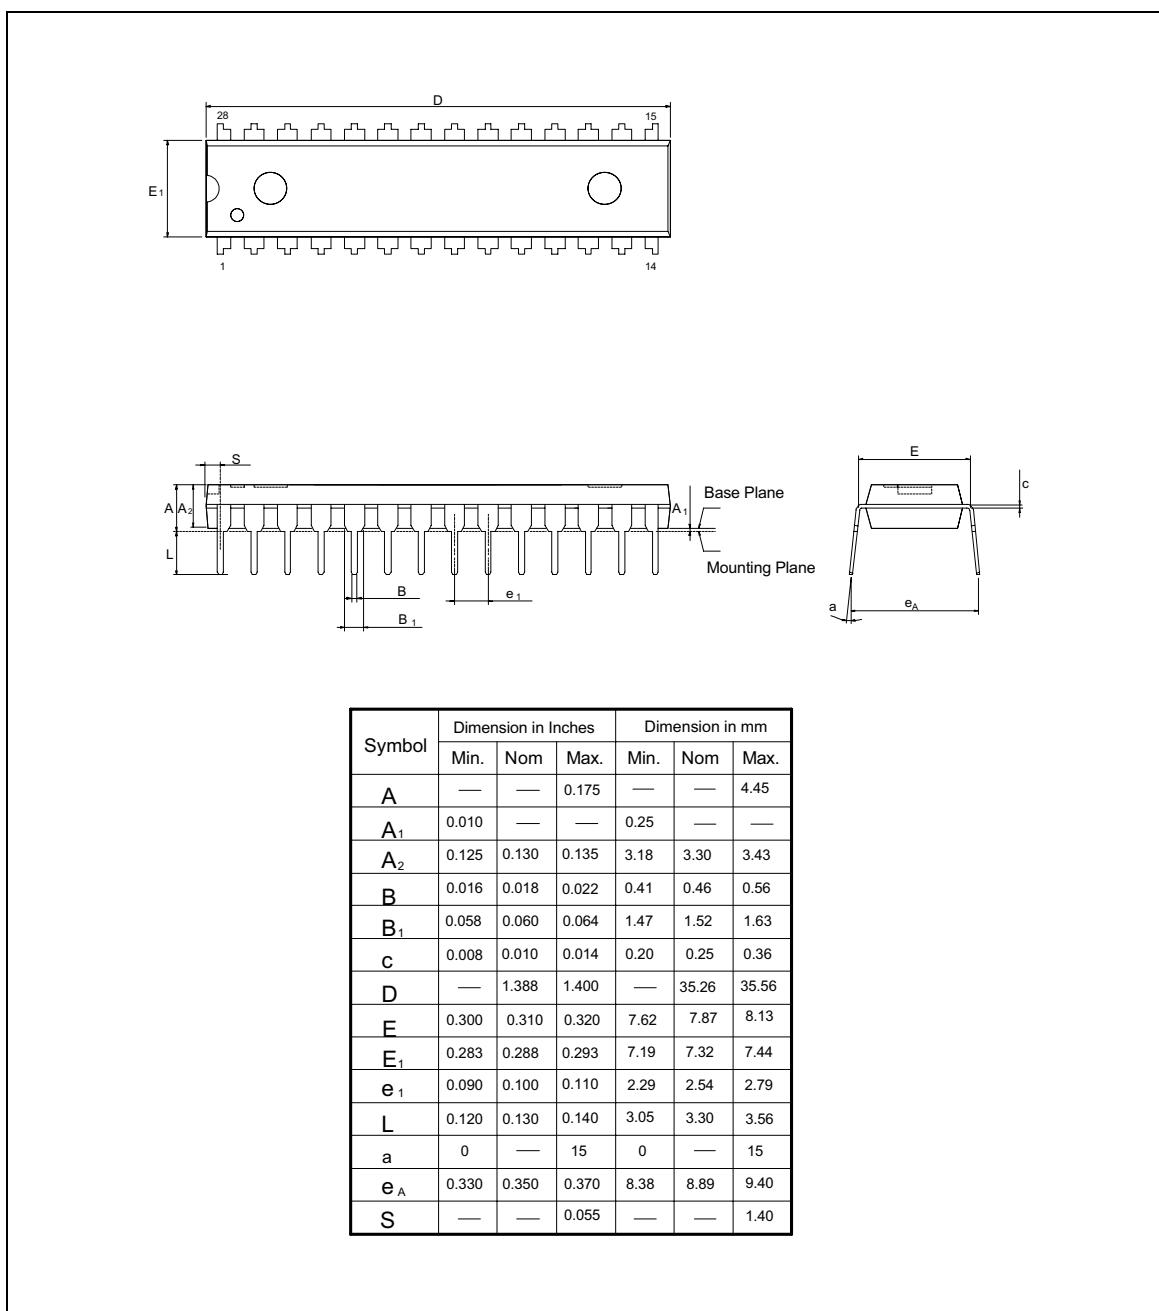

Preliminary W741C20X



20L SOP-300mil

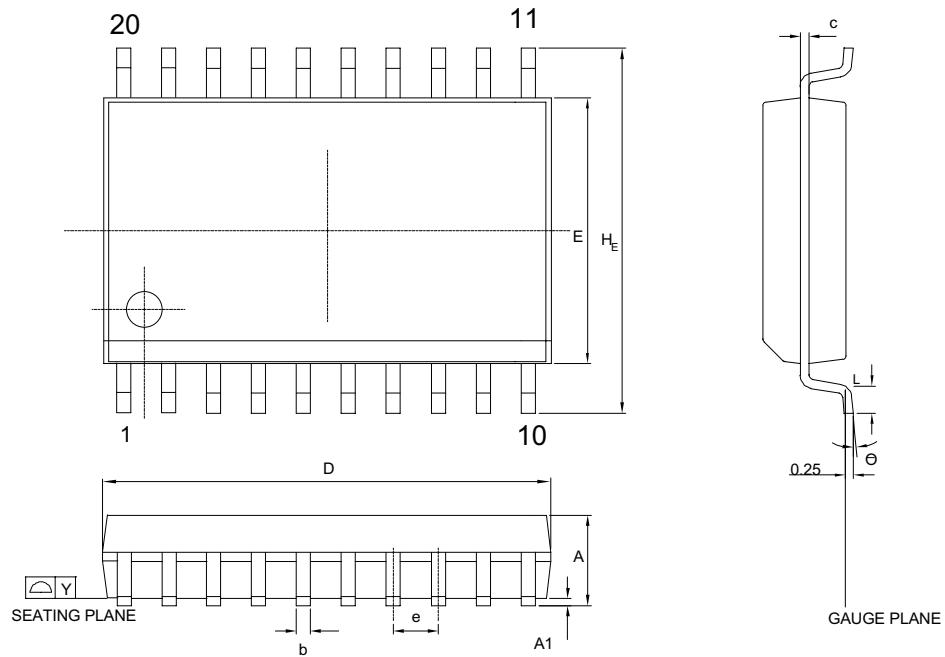


Control dimensions are in milimeters .

Symbol	Dimension in mm		Dimension in inches	
	Min.	Max.	Min.	Max.
A	2.35	2.65	0.093	0.104
A1	0.10	0.30	0.004	0.012
b	0.33	0.51	0.013	0.020
c	0.23	0.32	0.009	0.013
E	7.40	7.60	0.291	0.299
D	12.60	13.00	0.496	0.512
e	1.27 BSC		0.050 BSC	
H _E	10.00	10.65	0.394	0.419
Y	0.10		0.004	
L	0.40	1.27	0.016	0.050
q	0	8	0	8

Preliminary W741C20X



28L SOP-300mil

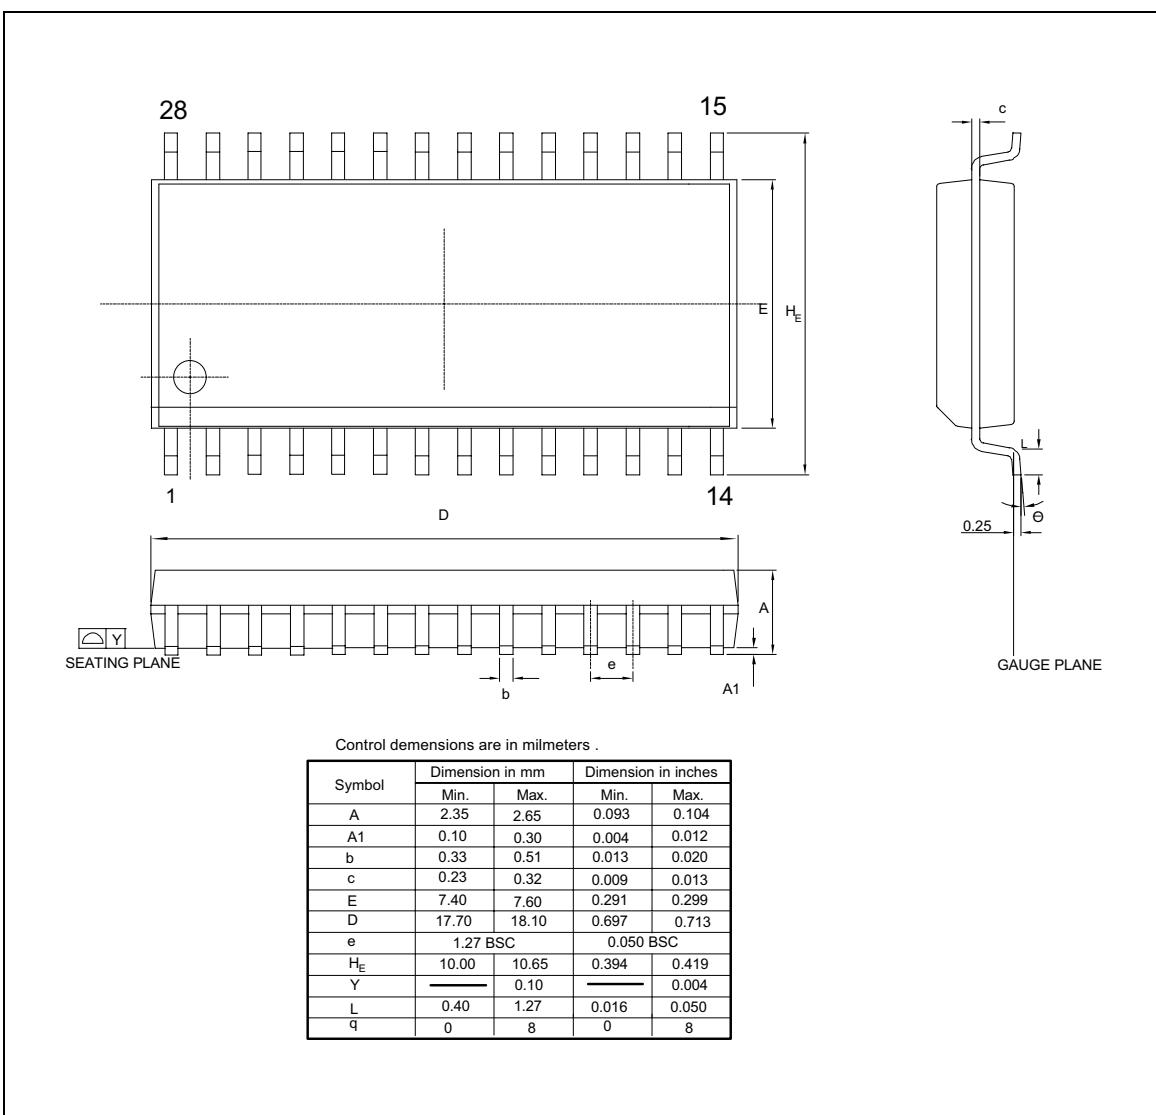

Preliminary W741C20X



NOTES:



Headquarters

No. 4, Creation Rd. III,
Science-Based Industrial Park,
Hsinchu, Taiwan
TEL: 886-3-5770066
FAX: 886-3-5792766
<http://www.winbond.com.tw/>
Voice & Fax-on-demand: 886-2-27197006

Taipei Office

11F, No. 115, Sec. 3, Min-Sheng East Rd.,
Taipei, Taiwan
TEL: 886-2-27190505
FAX: 886-2-27197502

Winbond Electronics (H.K.) Ltd.

Rm. 803, World Trade Square, Tower II,
123 Hoi Bun Rd., Kwun Tong,
Kowloon, Hong Kong
TEL: 852-27513100
FAX: 852-27552064

Winbond Electronics North America Corp.

Winbond Memory Lab.
Winbond Microelectronics Corp.
Winbond Systems Lab.
2727 N. First Street, San Jose,
CA 95134, U.S.A.
TEL: 408-9436666
FAX: 408-5441798

Note: All data and specifications are subject to change without notice.