

IEC plug


Compact size

General equipment protection

Up to 10 A maximum

B-version: for medical equipment

Applications: where small filter size is required

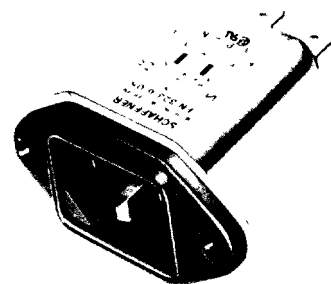

FN 323	Rated current A		Leakage current 220V/50Hz	Inductance mH	Connections		Weight g												
	40°C	25°C			Input	Output													
♥ FN 323-1/01	1	1.2	2 x 0.21 mA	2.8	IEC 320 C14	soldering lug	40	X	X	X	X	X	X	X	X	X	X	X	X
♥ FN 323-1/05	1	1.2	2 x 0.21 mA	2.8	IEC 320 C14	fast-on 6.3 x 0.8	40	X	X	X	X	X	X	X	X	X	X	X	X
♥ FN 323-3/01	3	3.6	2 x 0.21 mA	0.75	IEC 320 C14	soldering lug	40	X	X	X	X	X	X	X	X	X	X	X	X
♥ FN 323-3/05	3	3.6	2 x 0.21 mA	0.75	IEC 320 C14	fast-on 6.3 x 0.8	40	X	X	X	X	X	X	X	X	X	X	X	X
♥ FN 323-6/01	6	7.3	2 x 0.21 mA	0.3	IEC 320 C14	soldering lug	40	X	X	X	X	X	X	X	X	X	X	X	X
♥ FN 323-6/05	6	7.3	2 x 0.21 mA	0.3	IEC 320 C14	fast-on 6.3 x 0.8	40	X	X	X	X	X	X	X	X	X	X	X	X
♥ FN 323-10/01	10	12	2 x 0.21 mA	0.16	IEC 320 C14	soldering lug	40	X	X	X	X	X	X	X	X	X	X	X	X
♥ FN 323-10/05	10	12	2 x 0.21 mA	0.16	IEC 320 C14	fast-on 6.3 x 0.8	40	X	X	X	X	X	X	X	X	X	X	X	X

FN 323B

FN 323B-1/01	1	1.2	2 x 2 µA	2.8	IEC 320 C14	soldering lug	45	X	X	X	X	X	X	X	X	X	X	X	X
FN 323B-1/05	1	1.2	2 x 2 µA	2.8	IEC 320 C14	fast-on 6.3 x 0.8	45	X	X	X	X	X	X	X	X	X	X	X	X
♥ FN 323B-3/01	3	3.6	2 x 2 µA	0.75	IEC 320 C14	soldering lug	45	X	X	X	X	X	X	X	X	X	X	X	X
FN 323B-3/05	3	3.6	2 x 2 µA	0.75	IEC 320 C14	fast-on 6.3 x 0.8	45	X	X	X	X	X	X	X	X	X	X	X	X
FN 323B-6/01	6	7.3	2 x 2 µA	0.3	IEC 320 C14	soldering lug	45	X	X	X	X	X	X	X	X	X	X	X	X
FN 323B-6/05	6	7.3	2 x 2 µA	0.3	IEC 320 C14	fast-on 6.3 x 0.8	45	X	X	X	X	X	X	X	X	X	X	X	X
FN 323B-10/01	10	12	2 x 2 µA	0.16	IEC 320 C14	soldering lug	45	X	X	X	X	X	X	X	X	X	X	X	X
FN 323B-10/05	10	12	2 x 2 µA	0.16	IEC 320 C14	fast-on 6.3 x 0.8	45	X	X	X	X	X	X	X	X	X	X	X	X

♥ stock types

X = approved O = not approved



* with 6 A approved

Operating voltage 250 V max.

Operating frequency DC to 400 Hz max.


Temperature range -25°C to +85°C

Test voltage P/N → E 2 kV/50 Hz


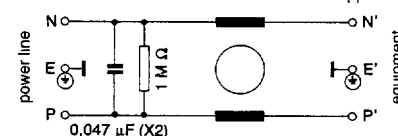
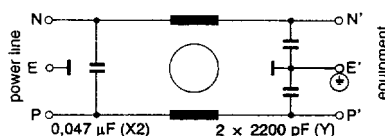


For further information, see general part.

Insertion loss

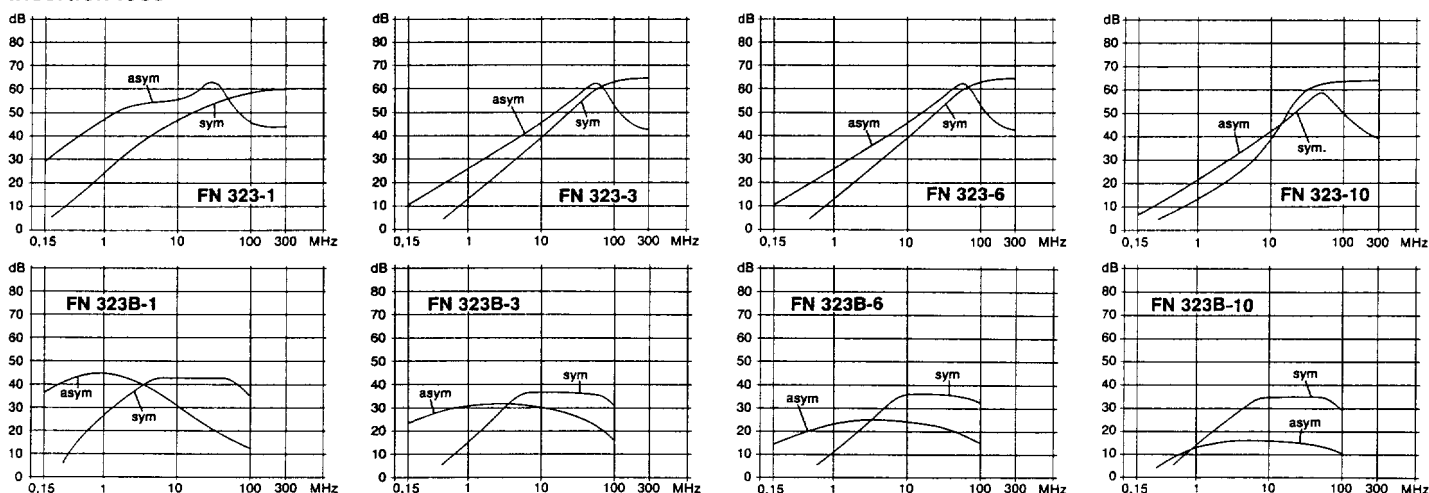

Dimensions

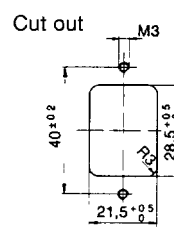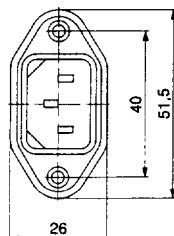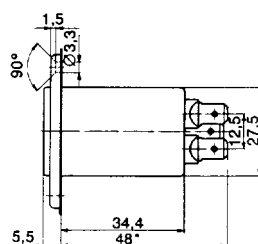

Alternative connections



Soldering lug /01

Option with discharge resistor (R)

* with soldering lug 46