

Pressure Gauges

Series **G15, G27, G36, GA36, G46, G33, G43**

General purpose Pressure Gauges

	Outside diameter	Model	Type	Indication precision ±% FS	Pressure range MPa	Connection thread	Material			Indication ⁽¹⁾ unit	Attachment ⁽²⁾
							Case	Clear cover	Stud		
	ø15	G15	Back side thread	5	0 to 1.0	R 1/8 M5 (Female thread)	Zinc die-cast (Black graphite coated)	Poly-carbonate	Zinc die-cast (Black graphite coated)	MPa	—
	ø26	G27	Back side thread		0 to 1.0	R 1/6				MPa	
With limit indicator 	ø37.5	G36	Back side thread	3	0 to 0.2 0 to 0.4 0 to 0.7 0 to 1.0 0 to 1.5	R 1/8	Aluminum die-cast (Black disulfide molybdenum coated)	Poly-carbonate	Aluminum die-cast (Black disulfide molybdenum coated)	MPa	—
With limit indicator 	ø42.5	G46	Back side thread	3	0 to 0.2 0 to 0.4 0 to 0.7 0 to 1.0 0 to 1.5	R 1/8 R 1/4	Aluminum die-cast (Black disulfide molybdenum coated)	Poly-carbonate	Aluminum die-cast (Black disulfide molybdenum coated)	MPa	Cover ring assembly
	ø30	G33	Back side thread	3	0 to 0.2 0 to 0.3 0 to 0.4 0 to 0.6	R 1/8	Stainless steel	Glass	Brass	MPa	—
	ø43	G43	Back side thread		0 to 0.7 0 to 1.0	R 1/8 R 1/4					

Note 1) Please consult with SMC for other scale indication units and connecting thread "NPT".

Note 2) Possible for use in panel mounting.

Differential Pressure Gauge

	ø40	GD40	Dual Ported	±3%	0 to 0.2	R 1/8 + 1/8	Zinc die-cast	Chloro-ethylene	Brass	MPa	—
---	-----	------	-------------	-----	----------	-------------------	---------------	-----------------	-------	-----	---

Also Available

(For more information on these products, see Best Pneumatics Vol. 14)

G46E Oil-free/External Parts Copper-free Pressure Gauge With limit indicator 	G49 Pressure Gauge for Clean Series (10-Series) 	G46-□-SRA,B Pressure Gauge for Clean Regulator With limit indicator 
--	--	--

Miniature Pressure Gauge

Series **G15, G27** O.D.: $\varnothing 15$ $\varnothing 26$



G15-10-01



G27-10-R1


Specifications

Model	G15	G27
Type	Back side thread	
Port size ⁽¹⁾	R 1/8: M5 (Female thread)	R 1/16
Fluid ⁽²⁾	Air	
Indication precision	±5% F.S. (Full span)	
Material	Case (Surface treatment)	Zinc die-cast (Black graphite coated)
	Clear cover	Polycarbonate
	Stud (Surface treatment)	Zinc die-cast (Black graphite coated)
	Bourdon tube	Brass
Weight (kg)	0.01	0.015
Applicable model	ARM1000/2000	AC1000, AR1000, AW1000

Model (Standard)


Model	Pressure range ^(Note) (MPa)	Indication unit	Connection thread
G15-10-01	0 to 1.0	MPa	R 1/8, M5 (Female thread)
G27-10-R1	0 to 1.0	MPa	R 1/16
G27-10-M5-X201	0 to 1.0	MPa	M5 (Female thread)

How to Order

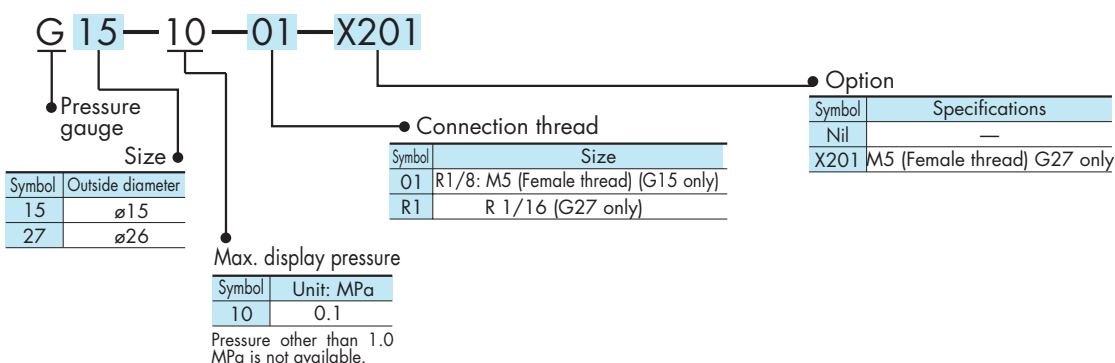


Dimensions

G15

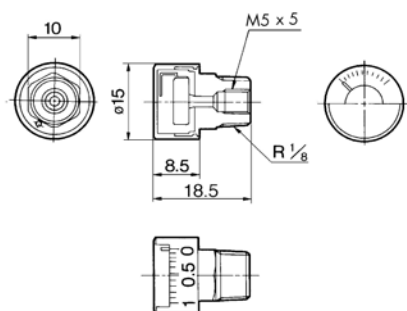

G27

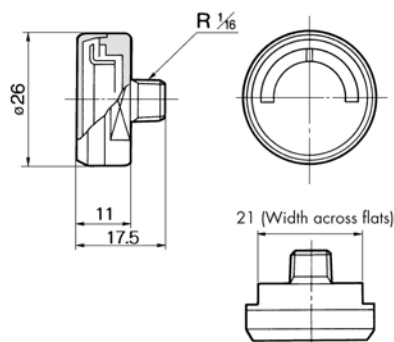

General Purpose Pressure Gauge $\frac{1}{8}$ entry (with Limit Indicator)

O.D.: $\phi 37$

Series **G36**

Specifications

Type	Centreback thread	
Port size ⁽¹⁾	R $\frac{1}{8}$	
Fluid ⁽²⁾	Air	
Indication precision	$\pm 3\%$ F.S. (Full span)	
Material	Case (Surface treatment)	Aluminum die-cast (Black disulfide molybdenum coat treated)
	Clear cover	Polycarbonate (Part no.: G36-00-00-3)
	Stud (Surface treatment)	Aluminum die-cast (Black disulfide molybdenum coat treated)
	Bourdon tube	Brass
Weight (kg)	0.04	




G36-10-01


Models (Standard)

Model	Pressure range ^{Note)}	Indication unit	Connection thread	Note
	MPa			
G36-2-01	0 to 0.2	MPa	R $\frac{1}{8}$	—
G36-4-01	0 to 0.4			
G36-7-01	0 to 0.7			
G36-10-01	0 to 1.0			
G36-15-01	0 to 1.5			

How to Order

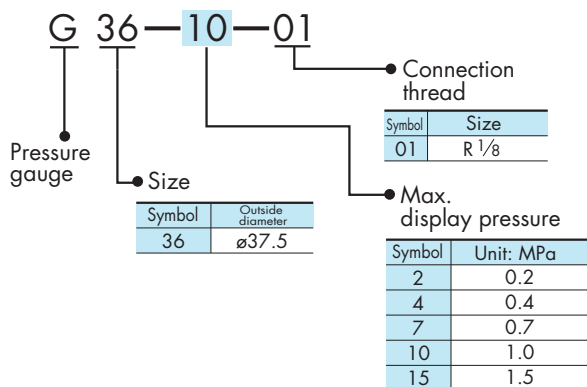

Dimensions

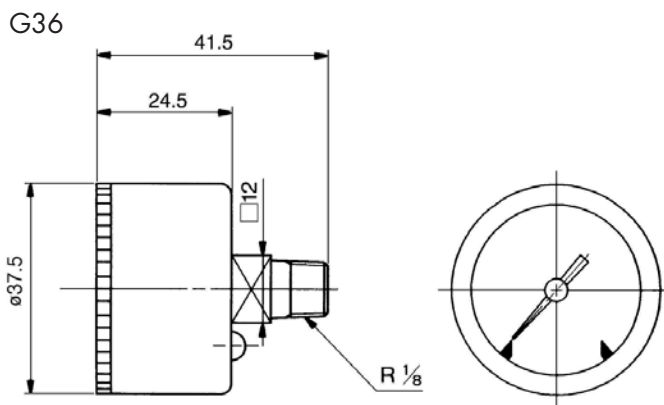

General Purpose Pressure Gauge $\frac{1}{8}$, $\frac{1}{4}$ entry (with Limit Indicator)

O.D.: $\varnothing 42$

Series **G46**

Specifications

Type	Back side thread	
Port size ⁽¹⁾	R $\frac{1}{8}$, R $\frac{1}{4}$	
Fluid ⁽²⁾	Air	
Indication precision	$\pm 3\%$ F.S. (Full span)	
Material	Case (Surface treatment)	Aluminum die-cast (Black disulfide molybdenum coated)
	Clear cover	Polycarbonate (Part no.: G46-00-00-3)
	Stud (Surface treatment)	Aluminum die-cast (Black disulfide molybdenum coated)
	Bourdon tube	Brass
Weight (kg)	0.05	
Panel Mounting kit	C	Part no.: 1305104-1A
With cover ring assembly	C1	Part no.: 1305104-3A




Models (Standard)

Model	Pressure range ^{Note)} MPa	Indication unit	Connection thread	Note
G46-2-01/02	0 to 0.2	MPa	R $\frac{1}{8}$, $\frac{1}{4}$	—
G46-4-01/02	0 to 0.4			
G46-7-01/02	0 to 0.7			
G46-10-01/02	0 to 1.0			
G46-15-01/02	0 to 1.5			

Note) Do not apply pressure more than the maximum display pressure. This will cause a malfunction.


How to Order

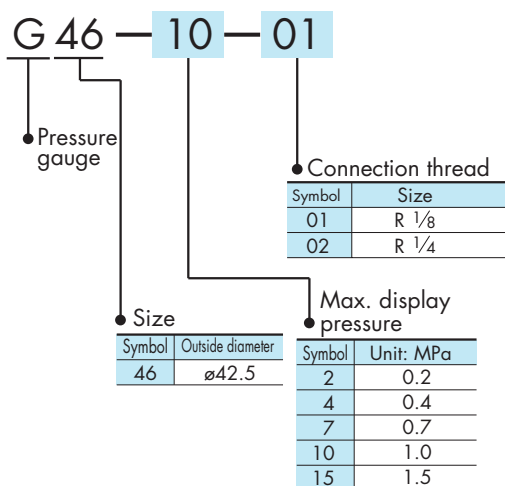

Dimensions

The dimensions in (): Connecting thread R $\frac{1}{4}$

G46

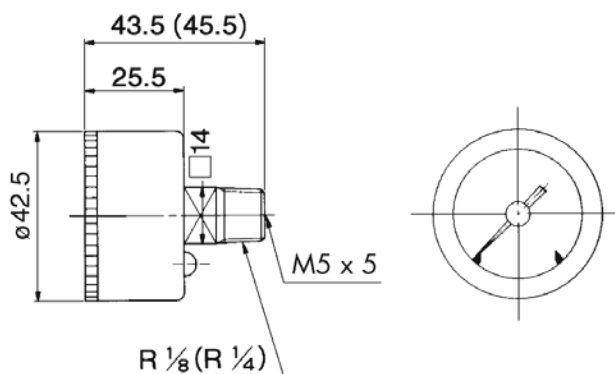

Stainless Cased Pressure Gauge $\frac{1}{8}$ entry

Series **G33**

O.D.: $\varnothing 30$

Specifications

Model	G33	
Type	Centreback thread	
Port size	R $\frac{1}{8}$	
Fluid	Air	
Indication precision	$\pm 3\%$ F.S. (Full span)	
Material	Case	Stainless steel
	Clear cover	Glass
	Stud	Brass
	Bourdon tube	Brass



Model (Standard)

Model	Pressure range ^{Note)} MPa	Indication unit	Connection thread	Note
G33-2-01	0 to 0.2	MPa	R $\frac{1}{8}$	—
G33-3-01	0 to 0.3			
G33-4-01	0 to 0.4			
G33-6-01	0 to 0.6			
G33-10-01	0 to 1.0			

NOTE: Can be used for general applications, but these are designed for use with instrumentation equipment, i.e. ITV and IR Regulators. Stainless case but brass welded parts so use for clean air only.

Note) Do not apply pressure more than the maximum display pressure. This will cause a malfunction.

How to Order

G 33-10-01

• Pressure gauge


• Max. display pressure

Symbol	Unit: MPa
2	0.2
3	0.3
4	0.4
6	0.6
7	0.7
10	1.0

• Model

Symbol	Outside diameter
33	$\varnothing 30$

Dimensions

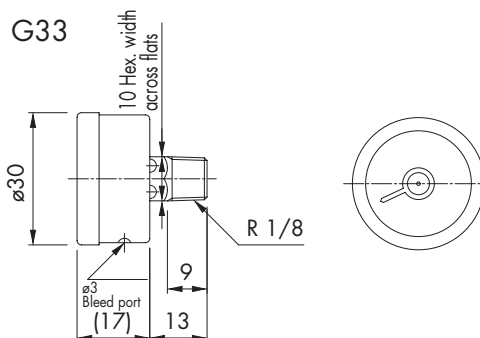

G33-□□-01

Stainless cased Pressure Gauge^{1/8, 1/4} entry

Series **G43**

Specifications

Type	Back side thread	
Port size ⁽¹⁾	R 1/8, R 1/4	
Fluid ⁽²⁾	Air	
Indication precision	±3% F.S. (Full span)	
Material	Case	Stainless steel
	Clear cover	Glass
	Stud	Brass
	Bourdon tube	Brass

O.D.: ø43



G43-10-01


NOTE: Can be used for general applications, but these are designed for use with instrumentation equipment, i.e. ITV and IR Regulators. Stainless case but brass welded parts so use for clean air only.

Model (Standard)


Model	Pressure range ^(Note) MPa	Indication unit	Connection thread
G43-2-01 to 02	0 to 0.2	MPa	R 1/8, R 1/4
G43-4-01 to 02	0 to 0.4		R 1/8
G43-6-01	0 to 0.6		R 1/8, R 1/4
G43-7-01 to 02	0 to 0.7		
G43-10-01 to 02	0 to 1.0		

Note) Do not apply pressure more than the maximum display pressure. This will cause a malfunction.

How to Order

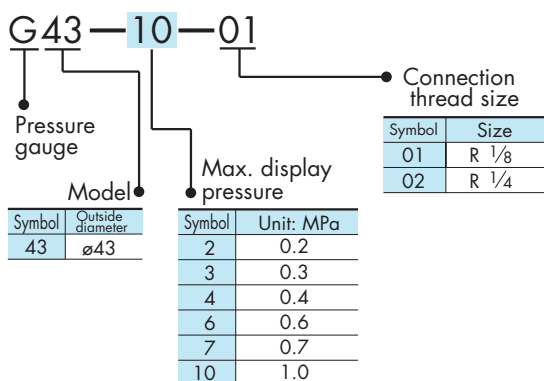

Dimensions

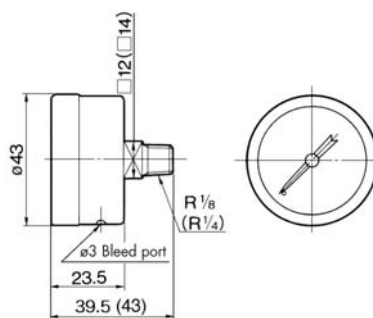

The dimensions in (): Connecting thread R 1/4

Differential Pressure Gauge

Series **GD40**

Features

- Measures a differential pressure accurately.
- Maximum differential 0.2 MPa (2 bar/29psi).
- Ideally suited to monitor filter element clogging.
- Compact design, simple to install.
- Tapped back for panel mounting.
- Two 1/8 ports for connection.



Specifications

Fluid	Compressed air
Max. operating pressure	1 MPa
Proof pressure	1.5 MPa
Ambient and fluid temperature	5 to 60°C
Port size	1/8
Scale range	0 to 0.2 MPa
Accuracy	±0.006 MPa
Dial size	40
Weight (g)	300

Symbol




How to Order

GD40 — 2 — 01


Port
01 1/8 male and female

Type
40mm Differential gauge

Piping Example

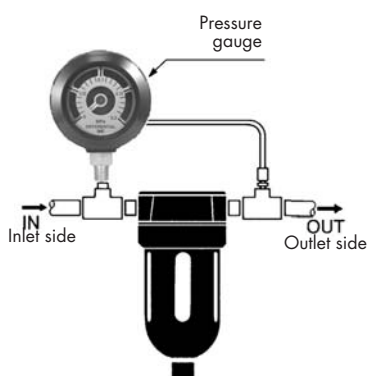

Dimensions

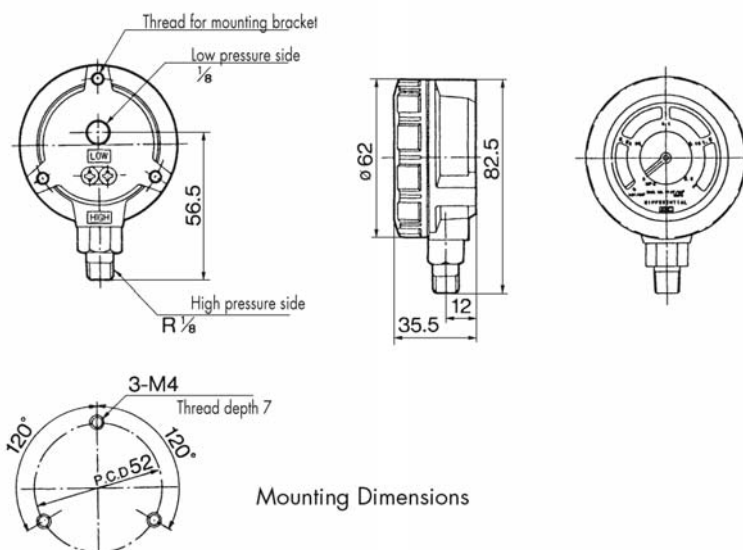

Mounting Dimensions