

Pressure Measurement

Transmitters for basic requirements

SITRANS P200
for gauge and absolute pressure

Overview



The SITRANS P200 pressure transmitter measures the gauge and absolute pressure of liquids, gases and vapors.

- Ceramic measuring cell
- Gauge and absolute measuring ranges 1 to 60 bar (15 to 1000 psi)
- For general applications

Benefits

- High measuring accuracy
- Rugged stainless steel enclosure
- High overload withstand capability
- For aggressive and non-aggressive media
- For measuring the pressure of liquids, gases and vapors
- Compact design

Application

The SITRANS P200 pressure transmitter for gauge and absolute pressure is used in the following industrial areas:

- Mechanical engineering
- Shipbuilding
- Power engineering
- Chemical industry
- Water supply

Design

Device structure without explosion protection

The pressure transmitter consists of a piezoresistive measuring cell with a diaphragm installed in a stainless steel enclosure. It can be used with a connector per EN 175301-803-A (IP65), a round plug M12 (IP67), a cable (IP67) or a cable quick screw connection (IP67) connected electrically. The output signal is between 4 and 20 mA or 0 and 10 V.


Device structure with explosion protection

The pressure transmitter consists of a piezoresistive measuring cell with a diaphragm installed in a stainless steel enclosure. It can be used with a connector per EN 175301-803-A (IP65) or a round plug M12 (IP67) connected electrically. The output signal is between 4 and 20 mA.

Function

The pressure transmitter measures the gauge and absolute pressure of liquids and gases as well as the level of liquids.

Mode of operation

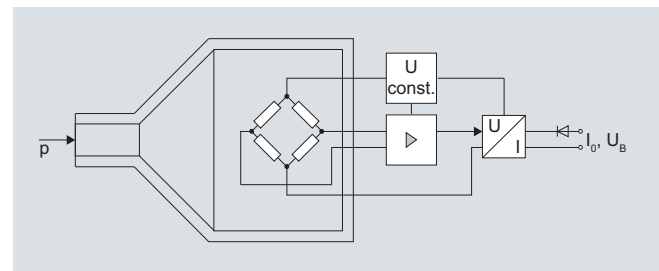

SITRANS P200 pressure transmitters (7MF1565-...), functional diagram

The ceramic measuring cell has a thin-film resistance bridge to which the operating pressure p is transmitted through a ceramic diaphragm.

The voltage output from the measuring cell is converted by an amplifier into an output current of 4 to 20 mA or an output voltage of 0 to 10 V DC.

The output current and voltage are linearly proportional to the input pressure.

Pressure Measurement

Transmitters for basic requirements

SITRANS P200 for gauge and absolute pressure

Technical specifications

Application		Design	
Gauge and absolute pressure measurement	Liquids, gases and vapors	Weight	Approx. 0.090 kg (0.198 lb)
Mode of operation		Process connections	See dimension drawings
Measuring principle	Piezo-resistive measuring cell (ceramic diaphragm)	Electrical connections	• Connector per EN 175301-803-A Form A with cable inlet M16x1.5 or ½-14 NPT or Pg 11 • M12 connector • 2 or 3-wire (0.5 mm²) cable (Ø ± 5.4 mm) • Cable quick screw connection
Measured variable	Gauge and absolute pressure		
Inputs			
Measuring range		Wetted parts materials	
• Gauge pressure - Metric - US measuring range • Absolute pressure - Metric - US measuring range	1 ... 60 bar (15 ... 870 psi) 15 ... 1000 psi 0.6 ... 16 bar a (10 ... 232 psia) 10 ... 300 psia	• Measuring cell • Process connection • Gasket	Al ₂ O ₃ - 96 % Stainless steel, mat. No. 1.4404 (SST 316 L) • FPM (Standard) • Neoprene • Perbunan • EPDM
Output		Non-wetted parts materials	
Current signal	4 ... 20 mA	• Enclosure	Stainless steel, mat. No. 1.4404 (SST 316 L)
• Load • Auxiliary power U_B	(U _B - 10 V) / 0.02 A DC 7 ... 33 V (10 ... 30 V for Ex)	• Rack • Cables	Plastic PVC
Voltage signal	0 ... 10 V DC		
• Load • Auxiliary power U_B • Power consumption	≥ 10 kΩ 12 ... 33 V DC < 7 mA at 10 kΩ		
Characteristic curve	Linear rising		
Measuring accuracy		Certificates and approvals	
Error in measurement at limit setting incl. hysteresis and reproducibility	• Typical: 0.25 % of full-scale value • Maximum: 0.5 % of full-scale value	Classification according to pressure equipment directive (PED 97/23/EC)	For gases of fluid group 1 and liquids of fluid group 1; complies with requirements of article 3, paragraph 3 (sound engineering practice)
Step response time T ₉₉	< 5 ms	Lloyds Register of Shipping (LR)	Applied
Long-term stability		Germanischer Lloyds Register of Shipping (GL)	Applied
• Lower range value and measuring span	0.25 % of full-scale value/year	American Bureau of Shipping (ABS)	Applied
Influence of ambient temperature		Bureau Veritas (BV)	Applied
• Lower range value and measuring span • Influence of power supply	0.25 %/10 K of full-scale value 0.005 %/V	Det Norske Veritas (DNV)	Applied
Conditions of use		Drinking water approval (ACS)	Applied
Process temperature with gasket made of:		GOST	Applied
• FPM (Standard) • Neoprene • Perbunan • EPDM	-15 ... +125 °C (+5 ... +257 °F) -35 ... +100 °C (-31 ... +212 °F) -20 ... +100 °C (-4 ... +212 °F) -40 ... +145 °C (-40 ... +293 °F), usable for drinking water	Explosion protection	
Ambient temperature	-25 ... +85 °C (-13 ... +185 °F)	Intrinsic safety "i" (only with current output)	Ex II 1/2 G Ex ia IIC T4 Ga/Gb Ex II 1/2 D Ex ia IIIC T125 °C Da/Db
Storage temperature	-50 ... +100 °C (-58 ... +212 °F)	EC type-examination certificate	SEV 10 ATEX 0146
Degree of protection (to EN 60529)	• IP 65 with connector per EN 175301-803-A • IP 67 with M12 connector • IP 67 with cable • IP 67 with cable quick screw connection	Connection to certified intrinsically-safe resistive circuits with maximum values:	U _i ≤ 30 V DC; I _i ≤ 100 mA; P _i ≤ 0.75 W
Electromagnetic compatibility	• acc. EN 61326-1/-2/-3 • acc. NAMUR NE21, only for ATEX versions and with a max. measuring deviation ≤ 1 %	Effective internal inductance and capacity for versions with plugs per EN 175301-803-A and M12	L _i = 0 nH; C _i = 0 nF

Selection and ordering data

Order No.

Order code

SITRANS P 200 pressure transmitters for pressure and absolute pressure for general applications

D)

7MF1565 -

Characteristic curve deviation typ. 0.25 %

Wetted parts materials: Ceramic and stainless steel + sealing material

Non-wetted parts materials: stainless steel

Measuring range		Overload limit		Burst pressure						
		Min.	Max.							
For gauge pressure										
0 ... 1 bar	(0 ... 14.5 psi)	-0.4 bar	(-5.8 psi)	2.5 bar	(36.26 psi)	> 2,5 bar	(> 36.3 psi)	▶	3 BA	
0 ... 1.6 bar	(0 ... 23.2 psi)	-0.4 bar	(-5.8 psi)	4 bar	(58.02 psi)	> 4 bar	(> 58.0 psi)	▶	3 BB	
0 ... 2.5 bar	(0 ... 36.3 psi)	-0.8 bar	(-11.6 psi)	6.25 bar	(90.65 psi)	> 6,25 bar	(> 90.7 psi)	▶	3 BD	
0 ... 4 bar	(0 ... 58.0 psi)	-0.8 bar	(-11.6 psi)	10 bar	(145 psi)	> 10 bar	(> 145 psi)	▶	3 BE	
0 ... 6 bar	(0 ... 87.0 psi)	-1 bar	(-14.5 psi)	15 bar	(217 psi)	> 15 bar	(> 217 psi)	▶	3 BG	
0 ... 10 bar	(0 ... 145 psi)	-1 bar	(-14.5 psi)	25 bar	(362 psi)	> 25 bar	(> 362 psi)	▶	3 CA	
0 ... 16 bar	(0 ... 232 psi)	-1 bar	(-14.5 psi)	40 bar	(580 psi)	> 40 bar	(> 580 psi)	▶	3 CB	
0 ... 25 bar	(0 ... 363 psi)	-1 bar	(-14.5 psi)	62.5 bar	(906 psi)	> 62,5 bar	(> 906 psi)	▶	3 CD	
0 ... 40 bar	(0 ... 580 psi)	-1 bar	(-14.5 psi)	100 bar	(1450 psi)	> 100 bar	(> 1450 psi)	▶	3 CE	
0 ... 60 bar	(0 ... 870 psi)	-1 bar	(-14.5 psi)	150 bar	(2175 psi)	> 150 bar	(> 2175 psi)	▶	3 CG	
Other version, add order code and plain text: Measuring range: ... up to... bar (psi)									9 AA	H1 Y
For absolute pressure										
0 ... 600 bar a	(0 ... 8.7 psia)	0 bar a	(0 psia)	3 bar a	(43.51 psia)	> 2,5 bar a	(> 36.3 psia)		5 AG	
0 ... 1 bar a	(0 ... 14.5 psia)	0 bar a	(0 psia)	2.5 bar a	(36.26 psia)	> 2,5 bar a	(> 36.3 psia)	▶	5 BA	
0 ... 1.6 bar a	(0 ... 23.2 psia)	0 bar a	(0 psia)	4 bar a	(58.02 psia)	> 4 bar a	(> 58.0 psia)	▶	5 BB	
0 ... 2.5 bar a	(0 ... 36.3 psia)	0 bar a	(0 psia)	6.25 bar a	(90.65 psia)	> 6,25 bar a	(> 90.7 psia)	▶	5 BD	
0 ... 4 bar a	(0 ... 58.0 psia)	0 bar a	(0 psia)	10 bar a	(145 psia)	> 10 bar a	(> 145 psia)	▶	5 BE	
0 ... 6 bar a	(0 ... 87.0 psia)	0 bar a	(0 psia)	15 bar a	(217 psia)	> 15 bar a	(> 217 psia)	▶	5 BG	
0 ... 10 bar a	(0 ... 145 psi)	0 bar a	(0 psia)	25 bar a	(362 psia)	> 25 bar a	(> 362 psia)	▶	5 CA	
0 ... 16 bar a	(0 ... 232 psi)	0 bar a	(0 psia)	40 bar a	(580 psia)	> 40 bar a	(> 580 psia)	▶	5 CB	
Other version, add order code and plain text: Measuring range: ... up to ... mbar a (psia)									9 AA	H1 Y
Measuring ranges for gauge pressure (only for US market)										
(0 ... 15 psi)	(-5.8 psi)		(35 psi)		(> 35 psi)				4 BB	
(3 ... 15 psi)	(-5.8 psi)		(35 psi)		(> 35 psi)				4 BC	
(0 ... 20 psi)	(-5.8 psi)		(50 psi)		(> 50 psi)				4 BD	
(0 ... 30 psi)	(-5.8 psi)		(80 psi)		(> 80 psi)				4 BE	
(0 ... 60 psi)	(-11.5 psi)		(140 psi)		(> 140 psi)				4 BF	
(0 ... 100 psi)	(-14.5 psi)		(200 psi)		(> 200 psi)				4 BG	
(0 ... 150 psi)	(-14.5 psi)		(350 psi)		(> 350 psi)				4 CA	
(0 ... 200 psi)	(-14.5 psi)		(550 psi)		(> 550 psi)				4 CB	
(0 ... 300 psi)	(-14.5 psi)		(800 psi)		(> 800 psi)				4 CD	
(0 ... 500 psi)	(-14.5 psi)		(1400 psi)		(> 1400 psi)				4 CE	
(0 ... 750 psi)	(-14.5 psi)		(2000 psi)		(> 2000 psi)				4 CF	
(0 ... 1000 psi)	(-14.5 psi)		(2000 psi)		(> 2000 psi)				4 CG	
Other version, add order code and plain text: Measuring range: ... up to ... psi									9 AA	H1 Y
Measuring ranges for absolute pressure (only for US market)										
(0 ... 10 psia)	(0 psia)		(35 psia)		(> 35 psia)				6 AG	
(0 ... 15 psia)	(0 psia)		(35 psia)		(> 35 psia)				6 BA	
(0 ... 20 psia)	(0 psia)		(50 psia)		(> 50 psia)				6 BB	
(0 ... 30 psia)	(0 psia)		(80 psia)		(> 80 psia)				6 BD	
(0 ... 60 psia)	(0 psia)		(140 psia)		(> 140 psia)				6 BE	
(0 ... 100 psia)	(0 psia)		(200 psia)		(> 200 psia)				6 BG	
(0 ... 150 psia)	(0 psia)		(350 psia)		(> 350 psia)				6 CA	
(0 ... 200 psia)	(0 psia)		(550 psia)		(> 550 psia)				6 CB	
(0 ... 300 psia)	(0 psia)		(800 psia)		(> 800 psia)				6 CC	
Other version, add order code and plain text: Measuring range: ... up to ... psia									9 AA	H1 Y

► Available ex stock

Pressure Measurement

Transmitters for basic requirements

SITRANS P200 for gauge and absolute pressure

2

Selection and ordering data

SITRANS P 200 pressure transmitters for pressure and absolute pressure for general applications

Accuracy typ. 0.25 %

Wetted parts materials: Ceramic and stainless steel + sealing material

Non-wetted parts materials: stainless steel

Output signal

4 ... 20 mA; two-wire system; power supply 7 ... 33 V DC (10 ... 30 V DC for ATEX versions)

0 ... 10 V; three-wire system; power supply 12 ... 33 V DC

Explosion protection (only 4 ... 20 mA)

None

With explosion protection EEx ia IIC T4

Electrical connection

Connector per DIN EN 175301-803-A, stuffing box thread M16 (with coupling)

Round connector M12 per DIN EN 60139-9 (not for gauge pressure ranges ≤ 16 bar)

Connection via fixed mounted cable, 2m (not for type of protection "Intrinsic safety i")

Cable quick screw connection PG9 (not for type of protection "Intrinsic safety i")

Connector per DIN EN 175301-803-A, stuffing box thread 1/2"-14 NPT (with coupling)

Connector per DIN EN 175301-803-A, stuffing box thread PG11 (with coupling)

Special version

Process connection

G1/2" male per EN 837-1 (1/2" BSP male) (standard for metric pressure ranges mbar, bar)

G1/2" male thread and G1/8" female thread

G1/4" male per EN 837-1 (1/4" BSP male)

7/16"-20 UNF male

1/4"-18 NPT male (standard for pressure ranges inH₂O and psi)

1/4"-18 NPT female

1/2"-14 NPT male

1/2"-14 NPT female

7/16"-20 UNF female

M20x1.5 male

Special version

Sealing material between sensor and enclosure

Viton (FPM, standard)

Neoprene (CR)

Perbunan (NBR)

EPDM

Special version

Version

Standard version

Further designs

Supplement the order no. with "-Z" and add order code.

Manufacturer's test certificate M per DIN 55340, Part 18 and ISO 8402 (calibration certificate) supplied

Oxygen application, oil and grease-free cleaning
(only in conjunction with the sealing material Viton between sensor and enclosure)

► Available ex stock

D) Subject to export regulations AL: N, ECCN: EAR99H.

Order No.

Order code

D) 7MF1565 - - - - -

0

10

0

1

1

2

0

3

0

4

5

6

9

N1Y

A

B

C

D

E

F

G

H

J

P

Z

P1Y

A

B

C

D

Z

Q1Y

1

C11


E10

Pressure Measurement


Transmitters for basic requirements

SITRANS P200
for gauge and absolute pressure

Dimensional drawings

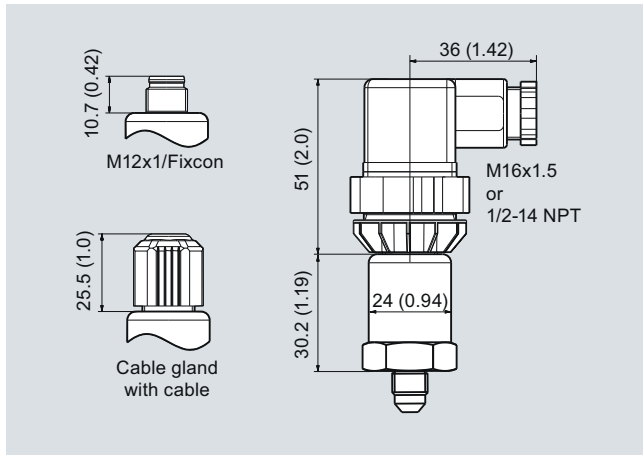

SITRANS P200, electrical connections, dimensions in mm (inch)

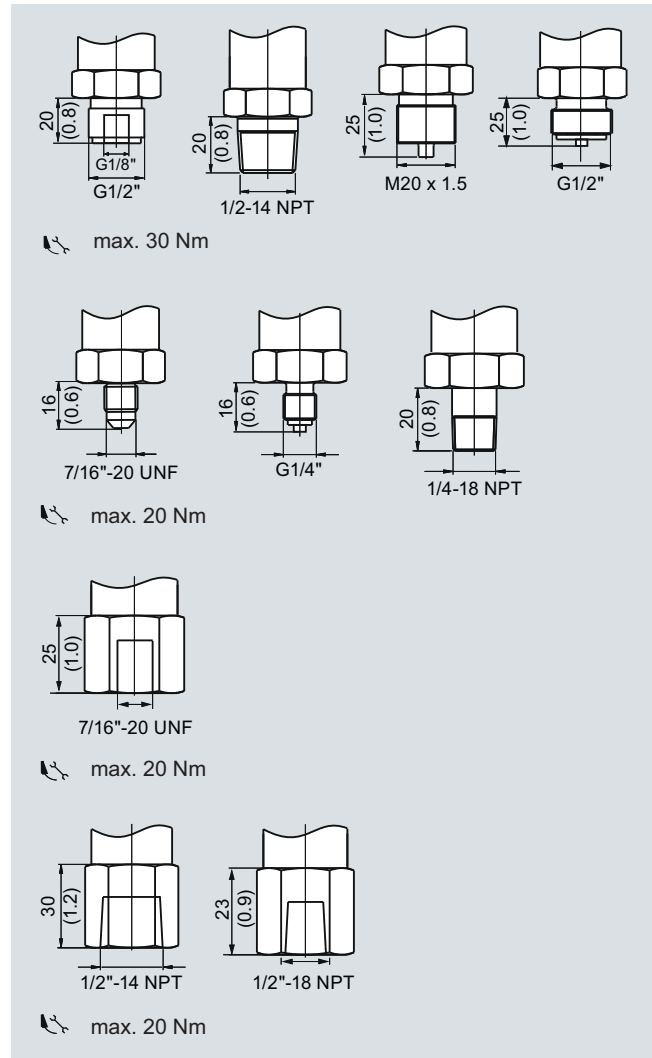


SITRANS P200, process connections, dimensions in mm (inch)

Pressure Measurement


Transmitters for basic requirements

SITRANS P200
for gauge and absolute pressure


Schematics

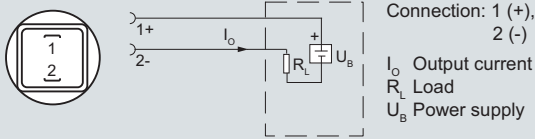


Connection with current output and connector per EN 175301

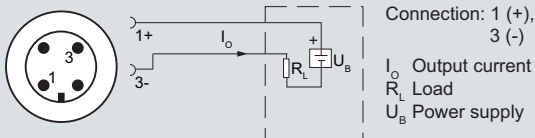


Connection with current output and connector M12x1

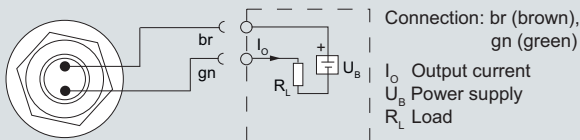


Connection with current output and cable

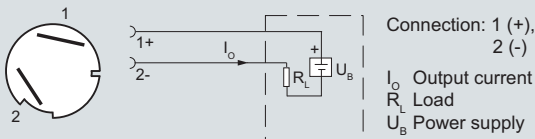


Connection with current output and cable quick screw connection

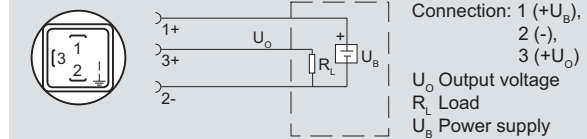


Connection with voltage output and connector per EN 175301

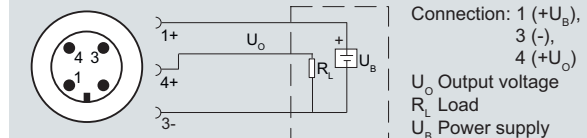

Connection with voltage output and connector M12x1

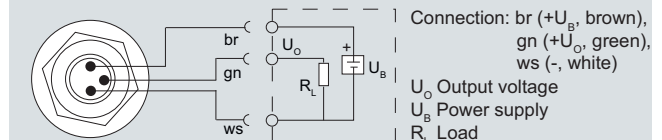


Connection with voltage output and cable

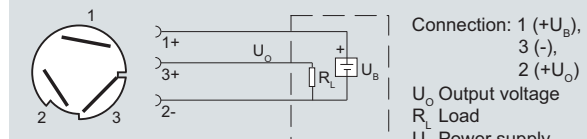


Connection with voltage output and cable quick screw connection

Version with explosion protection: 4 ... 20 mA

The grounding connection is conductively bonded to the transmitter enclosure

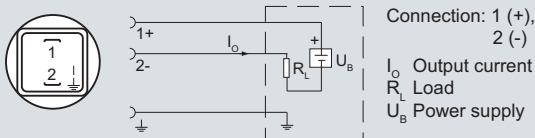

Connection with current output and connector per EN 175301 (Ex)

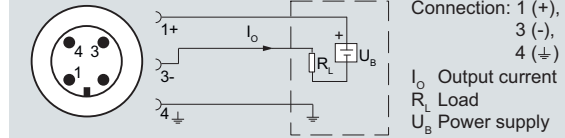

Connection with current output and connector M12x1 (Ex)

Pressure Measurement

Transmitters for basic requirements

SITRANS P210
for gauge pressure

Overview



The pressure transmitter SITRANS P210 measures the gauge pressure of liquids, gases and vapors.

- Stainless steel measuring cell
- Measuring ranges 100 to 600 mbar (1.45 to 8.7 psi) relative
- For low-pressure applications

Benefits

- High measuring accuracy
- Rugged stainless steel enclosure
- High overload withstand capability
- For aggressive and non-aggressive media
- For measuring the pressure of liquids, gases and vapors
- Compact design

Application

The pressure transmitter SITRANS P210 for gauge pressure is used in the following industrial areas:

- Mechanical engineering
- Shipbuilding
- Power engineering
- Chemical industry
- Water supply

Design

Device structure without explosion protection

The pressure transmitter consists of a piezoresistive measuring cell with a diaphragm installed in a stainless steel enclosure. It can be used with a connector per EN 175301-803-A (IP65), a round plug M12 (IP67), a cable (IP67) or a cable quick screw connection (IP67) connected electrically. The output signal is between 4 and 20 mA or 0 and 10 V.


Device structure with explosion protection

The pressure transmitter consists of a piezoresistive measuring cell with a diaphragm installed in a stainless steel enclosure. It can be used with a connector per EN 175301-803-A (IP65) or a round plug M12 (IP67) connected electrically. The output signal is between 4 and 20 mA.

Function

The pressure transmitter measures the gauge pressure of liquids and gases as well as the level of liquids.

Mode of operation

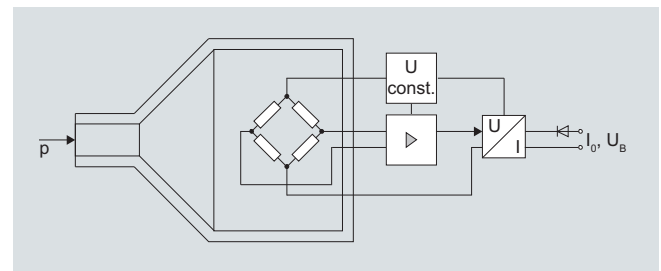

SITRANS P210 pressure transmitters (7MF1566-...), functional diagram

The stainless steel measuring cell has a thin-film resistance bridge to which the operating pressure p is transmitted through a stainless steel diaphragm.

The voltage output from the measuring cell is converted by an amplifier into an output current of 4 to 20 mA or an output voltage of 0 to 10 V DC.

The output current and voltage are linearly proportional to the input pressure.

Pressure Measurement

Transmitters for basic requirements

SITRANS P210 for gauge pressure

Technical specifications

Application		Design	
Gauge measurement	Liquids, gases and vapors	Weight	Approx. 0.090 kg (0.198 lb)
Mode of operation		Process connections	See dimension drawings
Measuring principle	Piezoresistive measuring cell (stainless steel diaphragm)	Electrical connections	- Connector per EN 175301-803-A Form A with cable inlet M16x1.5 or ½-14 NPT or Pg 11 - M12 connector 2 or 3-wire (0.5 mm²) cable (Ø ± 5.4 mm) - Cable quick screw connection
Measured variable	Gauge pressure		
Inputs			
Measuring range			
• Gauge pressure	100 ... 600 mbar (1.5 ... 8.7 psi)		
Output			
Current signal	4 ... 20 mA	Wetted parts materials	
• Load	(U _B - 10 V) / 0.02 A	• Measuring cell	Stainless steel, mat.-No. 1.4435
• Auxiliary power U _B	DC 7 ... 33 V (10 ... 30 V for Ex)	• Process connection	Stainless steel, mat. No. 1.4404 (SST 316 L)
Voltage signal	0 ... 10 V DC	• Gasket	- FPM (Standard) - Neoprene - Perbunan - EPDM
• Load	≥ 10 kΩ		
• Auxiliary power U _B	12 ... 33 V DC	Non-wetted parts materials	
• Power consumption	< 7 mA at 10 kΩ	• Enclosure	Stainless steel, mat. No. 1.4404 (SST 316 L)
Characteristic curve	Linear rising	• Rack	Plastic
Measuring accuracy		• cables	PVC
Error in measurement at limit setting incl. hysteresis and reproducibility	- Typical: 0.25 % of full-scale value - Maximum: 0.5 % of full-scale value	Certificates and approvals	
Step response time T ₉₉	< 5 ms	Classification according to pressure equipment directive (PED 97/23/EC)	For gases of fluid group 1 and liquids of fluid group 1; meets requirements as per article 3, paragraph 3 (good engineering practice)
Long-term stability		Lloyds Register of Shipping (LR)	Applied
• Lower range value and measuring span	0.25 % of full-scale value/year	Germanischer Lloyds Register of Shipping (GL)	Applied
Influence of ambient temperature		American Bureau of Shipping (ABS)	Applied
• Lower range value and measuring span	0.25 %/10 K of full-scale value 0.5 %/10K of full-scale value for a measuring range 100 ... 400 mbar	Bureau Veritas (BV)	Applied
• Influence of power supply	0.005 %/V	Det Norske Veritas (DNV)	Applied
Conditions of use		Drinking water approval (ACS)	Applied
Process temperature with gasket made of:		GOST	Applied
• FPM (Standard)	-15 ... +125 °C (+5 ... +257 °F)	Explosion protection	
• Neoprene	-35 ... +100 °C (-31 ... +212 °F)	Intrinsic safety "i" (only with current output)	Ex II 1/2 G Ex ia IIC T4 Ga/Gb Ex II 1/2 D Ex ia IIIC T125 °C Da/Db
• Perbunan	-20 ... +100 °C (-4 ... +212 °F)	EC type-examination certificate	SEV 10 ATEX 0146
• EPDM	-40 ... +145 °C (-40 ... +293 °F), usable for drinking water	Connection to certified intrinsically-safe resistive circuits with maximum values:	U _i ≤ 30 V DC; I _i ≤ 100 mA; P _i ≤ 0.75 W
Ambient temperature	-25 ... +85 °C (-13 ... +185 °F)	Effective internal inductance and capacity for versions with plugs per EN 175301-803-A and M12	L _i = 0 nH; C _i = 0 nF
Storage temperature	-50 ... +100 °C (-58 ... +212 °F)		
Degree of protection (to EN 60529)	- IP 65 with connector per EN 175301-803-A - IP 67 with M12 connector - IP 67 with cable - IP 67 with cable quick screw connection		
Electromagnetic compatibility	- acc. EN 61326-1/-2/-3 - acc. NAMUR NE21, only for ATEX versions and with a max. measuring deviation ≤ 1 %		
Mounting position	upright		

Pressure Measurement

Transmitters for basic requirements

SITRANS P210
for gauge pressure

2


Selection and ordering data										Order No.		Order code								
SITRANS P 210 pressure transmitters for gauge pressure for low pressure applications										D)	7MF1566-									
Accuracy typ. 0.25 %																				
Wetted parts materials: Stainless steel + sealing material																				
Non-wetted parts materials: stainless steel																				
Measuring range			Overload limit				Burst pressure													
			min.				max.													
For gauge pressure																				
0 ... 100 mbar (0.58 psi)		-40 mbar (-0.58 psi)		250 mbar (3.63 psi)		0.5 bar (7.25 psi)		▶												
0 ... 160 mbar (2.32 psi)		-40 mbar (-0.58 psi)		400 mbar (5.8 psi)		0.5 bar (7.25 psi)		▶												
0 ... 250 mbar (3.63 psi)		-80 mbar (-1.16 psi)		625 mbar (9.06 psi)		1 bar (14.5 psi)		▶												
0 ... 400 mbar (5.8 psi)		-80 mbar (-1.16 psi)		1000 mbar (14.5 psi)		1 bar (14.5 psi)		▶												
0 ... 600 mbar (8.7 psi)		-100 mbar (-1.45 psi)		1500 mbar (21.76 psi)		2.5 bar (36.26 psi)		▶												
Other version, add order code and plain text: Measuring range: ... up to ... mbar (psi)																				
Output signal																				
4 ... 20 mA; two-wire system; power supply 7 ... 33 V DC (10 ... 30 V DC for ATEX versions)										▶										
0 ... 10 V; three-wire system; power supply 12 ... 33 V DC										▶										
Explosion protection (only 4 ... 20 mA)																				
None										▶										
With explosion protection EEx ia IIC T4										▶										
Electrical connection																				
Connector per DIN EN 175301-803-A, stuffing box thread M16 (with coupling)										▶										
Round connector M12 per DIN EN 60139-9 (not for gauge pressure ranges ≤ 16 bar)																				
Connection via fixed mounted cable, 2 m (not for type of protection "Intrinsic safety i")																				
Cable quick screw connection PG9 (not for type of protection "Intrinsic safety i")																				
Connector per DIN EN 175301-803-A, stuffing box thread 1/2"-14 NPT (with coupling)																				
Connector per DIN EN 175301-803-A, stuffing box thread PG11 (with coupling)																				
Special version																				
Process connection																				
G½" male per EN 837-1 (½" BSP male) (standard for metric pressure ranges mbar, bar)										▶										
G½" male thread and G1/8" female thread																				
G¼" male per EN 837-1 (¼" BSP male)																				
7/16"-20 UNF male																				
¼"-18 NPT male (standard for pressure ranges inH₂O and psi)																				
¼"-18 NPT female																				
½"-14 NPT male																				
½"-14 NPT female																				
7/16"-20 UNF female																				
M20x1.5 male																				
Special version																				
Sealing material between sensor and enclosure																				
Viton (FPM, standard)										▶										
Neoprene (CR)																				
Perbunan (NBR)																				
EPDM																				
Special version																				
Version																				
Standard version										▶										
Further designs																				
Supplement the order no. with "-Z" and add order code.																				
Manufacturer's test certificate M per DIN 55340, Part 18 and ISO 8402 (calibration certificate) supplied																				
▶ Available ex stock																				
D) Subject to export regulations AL: N, ECCN: EAR99H.																				

Pressure Measurement


Transmitters for basic requirements

SITRANS P210
for gauge pressure

Dimensional drawings

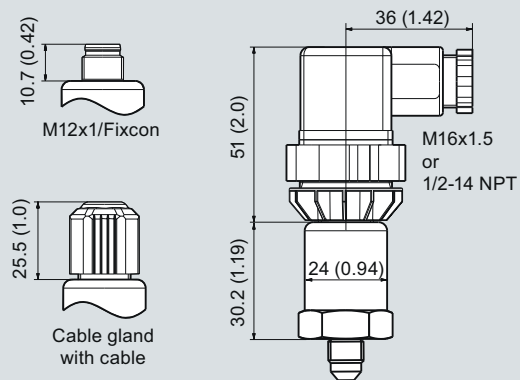

SITRANS P210, electrical connections, dimensions in mm (inch)

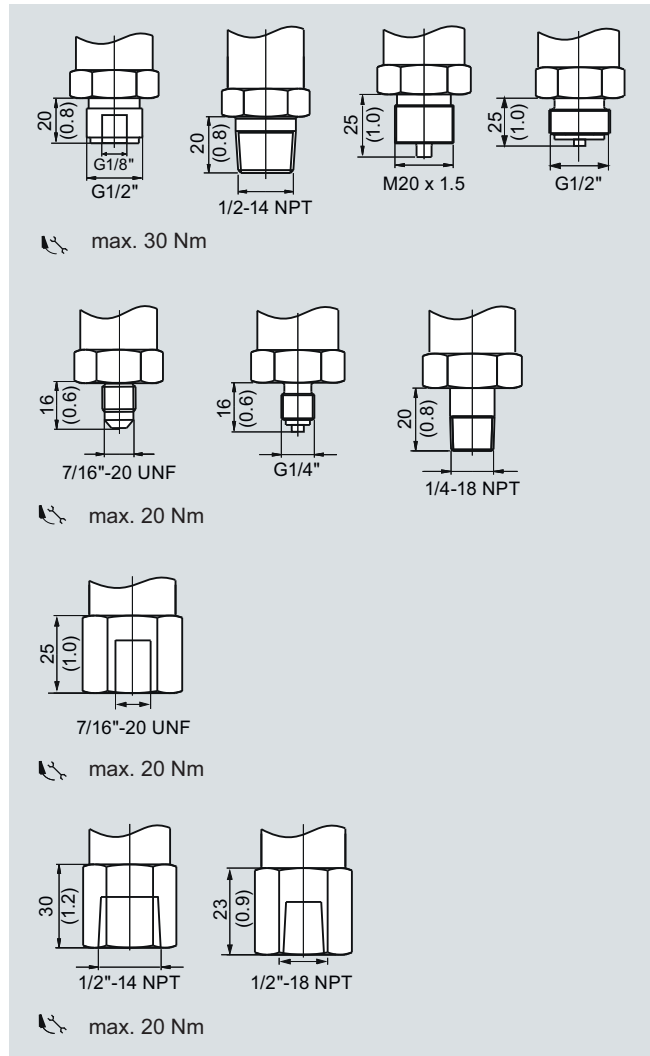


SITRANS P210, process connections, dimensions in mm (inch)

Pressure Measurement


Transmitters for basic requirements

SITRANS P210
for gauge pressure


Schematics

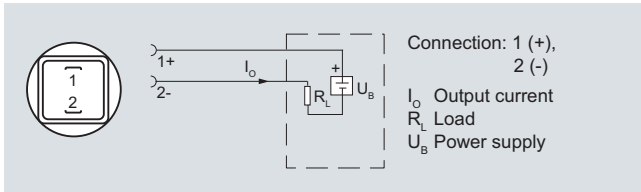


Connection with current output and connector per EN 175301

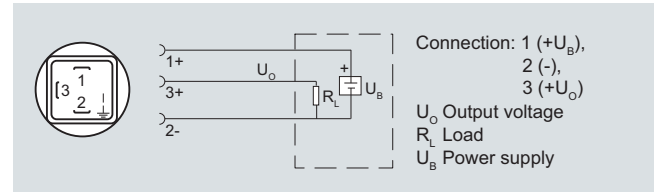


Connection with voltage output and connector per EN 175301

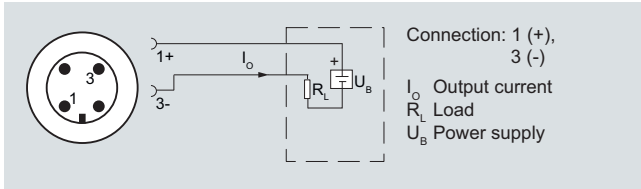


Connection with current output and connector M12x1

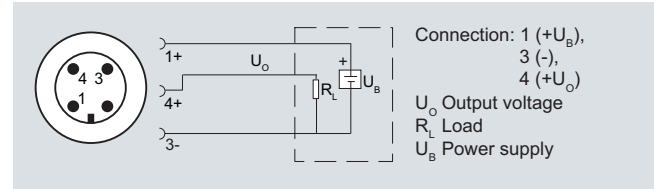


Connection with voltage output and connector M12x1

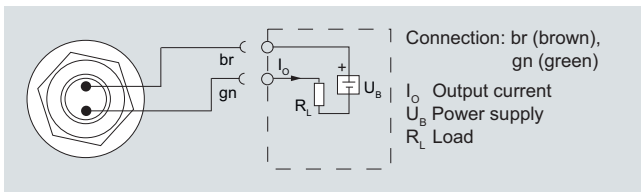


Connection with current output and cable

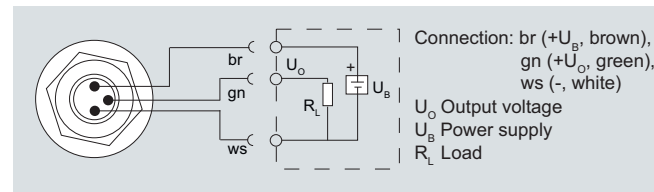

Connection with voltage output and cable

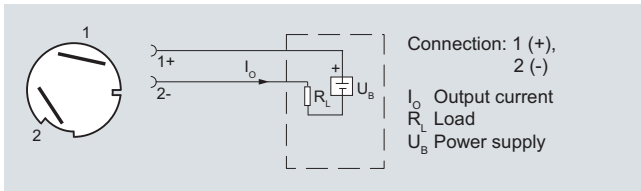


Connection with current output and cable quick screw connection

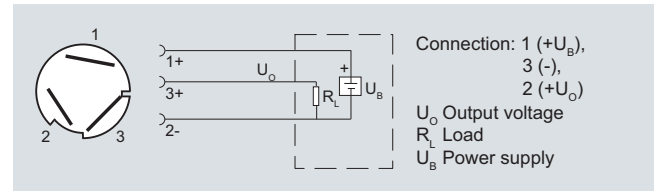


Connection with voltage output and cable quick screw connection

Version with explosion protection: 4 ... 20 mA

The grounding connection is conductively bonded to the transmitter enclosure

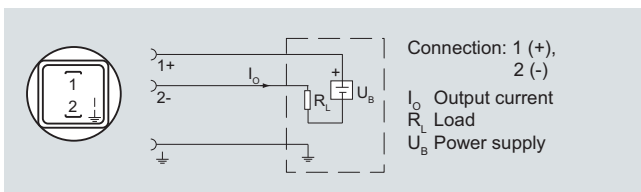

Connection with current output and connector per EN 175301 (Ex)

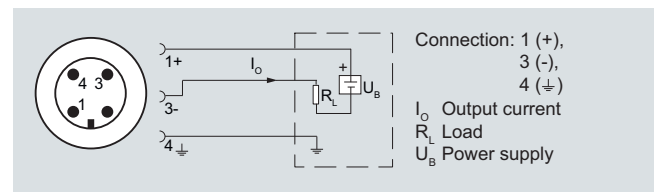

Connection with current output and connector M12x1 (Ex)

Pressure Measurement

Transmitters for basic requirements

SITRANS P220 for gauge pressure

Overview



The pressure transmitter SITRANS P220 measures the gauge pressure of liquids, gases and vapors.

- Stainless steel measuring cell, fully welded
- Measuring ranges 2.5 to 600 bar (36.3 to 8702 psi) relative
- For high-pressure applications and refrigeration technology division

Benefits

- High measuring accuracy
- Rugged stainless steel enclosure
- High overload withstand capability
- For aggressive and non-aggressive media
- For measuring the pressure of liquids, gases and vapors
- Compact design
- Gasket-less

Application

The pressure transmitter SITRANS P220 for gauge pressure is used in the following industrial areas:

- Mechanical engineering
- Shipbuilding
- Power engineering
- Chemical industry
- Water supply

Design

Device structure without explosion protection

The pressure transmitter consists of a piezoresistive measuring cell with a diaphragm installed in a stainless steel enclosure. It can be used with a connector per EN 175301-803-A (IP65), a round plug M12 (IP67), a cable (IP67) or a cable quick screw connection (IP67) connected electrically. The output signal is between 4 and 20 mA or 0 and 10 V.


Device structure with explosion protection

The pressure transmitter consists of a piezoresistive measuring cell with a diaphragm installed in a stainless steel enclosure. It can be used with a connector per EN 175301-803-A (IP65) or a round plug M12 (IP67) connected electrically. The output signal is between 4 and 20 mA.

Function

The pressure transmitter measures the gauge pressure of liquids and gases as well as the level of liquids.

Mode of operation

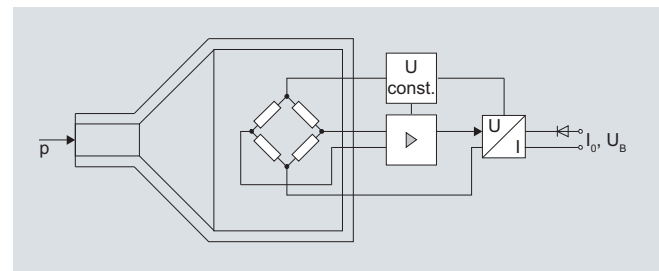

SITRANS P220 pressure transmitters (7MF1567-...), functional diagram

The stainless steel measuring cell has a thick-film resistance bridge to which the operating pressure p is transmitted through a stainless steel diaphragm.

The voltage output from the measuring cell is converted by an amplifier into an output current of 4 to 20 mA or an output voltage of 0 to 10 V DC.

The output current and voltage are linearly proportional to the input pressure.

Pressure Measurement

Transmitters for basic requirements

SITRANS P220
for gauge pressure

2

Technical specifications

Application	
Gauge pressure measurement	Liquids, gases and vapors
Mode of operation	
Measuring principle	Piezoresistive measuring cell (stainless steel diaphragm)
Measured variable	Gauge pressure
Inputs	
Measuring range	
• Gauge pressure	
- Metric	2.5 ... 600 bar (36 ... 8700 psi)
- US measuring range	30... 8700 psi
Output	
Current signal	4 ... 20 mA
• Load	($U_B - 10 \text{ V}$) / 0.02 A
• Auxiliary power U_B	DC 7 ... 33 V (10 ... 30 V for Ex)
Voltage signal	0 ... 10 V DC
• Load	$\geq 10 \text{ k}\Omega$
• Auxiliary power U_B	12 ... 33 V DC
• Power consumption	< 7 mA at 10 k Ω
Characteristic curve	Linear rising
Measuring accuracy	
Error in measurement at limit setting incl. hysteresis and reproducibility	• Typical: 0.25 % of full-scale value • Maximum: 0.5 % of full-scale value
Step response time T_{99}	< 5 ms
Long-term stability	
• Lower range value and measuring span	0.25 % of full-scale value/year
Influence of ambient temperature	
• Lower range value and measuring span	0.25 %/10 K of full-scale value
• Influence of power supply	0.005 %/V
Conditions of use	
• Process temperature	-30 ... +120 °C (-22 ... +248 °F)
• Ambient temperature	-25 ... +85 °C (-13 ... +185 °F)
• Storage temperature	-50 ... +100 °C (-58 ... +212 °F)
• Degree of protection (to EN 60529)	• IP 65 with connector per EN 175301-803-A • IP 67 with M12 connector • IP 67 with cable • IP 67 with cable quick screw connection
Electromagnetic compatibility	• acc. EN 61326-1/-2/-3 • acc. NAMUR NE21, only for ATEX versions and with a max. measuring deviation $\leq 1 \%$

Design

Weight	Approx. 0.090 kg (0.198 lb)
Process connections	See dimension drawings
Electrical connections	• Connector per EN 175301-803-A Form A with cable inlet M16x1.5 or ½-14 NPT or Pg 11 • M12 connector • 2 or 3-wire (0.5 mm²) cable ($\varnothing \pm 5.4 \text{ mm}$) • Cable quick screw connection
Wetted parts materials	
• Measuring cell	Stainless steel, mat.-No. 1.4016
• Process connection	Stainless steel, mat. No. 1.4404 (SST 316 L)
Non-wetted parts materials	
• Enclosure	Stainless steel, mat. No. 1.4404 (SST 316 L)
• Rack	Plastic
• cables	PVC
Certificates and approvals	
Classification according to pressure equipment directive (PED 97/23/EC)	For gases of fluid group 1 and liquids of fluid group 1; complies with requirements of article 3, paragraph 3 (sound engineering practice)
Lloyds Register of Shipping (LR)	Applied
Germanischer Lloyds Register of Shipping (GL)	Applied
American Bureau of Shipping (ABS)	Applied
Bureau Veritas (BV)	Applied
Det Norske Veritas (DNV)	Applied
Drinking water approval (ACS)	Applied
GOST	Applied
Explosion protection	
Intrinsic safety "i" (only with current output)	Ex II 1/2 G Ex ia IIC T4 Ga/Gb Ex II 1/2 D Ex ia IIIC T125 °C Da/Db
EC type-examination certificate	SEV 10 ATEX 0146
Connection to certified intrinsically-safe resistive circuits with maximum values:	$U_i \leq 30 \text{ V DC}$; $I_i \leq 100 \text{ mA}$; $P_i \leq 0.75 \text{ W}$
Effective internal inductance and capacity for versions with plugs per EN 175301-803-A and M12	$L_i = 0 \text{ nH}$; $C_i = 0 \text{ nF}$

Pressure Measurement

Transmitters for basic requirements

SITRANS P220 for gauge pressure

Selection and ordering data

Order No.

Order code

SITRANS P 220 pressure transmitters for gauge pressure, high-pressure and refrigeration applications, fully-welded version

D) 7MF1567- - A

Accuracy typ. 0.25 %

Wetted parts materials: stainless steel

Non-wetted parts materials: stainless steel

Measuring range

Overload limit

Mini-
mum

Max.

Burst pressure

For gauge pressure

0 ... 2.5 bar	(0 ... 36.3 psi)	-0.8 bar (-11.6 psi)	6.25 bar (90.7 psi)	25 bar (363 psi)	▶	3BD
0 ... 4 bar	(0 ... 58 psi)	-0.8 bar (-11.6 psi)	10 bar (145 psi)	40 bar (870 psi)	▶	3BE
0 ... 6 bar	(0 ... 87 psi)	-1 bar (-14.5 psi)	15 bar (217 psi)	60 bar (870 psi)	▶	3BG
0 ... 10 bar	(0 ... 145 psi)	-1 bar (-14.5 psi)	25 bar (362 psi)	60 bar (870 psi)	▶	3CA
0 ... 16 bar	(0 ... 232 psi)	-1 bar (-14.5 psi)	40 bar (580 psi)	96 bar (1392 psi)	▶	3CB
0 ... 25 bar	(0 ... 363 psi)	-1 bar (-14.5 psi)	62.5 bar (906 psi)	150 bar (2176 psi)	▶	3CD
0 ... 40 bar	(0 ... 580 psi)	-1 bar (-14.5 psi)	100 bar (1450 psi)	240 bar (3481 psi)	▶	3CE
0 ... 60 bar	(0 ... 870 psi)	-1 bar (-14.5 psi)	150 bar (2175 psi)	360 bar (5221 psi)	▶	3CG
0 ... 100 bar	(0 ... 1450 psi)	-1 bar (-14.5 psi)	250 bar (3625 psi)	600 bar (8702 psi)		3DA
0 ... 160 bar	(0 ... 2320 psi)	-1 bar (-14.5 psi)	400 bar (5801 psi)	960 bar (13924 psi)		3DB
0 ... 250 bar	(0 ... 3625 psi)	-1 bar (-14.5 psi)	625 bar (9064 psi)	1500 bar (21756 psi)		3DD
0 ... 400 bar	(0 ... 5801 psi)	-1 bar (-14.5 psi)	1000 bar (14503 psi)	2400 bar (34809 psi)		3DE
0 ... 600 bar	(0 ... 8702 psi)	-1 bar (-14.5 psi)	1500 bar (21755 psi)	2500 bar (36260 psi)		3DG

Other version, add order code and plain text:

Measuring range: ... up to ... bar (psi)

Measuring ranges for gauge pressure (only for US market)

(0 ... 30 psi)	(-5.8 psi)	(75 psi)	(360 psi)	4BE
(0 ... 60 psi)	(-11.5 psi)	(150 psi)	(580 psi)	4BF
(0 ... 100 psi)	(-14.5 psi)	(250 psi)	(580 psi)	4BG
(0 ... 150 psi)	(-14.5 psi)	(375 psi)	(870 psi)	4CA
(0 ... 200 psi)	(-14.5 psi)	(500 psi)	(1390 psi)	4CB
(0 ... 300 psi)	(-14.5 psi)	(750 psi)	(2170 psi)	4CD
(0 ... 500 psi)	(-14.5 psi)	(1250 psi)	(3480 psi)	4CE
(0 ... 750 psi)	(-14.5 psi)	(1875 psi)	(5220 psi)	4CF
(0 ... 1000 psi)	(-14.5 psi)	(2500 psi)	(5220 psi)	4CG
(0 ... 1500 psi)	(-14.5 psi)	(3750 psi)	(8700 psi)	4DA
(0 ... 2000 psi)	(-14.5 psi)	(5000 psi)	(13920 psi)	4DB
(0 ... 3000 psi)	(-14.5 psi)	(7500 psi)	(21750 psi)	4DD
(0 ... 5000 psi)	(-14.5 psi)	(12500 psi)	(34800 psi)	4DE
(0 ... 6000 psi)	(-14.5 psi)	(15000 psi)	(34800 psi)	4DF
(0 ... 8700 psi)	(-14.5 psi)	(21000 psi)	(52200 psi)	4DG

Other version, add order code and plain text: Measuring range: ... up to ... psi

Output signal

4 ... 20 mA; two-wire system; power supply 7 ... 33 V DC (10 ... 30 V DC for ATEX versions) ▶

0 ... 10 V; three-wire system; power supply 12 ... 33 V DC ▶

Explosion protection (only 4 ... 20 mA)

None ▶

With explosion protection EEx ia IIC T4 ▶

Electrical connection

Connector per DIN EN 175301-803-A, stuffing box thread M16 (with coupling) ▶

Round connector M12 per DIN EN 60139-9 (not for gauge pressure ranges ≤ 16 bar)

Connection via fixed mounted cable, 2 m (not for type of protection "Intrinsic safety i")

Cable quick screw connection PG9 (not for type of protection "Intrinsic safety i")

Connector per DIN EN 175301-803-A, stuffing box thread 1/2"-14 NPT (with coupling)

Connector per DIN EN 175301-803-A, stuffing box thread PG11 (with coupling)

Special version

▶ Available ex stock

Pressure Measurement

Transmitters for basic requirements

SITRANS P220
for gauge pressure


Selection and ordering data	Order No.	Order code
SITRANS P 220 pressure transmitters for gauge pressure, high-pressure and refrigeration applications, fully-welded version Accuracy typ. 0.25 % Wetted parts materials: stainless steel Non-wetted parts materials: stainless steel	D) 7MF1567 -	A
Process connection G½" male per EN 837-1 (½" BSP male) (standard for metric pressure ranges mbar, bar) G½" male thread and G1/8" female thread G¼" male per EN 837-1 (¼" BSP male) 7/16"-20 UNF male ¼"-18 NPT male (standard for pressure ranges inH ₂ O and psi) ¼"-18 NPT female (Only for measuring ranges ≤ 60 bar (870 psi)) ½"-14 NPT male ½"-14 NPT female (Only for measuring ranges ≤ 60 bar (870 psi)) 7/16"-20 UNF female M20x1.5 male Special version	►	A B C D E F G H J P Z P 1 Y
Version Standard version	►	1
Further designs Supplement the order no. with "-Z" and add order code. Manufacturer's test certificate M per DIN 55340, Part 18 and ISO 8402 (calibration certificate) supplied Oxygen application, oil and grease-free cleaning ► Available ex stock D) Subject to export regulations AL: N, ECCN: EAR99H.		C11 E10

Pressure Measurement


Transmitters for basic requirements

SITRANS P220
for gauge pressure

Dimensional drawings

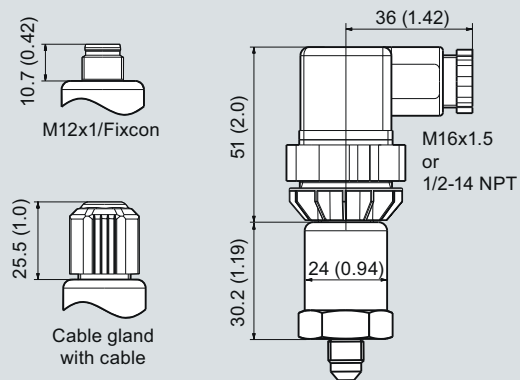

SITRANS P220, electrical connections, dimensions in mm (inch)

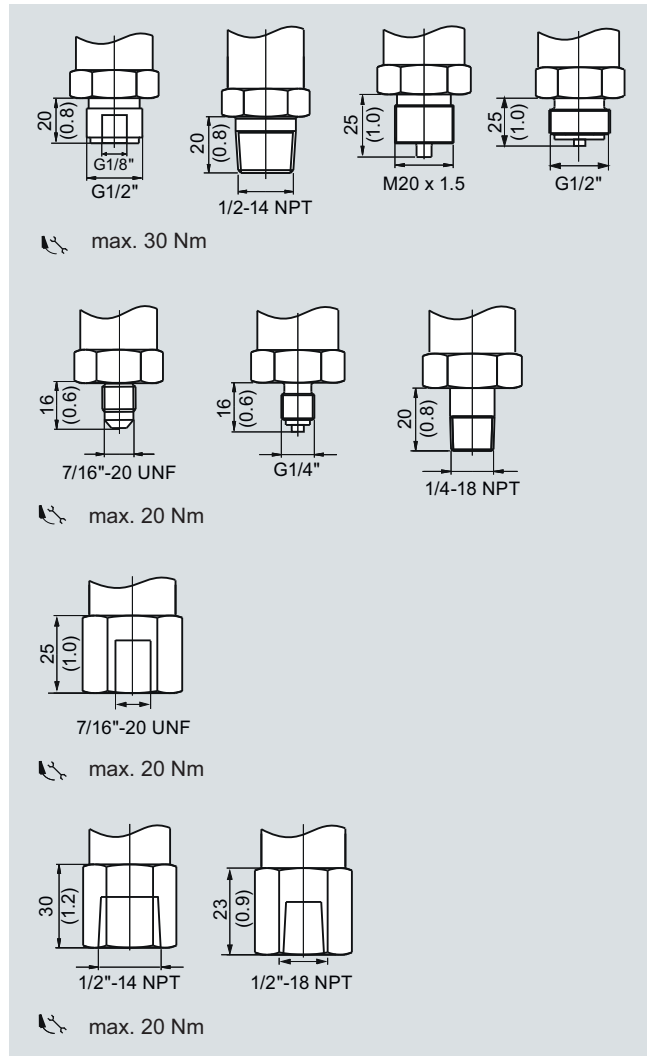


SITRANS P220, process connections, dimensions in mm (inch)

Pressure Measurement


Transmitters for basic requirements

SITRANS P220
for gauge pressure


Schematics

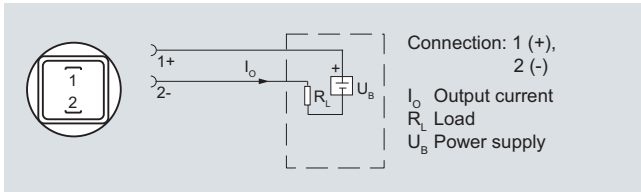


Connection with current output and connector per EN 175301

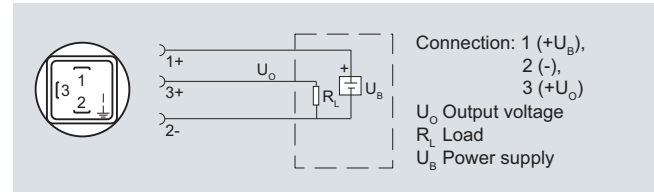


Connection with voltage output and connector per EN 175301

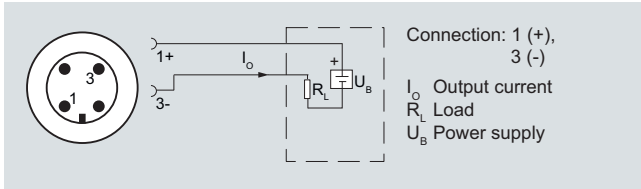


Connection with current output and connector M12x1

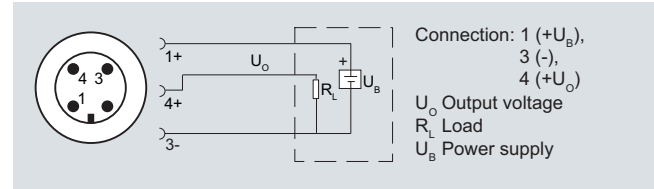


Connection with voltage output and connector M12x1

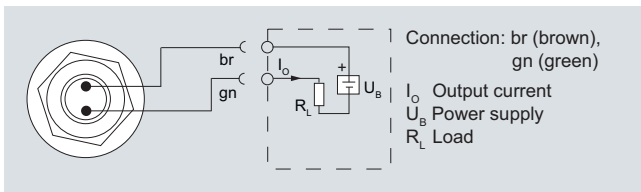


Connection with current output and cable

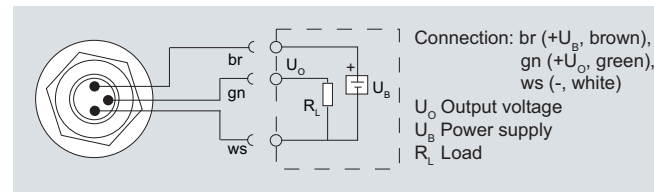

Connection with voltage output and cable

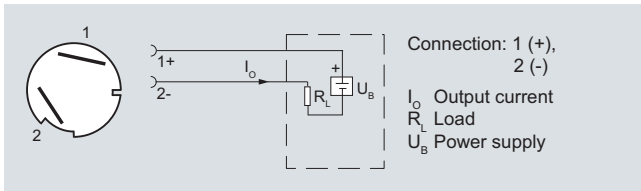


Connection with current output and cable quick screw connection

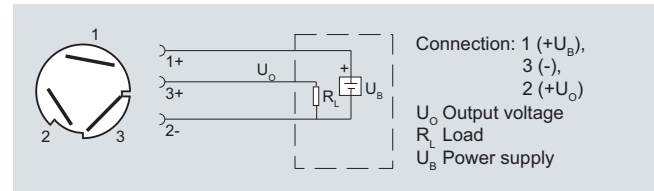


Connection with voltage output and cable quick screw connection

Version with explosion protection: 4 ... 20 mA

The grounding connection is conductively bonded to the transmitter enclosure

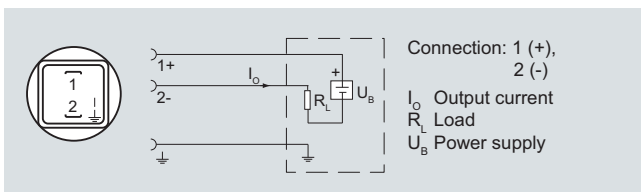

Connection with current output and connector per EN 175301 (Ex)

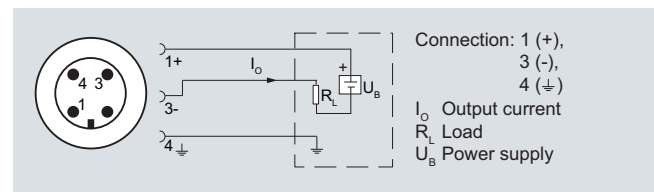

Connection with current output and connector M12x1 (Ex)