

MODULAR CONNECTORS




Dip Type

CL 222 TM


Straight Dip Type

● TM3R-6-*(50)

CL No.	Part No.	RoHS
222-0114-3-50	TM3R-66(50)	YES
222-0071-2-50	TM3R-64(50)	

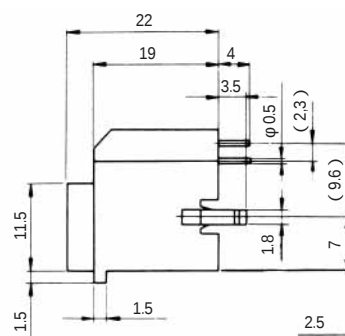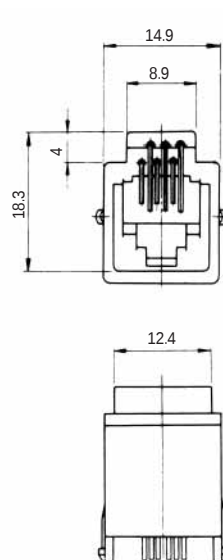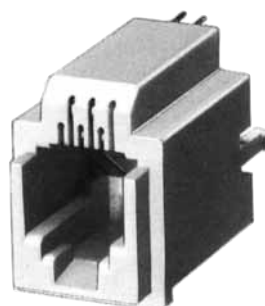

PCB mounting hole layout
(Connector mounting side)



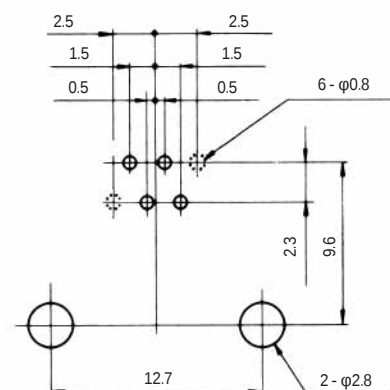


Note1: Standard finish color is vanilla white.

Note2: The drawing is shown sample of TM3R-66(50).


● TM3RA-*(50)

CL No.	Part No.	A	B	C	RoHS
222-0521-7-50	TM3RA-44(50)	12.9	6.9	10.4	YES
222-0567-8-50	TM3RA-62(50)	14.9	8.9	12.4	
222-0584-7-50	TM3RA-64(50)	14.9	8.9	12.4	
222-0770-1-50	TM3RA-66(50)	14.9	8.9	12.4	

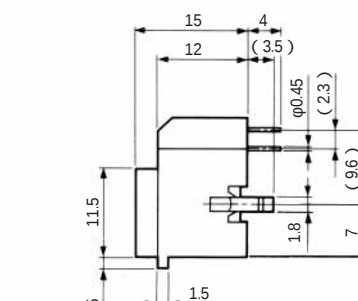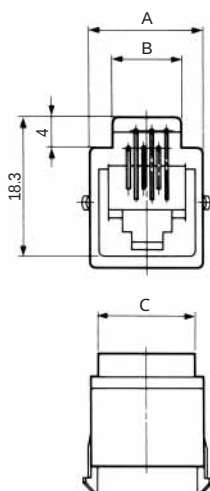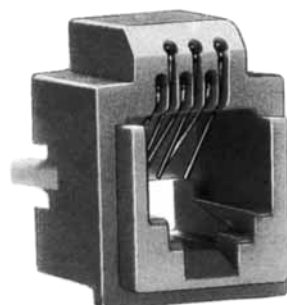

PCB mounting hole layout
(Connector mounting side)

TM3RA-44


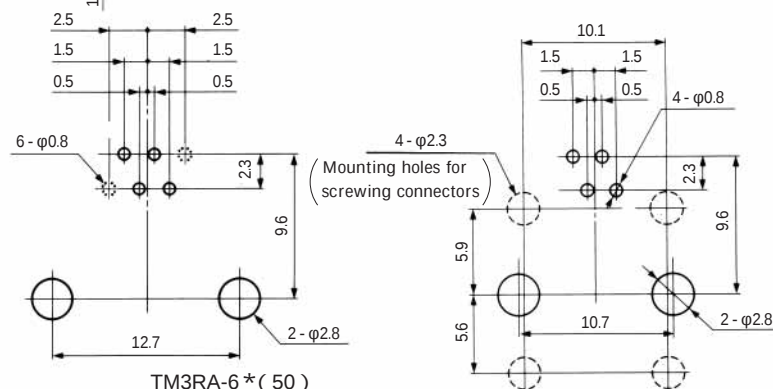


Note1: Standard finish color is vanilla white.




Note2: The drawing is shown sample of TM3RA-66(50).

CL 222 TM



Note1: (50)Stick packaging... 27 units.
Note2: Standard finish color is vanilla white.

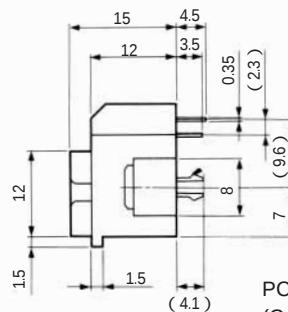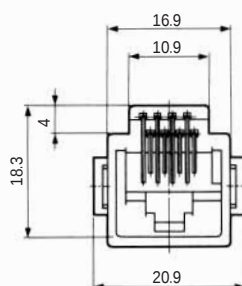

PCB mounting hole layout
(Connector mounting side)

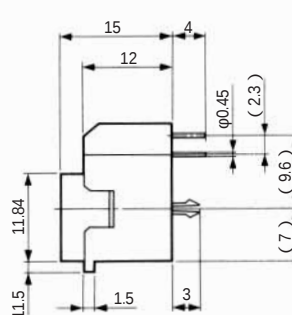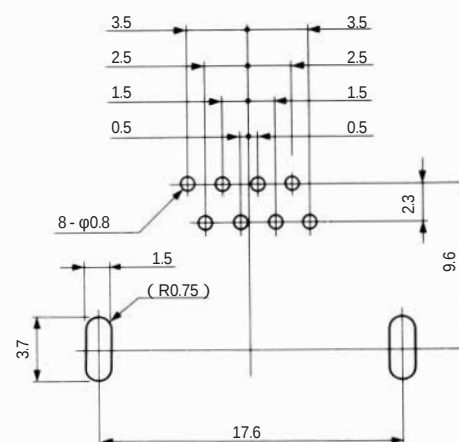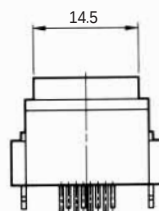

PCB mounting hole layout
(Connector mounting side)

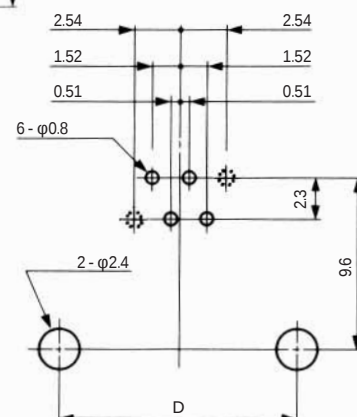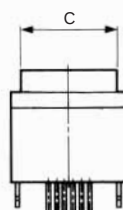

Note3: The drawing is shown sample of TM3RA1-66(67).



MODULAR CONNECTORS

CL 222 TM


Gang-Jacks Straight Dip Type

• TM2RE-06 * *(50)


CL No.	Part No.	RoHS
222-1286-4-50	TM2RE-0602(50)	YES
222-1391-9-50	TM2RE-0604(50)	
222-1422-0-50	TM2RE-0606(50)	

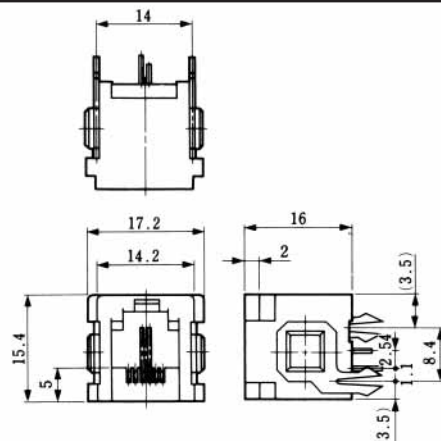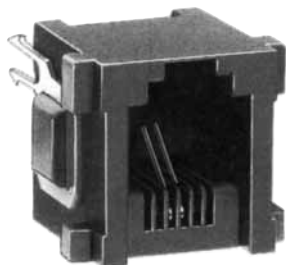


PCB mounting hole layout
(Connector mounting side)

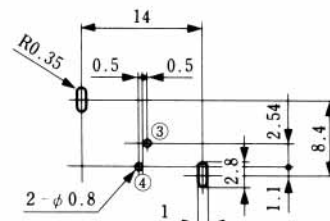

TM2RE-0602(50)

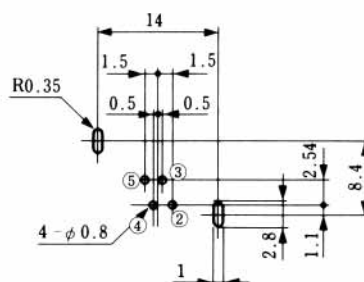

TM2RE-0604(50)

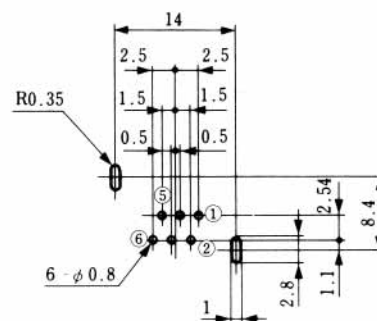


TM2RE-0606(50)

Note 1: Standard finish color is gray.


Note 2: The drawing is shown sample of TM2RE-0602(50).

• TM2RE-12 * *(50)


CL No.	Part No.	RoHS
222-0592-5-50	TM2RE-1204(50)	YES
222-0756-0-50	TM2RE-1208(50)	
222-0757-3-50	TM2RE-1212(50)	

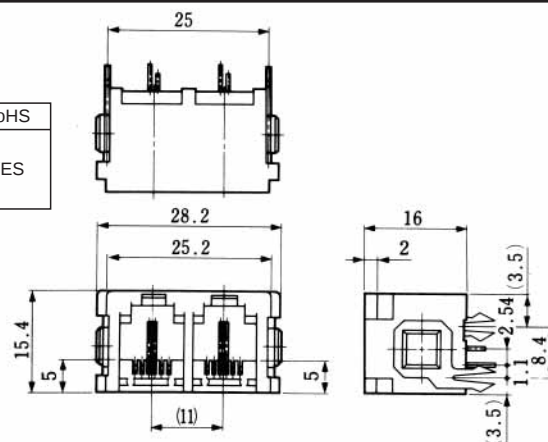


PCB mounting hole layout
(Connector mounting side)

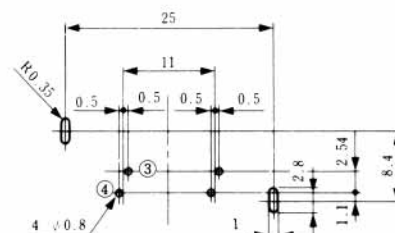

TM2RE-1204(50)

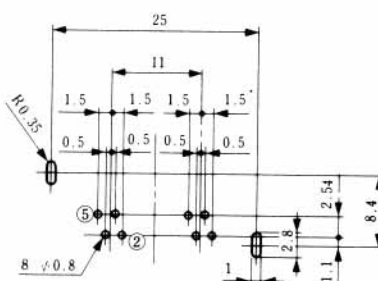

TM2RE-1208(50)

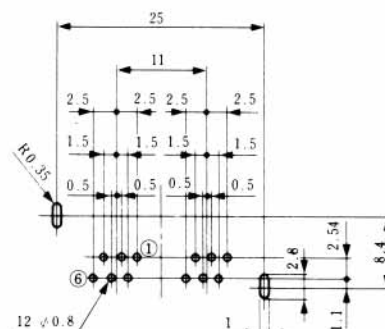




TM2RE-1212(50)

Note 1: Standard finish color is gray.


Note 2: The drawing is shown sample of TM2RE-1204(50).

● TM2RE-18 * *(50)


CL No.	Part No.	RoHS
222-0591-2-50	TM2RE-1806(50)	YES
222-0753-2-50	TM2RE-1812(50)	
222-0796-5-50	TM2RE-1818(50)	

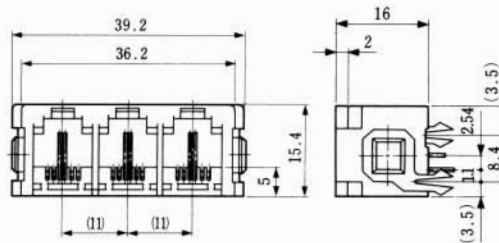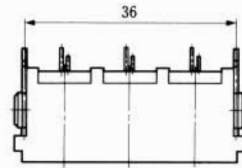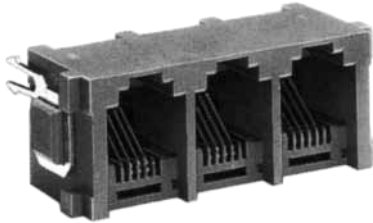


PCB mounting hole layout
(Connector mounting side)

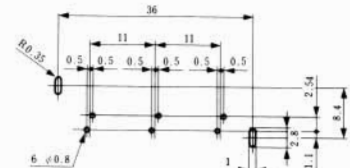

TM2RE-1806(50)

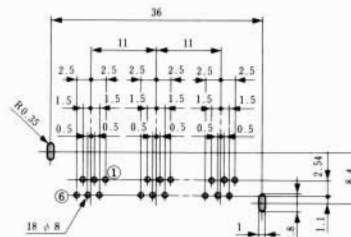

TM2RE-1818(50)

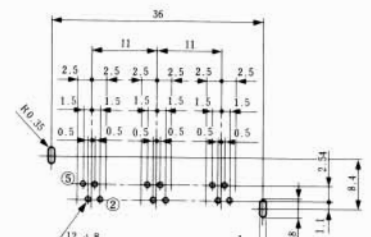




TM2RE-1812(50)

Note 1: Standard finish color is gray.


Note 2: The drawing is shown sample of TM2RE-1806(50).

● TM2RE-24 * *(50)


CL No.	Part No.	RoHS
222-0797-8-50	TM2RE-2408(50)	YES
222-0590-0-50	TM2RE-2416(50)	
222-0751-7-50	TM2RE-2424(50)	

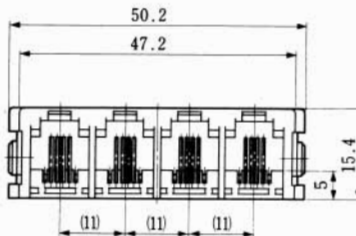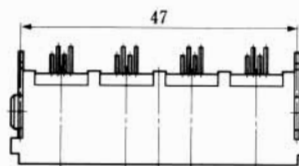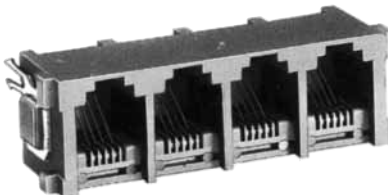


PCB mounting hole layout (Connector mounting side)

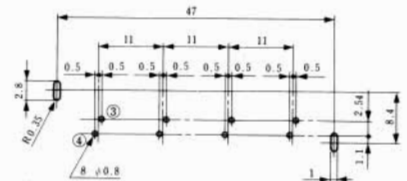

TM2RE-2408(50)

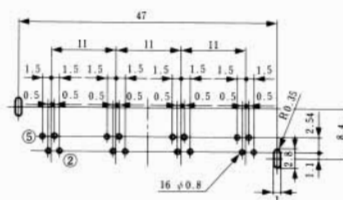

TM2RE-2416(50)

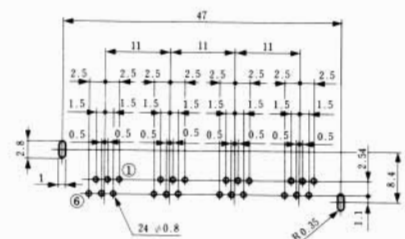

TM2RE-2424(50)

Note 1: Standard finish color is gray.






Note 2: The drawing is shown sample of TM2RE-2416(50).

MODULAR CONNECTORS

CL 222 TM

• TM3RA1-1010A(50)

CL No.	Part No.	RoHS
222-2526-1-50	TM3RA1-1010A(50)	YES

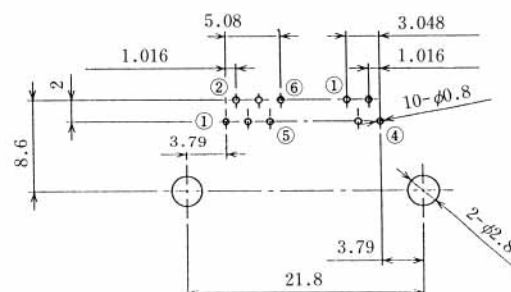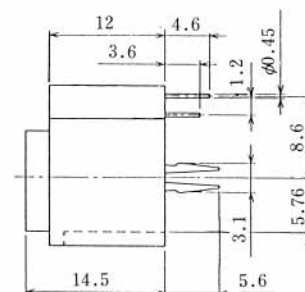
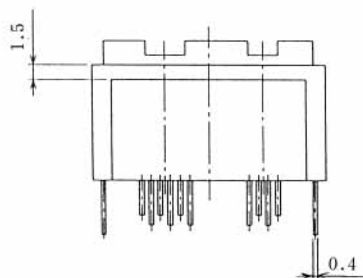
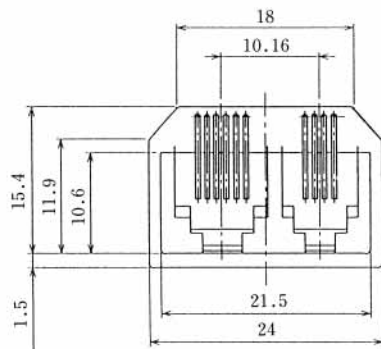
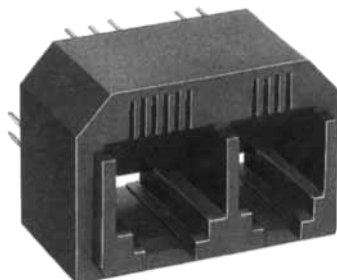


PCB mounting hole layout
(Connector mounting side)


Note : Standard finish color is black.

• TM3RB1-1010(50)

CL No.	Part No.	RoHS
222-2598-2-50	TM3RB1-1010(50)	YES

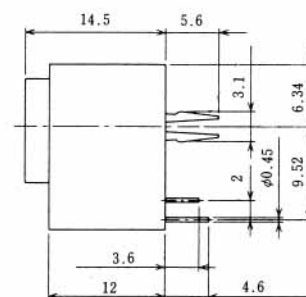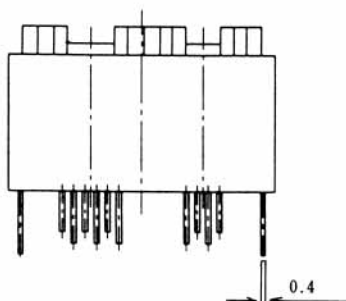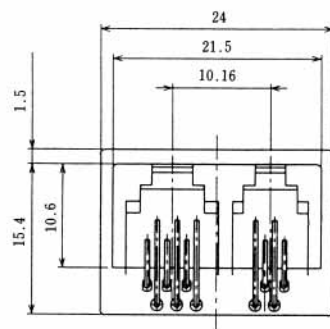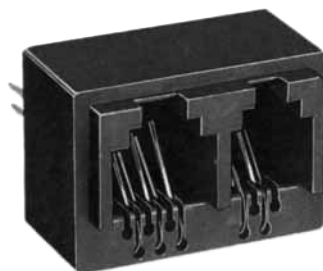

PCB mounting hole layout
(Connector mounting side)

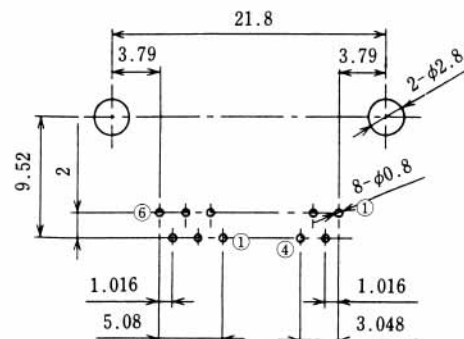

Note : Standard finish color is black.

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Hirose Electric:

[TM5RE1-64\(21\)](#) [TM5RE2-64\(60\)](#) [TM5RE2-66\(50\)](#) [TM5RF1-44\(60\)](#) [TM5RJ1-64\(52\)](#) [TM3RA1-64\(60\)](#) [TM5RF-66](#)
[TM5RJ2-64](#) [TM5RJ2-66\(52\)](#) [TM5RJ3-64\(51\)](#) [TM5RJ2-62\(51\)](#) [TM5RJ2-62\(52\)](#) [TM5RJ3-62\(51\)](#) [TM5RF-62\(50\)](#)
[TM2REA-1206-24\(121\)\(50\)](#) [TM5RE3V-66\(20\)](#) [TM5RE2V-62\(20\)](#) [TM5RE2V-64\(20\)](#) [TM5RE2V-66\(20\)](#) [TM5RE3V-](#)
[88\(20\)](#) [TM5RF2-44\(60\)](#) [TM5RE3V-1204\(20\)](#) [TM5RJ3-64A\(50\)](#) [TM5RJ1-1818\(50\)](#) [TM5RL-8\(62\)-FT\(50\)](#) [TM5RQ-](#)
[2012-822\(50\)](#) [TM5RJ2A-64](#) [TM2REAX-1816-664\(50\)](#) [TM5RE3V-1208\(20\)](#) [TM5RJ3-84\(50\)](#) [TM5RL-88-JJ](#) [TM5RL-](#)
[88-JJ\(55\)](#) [TM2REA-1208-62\(50\)](#) [TM5RSB-1608\(50\)](#) [TM2REAX-2408\(53\)](#) [TM2REAX-2416\(50\)](#) [TM5RE3X-62\(20\)](#)
[TM5RF1X-44\(50\)](#) [TM5RJX-88](#) [TM5RJ1X-88\(50\)](#) [TM5RJ3X-44\(50\)](#) [TM5RJ3X-64\(50\)](#) [TM5RJ3X-64\(51\)](#) [TM5RJ3X-](#)
[66\(50\)](#) [TM5RJ3X-88\(51\)](#) [TM5RSBX-2424\(50\)](#) [TM5RE2VX-66\(20\)](#) [TM5RE2X-66\(20\)](#) [TM5RU1X-62](#) [TM5RU1X-66](#)
[TM2RE-1204\(51\)](#) [TM3RB1-1010\(50\)](#) [TM5RC-88-FT\(50\)](#) [TM3RB1-1008\(50\)](#) [TM5RJ-66\(51\)](#)